

Weighing systems

Weighing terminal SIWAREX WT231

Operating Instructions

7MH4965-2AA01 (not legal-for-trade)

Introduction

1

Safety notes

2

Description

3

Installation

4

Connecting

5

Commissioning

6

Messages

7

Command lists

8

Communication via
Modbus

9

Scale parameters and
functions

10

Technical specifications

11

Ordering data

12

Dimension drawings

13

ESD guidelines

A

Product documentation
and support

B

Abbreviations

C

Legal information

Warning notice system

This manual contains notices you have to observe in order to ensure your personal safety, as well as to prevent damage to property. The notices referring to your personal safety are highlighted in the manual by a safety alert symbol, notices referring only to property damage have no safety alert symbol. These notices shown below are graded according to the degree of danger.

DANGER

indicates that death or severe personal injury **will** result if proper precautions are not taken.

WARNING

indicates that death or severe personal injury **may** result if proper precautions are not taken.

CAUTION

indicates that minor personal injury can result if proper precautions are not taken.

NOTICE

indicates that property damage can result if proper precautions are not taken.

If more than one degree of danger is present, the warning notice representing the highest degree of danger will be used. A notice warning of injury to persons with a safety alert symbol may also include a warning relating to property damage.

Qualified Personnel

The product/system described in this documentation may be operated only by **personnel qualified** for the specific task in accordance with the relevant documentation, in particular its warning notices and safety instructions. Qualified personnel are those who, based on their training and experience, are capable of identifying risks and avoiding potential hazards when working with these products/systems.

Proper use of Siemens products

Note the following:

WARNING

Siemens products may only be used for the applications described in the catalog and in the relevant technical documentation. If products and components from other manufacturers are used, these must be recommended or approved by Siemens. Proper transport, storage, installation, assembly, commissioning, operation and maintenance are required to ensure that the products operate safely and without any problems. The permissible ambient conditions must be complied with. The information in the relevant documentation must be observed.

Trademarks

All names identified by ® are registered trademarks of Siemens Aktiengesellschaft. The remaining trademarks in this publication may be trademarks whose use by third parties for their own purposes could violate the rights of the owner.

Disclaimer of Liability

We have reviewed the contents of this publication to ensure consistency with the hardware and software described. Since variance cannot be precluded entirely, we cannot guarantee full consistency. However, the information in this publication is reviewed regularly and any necessary corrections are included in subsequent editions.

Table of contents

1	Introduction	11
1.1	Purpose of this documentation	11
1.2	Document history	11
1.3	Validity of the documentation	11
1.4	Designated use	11
1.5	Checking the consignment.....	11
1.6	Scope of delivery	12
1.7	Industrial use note	12
1.8	Cybersecurity information	12
1.9	Transportation and storage	13
1.10	Notes on warranty	13
2	Safety notes	15
2.1	Prerequisites for safe use.....	15
2.1.1	Laws and directives	15
2.1.2	Conformity with European directives	15
2.2	Requirements for special applications.....	16
2.3	Improper commissioning	16
2.4	Service and maintenance	16
3	Description.....	19
3.1	Area of application.....	19
3.2	Design	20
4	Installation.....	23
4.1	Wall mounting	23
4.2	EMC-compliant setup	23
4.2.1	Introduction.....	23
4.2.2	Possible effects of interference	24
4.2.3	Coupling mechanisms	24
4.3	Five basic rules for securing EMC	24
5	Connecting	27
5.1	Basic safety instructions	27
5.1.1	Transient overvoltages	27
5.2	Requirements	28
5.3	Color coding of cables.....	28

5.4	230 V AC connection	29
5.5	24 V DC connection	30
5.6	Connection of analog load cells.....	31
5.6.1	Connect load cells to the weighing terminal	31
5.6.2	Connecting the cable	33
5.7	Connection of digital outputs (4 x DQ)	34
5.8	Connection of digital inputs (4 x DI)	35
5.9	Connection of the analog output (1 x AQ)	36
5.10	Connection of RS485 serial interface	36
5.11	Connection of Siebert display via RS485	37
5.12	Connection of digital load cells from the Wipotec company.....	37
5.12.1	Electrical connection of load cells with plug-in connection.....	38
5.12.2	Electrical connection of load cells with terminal block (SW-D-FS series)	38
5.13	Connection of digital load cells from the Mettler-Toledo company.....	40
5.14	Connection of the SIWAREX DB	42
5.14.1	Connecting SIWAREX DB	42
5.14.2	Connect the cable	43
6	Commissioning	45
6.1	Introduction.....	45
6.2	Commissioning via Quick Start	45
6.2.1	Start	45
6.2.2	Standard parameter settings	46
6.2.3	Selecting the calibration method.....	47
6.2.4	Defining the calibration weights.....	48
6.2.5	Setting calibration points	49
6.2.6	Calibrating the scale automatically	50
6.2.7	Performing the automatic calibration	51
6.2.8	Checking the scale following calibration	51
6.3	Operating view	52
6.4	Menu structure	53
6.5	Menu 1.0 Setup	53
6.5.1	Menu 1.1 Recalibration	53
6.5.2	Menu 1.2 Quick Start	54
6.5.3	Menu 1.3 Limits.....	54
6.5.4	Menu 1.4 Advanced scale parameters	55
6.5.5	Menu 1.5 Communication & interfaces	56
6.5.6	Menu 1.6 Recovery point	60
6.6	Menu 2.0 Diagnostics	61
6.6.1	Menu 2.1 Messages	61
6.6.2	Menu 2.2 Scale status	61
6.6.3	Menu 2.3 Load trend	65
6.6.4	Menu 2.4 Module information	65
6.6.5	Menu 2.5 Start / stop trace	65

6.6.6	Menu 2.6 Increased resolution	66
6.7	Menu 3.0 Language, Date & Time	66
6.8	Menu 4.0 User administration	66
6.9	Screen saver	68
7	Messages	69
7.1	Message types	69
7.2	Message paths	69
7.3	Evaluating messages with the help of SIWATOOL	70
7.4	Message list	70
7.4.1	System status message list	70
7.4.2	Technology error message list	71
7.4.3	Data and operating errors message list	71
7.4.4	Messages by LEDs on the electronic weighing system	73
8	Command lists	75
8.1	Overview	75
8.2	Command lists	75
8.3	Command groups of the electronic weighing system	80
9	Communication via Modbus	81
9.1	Principle of data transmission	81
9.2	Data record concept	82
9.3	Command mailboxes	82
9.4	Reading registers	83
9.5	Writing registers	84
10	Scale parameters and functions	85
10.1	Parameters and functions	85
10.2	Assigning parameters to the electronic weighing system with SIWAREX DB	85
10.3	DR 2 command code	86
10.4	DR 3 calibration parameters	86
10.4.1	Scale name	91
10.4.2	Unit of weight	91
10.4.3	Gross identifier	91
10.4.4	Load cell type	92
10.4.5	Code for regulations	92
10.4.6	Minimum weighing range	92
10.4.7	Maximum weighing range	92
10.4.8	Calibration weights 0, 1, 2 and calibration digits 0, 1, 2	93
10.4.9	Scale interval	93
10.4.10	Zero by power-on	93
10.4.11	Zero by power-on when tare $\neq$ 0	93
10.4.12	Automatic zero adjustment	93
10.4.13	Subtractive / additive tare device	94

10.4.14	Weight simulation.....	94
10.4.15	Decimal places for process values.....	94
10.4.16	Maximum tare load.....	94
10.4.17	Maximum negative zero setting limit (power-on).....	95
10.4.18	Maximum positive zero setting limit (power-on).....	95
10.4.19	Maximum negative zero setting limit (semi-automatically).....	95
10.4.20	Maximum positive zero setting limit (semi-automatically).....	95
10.4.21	Standstill range.....	95
10.4.22	Standstill time.....	96
10.4.23	Standstill waiting time.....	96
10.4.24	Low-pass cut-off frequency.....	97
10.4.25	Low-pass filter number.....	97
10.4.26	Low-pass filter limit frequency (commissioning).....	97
10.4.27	Low-pass filter number (commissioning).....	98
10.4.28	Mean value filter depth.....	98
10.4.29	Display weighing range data.....	98
10.4.30	Interface for legal trade display.....	98
10.4.31	Firmware version SecureDisplay.....	98
10.4.32	Minimum display size [%].....	98
10.5	Calibration procedure.....	99
10.5.1	Calibration with calibration weights.....	99
10.5.2	Automatic calibration.....	101
10.6	DR 4 Output of calculated calibration digits.....	102
10.6.1	Calibration digits 0, 1, 2 (calculated).....	103
10.7	DR 5 zeroing memory.....	103
10.7.1	Effective tare weight - from specification 1, 2 or 3.....	104
10.7.2	Effective tare weight (semi-automatic).....	104
10.7.3	Zero by power-on (value when switching on).....	104
10.7.4	Zero weight (semi-automatic).....	105
10.7.5	Current zero tracking weight.....	105
10.7.6	Dead load.....	105
10.8	DR 6 limit value settings.....	105
10.8.1	Limit reference.....	107
10.8.2	Limit value 1 ON, limit value 2 ON, limit value 1 OFF, limit value 2 OFF.....	107
10.8.3	Delay time for limit value 1 ON, delay time for limit value 2 ON.....	108
10.8.4	Delay time for limit value 1 OFF, delay time for limit value 2 OFF.....	108
10.8.5	Limit value "Empty" ON.....	108
10.8.6	Delay time for limit value "Empty" ON.....	109
10.9	DR 7 interface parameters.....	109
10.9.1	Assignment for digital input 0, 1, 2, 3.....	112
10.9.2	Input filtering (hardware setting).....	113
10.9.3	Assignment for digital output 0, 1, 2, 3.....	113
10.9.4	Response of digital outputs to faults or SIMATIC STOP.....	113
10.9.5	Substitute value for DQ 0, 1, 2, 3 following fault or SIMATIC STOP.....	114
10.9.6	Analog output range.....	114
10.9.7	Analog output source.....	115
10.9.8	Response of analog output to faults or SIMATIC STOP.....	115
10.9.9	Start value for the analog output.....	115
10.9.10	End value for the analog output.....	115
10.9.11	Output value following fault or SIMATIC STOP.....	115

10.9.12	Trace recording cycle.....	116
10.9.13	Trace storage method	116
10.10	DR 8 date and time	116
10.11	DR 9 module information	117
10.12	DR 10 load cell parameters.....	118
10.12.1	50/60 Hz toggling	119
10.12.2	Number of support points	119
10.12.3	Load cell characteristic value	120
10.12.4	Rated load of a load cell	120
10.13	DR 12 Ethernet parameters	120
10.13.1	Device MAC address	122
10.13.2	Port MAC address	122
10.13.3	IP address	122
10.13.4	Subnet mask	123
10.13.5	Gateway	123
10.13.6	Device name	123
10.13.7	Byte/Word swap options	123
10.14	DR 13 RS485 parameters	123
10.14.1	RS485 protocol	125
10.14.2	RS485 baud rate	125
10.14.3	RS485 character parity	125
10.14.4	RS485 number of data bits	125
10.14.5	RS485 number of stop bits	125
10.14.6	Byte/Word swap options	126
10.14.7	RS485 Modbus address	126
10.14.8	Decimal place for Siebert indicator	126
10.14.9	MODBUS RTU response delay	126
10.15	DR 15 tare settings	126
10.15.1	Specification of tare weight 1, 2, 3	127
10.16	DR 16 simulation value	127
10.16.1	Weight simulation specification	128
10.17	DR 17 analog output control specifications	128
10.17.1	Analog output specification	129
10.18	DR 18 digital output control specifications	129
10.18.1	Specification for digital output 0, 1, 2, 3	130
10.19	DR 30 current process values	131
10.19.1	Gross process weight	133
10.19.2	Net process weight	134
10.19.3	Tare process weight	134
10.19.4	Gross / net weight	134
10.19.5	Gross / net weight with increased resolution (x 10)	134
10.19.6	Tare weight	134
10.19.7	Gross process weight (commissioning aid)	134
10.19.8	Net process weight (commissioning aid)	134
10.19.9	Refresh counter for process values	134
10.19.10	Last report ID	135
10.20	DR 31 advanced current process values	135

10.20.1	Unfiltered digit value	136
10.20.2	Filtered digit value	136
10.20.3	Filtered digit value (commissioning aid)	136
10.20.4	Digits for analog output	136
10.20.5	Current status of input 0, 1, 2, 3.....	136
10.20.6	Current status of digital output 0, 1, 2, 3	137
10.20.7	Refresh counter for process values	137
10.20.8	Current load cell signal in mV	137
10.21	DR 32 display of data and operator errors	137
10.21.1	Data and operator errors, bytes 0 to 7	139
10.21.2	Modbus RTU error code.....	139
10.21.3	Modbus Ethernet error code.....	139
10.21.4	SIWATOOL error code	140
10.21.5	Error code following commands at digital input.....	140
10.22	DR 34 ASCII main display value.....	140
10.22.1	Content of main display as ASCII string	140
10.23	DR 45 protocol request.....	141
10.23.1	Protocol ID to be read.....	142
10.24	DR 46 protocol contents	142
10.24.1	Oldest protocol ID	144
10.24.2	Newest protocol ID.....	144
10.24.3	Selected protocol ID, numeric.....	144
10.24.4	Gross / net identifier	144
10.24.5	G/N weight	144
10.24.6	Unit of weight.....	144
10.24.7	Tare identification	144
10.24.8	Date, time.....	145
10.25	DR 47 logbook	145
10.26	DR 48 date and time 2 (for Modbus).....	146
10.27	DR 59 Parameter string digital load cell	147
10.28	DR 70 SIWAREX DB parameter	147
10.29	DR 80 SIWAREX DB process status.....	149
10.30	DR 81 SIWAREX DB process status advanced	151
10.31	DR 82 SIWAREX DB device information	153
11	Technical specifications	155
11.1	Power supply	155
11.2	Analog load cell interface connection	155
11.3	Rated conditions	159
11.4	Dimensions and weights	159
11.5	Electrical, EMC and climatic requirements.....	160
11.5.1	Electrical protection and safety requirements.....	160
11.5.2	Electromagnetic compatibility	161
11.5.3	Ambient conditions.....	162

12	Ordering data	163
13	Dimension drawings	165
13.1	Drilling template	165
A	ESD guidelines	167
A.1	ESD Guidelines.....	167
B	Product documentation and support	169
B.1	Product documentation	169
B.2	Technical support.....	169
C	Abbreviations.....	171
	Index	173

Introduction

1.1 Purpose of this documentation

These instructions are a brief summary of important features, functions and safety information, and contain all information required for safe use of the device. Read the instructions carefully prior to installation and commissioning. In order to use the device correctly, first review its principle of operation.

The instructions are aimed at persons who install and commission the device.

To realize optimum performance from the device, read the complete operating instructions.

1.2 Document history

The overview below summarizes the most important changes in the documentation when compared to the previous edition.

Edition	Note
08/2023	Safety instructions updated
01/2022	SIWAREX DB added

1.3 Validity of the documentation

This document is valid for:

Table 1-1 Scope

Type designation	Order No.	as of version		HMI project
SIWAREX WT231	7MH4965-2AA01	FS:08	FW: V4.0.2	V3.2.0

1.4 Designated use

Use the device in accordance with the information on the nameplate and in the Technical specifications (Page 155).

1.5 Checking the consignment

1. Check the packaging and the delivered items for visible damages.
2. Report any claims for damages immediately to the shipping company.

3. Retain damaged parts for clarification.
4. Check the scope of delivery by comparing your order to the shipping documents for correctness and completeness.

**WARNING****Using a damaged or incomplete device**

Risk of explosion in hazardous areas.

- Do not use damaged or incomplete devices.

1.6 Scope of delivery

The following are included in the scope of delivery:

- Weighing terminal
- Preassembled wall-mounting bracket
- M20 -> M16 reducing ring
- M16 cable gland

1.7 Industrial use note

NOTICE**Use in a domestic environment**

This Class A Group 1 equipment is intended for use in industrial areas.

In a domestic environment this device may cause radio interference.

1.8 Cybersecurity information

Siemens provides products and solutions with industrial cybersecurity functions that support the secure operation of plants, systems, machines and networks.

In order to protect plants, systems, machines and networks against cyber threats, it is necessary to implement – and continuously maintain – a holistic, state-of-the-art industrial cybersecurity concept. Siemens' products and solutions constitute one element of such a concept.

Customers are responsible for preventing unauthorized access to their plants, systems, machines and networks. Such systems, machines and components should only be connected to an enterprise network or the internet if and to the extent such a connection is necessary and only when appropriate security measures (e.g. firewalls and/or network segmentation) are in place.

For additional information on industrial cybersecurity measures that may be implemented, please visit <https://www.siemens.com/global/en/products/automation/topic-areas/industrial-cybersecurity.html>.

Siemens' products and solutions undergo continuous development to make them more secure. Siemens strongly recommends that product updates are applied as soon as they are available and that the latest product versions are used. Use of product versions that are no longer supported, and failure to apply the latest updates may increase customer's exposure to cyber threats.

To stay informed about product updates, subscribe to the Siemens Industrial Cybersecurity RSS Feed under <https://new.siemens.com/global/en/products/services/cert.html>.

1.9 Transportation and storage

To guarantee sufficient protection during transport and storage, observe the following:

- Keep the original packaging for subsequent transportation.
- Devices/replacement parts should be returned in their original packaging.
- If the original packaging is no longer available, ensure that all shipments are properly packaged to provide sufficient protection during transport. Siemens cannot assume liability for any costs associated with transportation damages.

NOTICE
Insufficient protection during storage
The packaging only provides limited protection against moisture and infiltration.
• Provide additional packaging as necessary.

Special conditions for storage and transportation of the device are listed in Technical specifications (Page 155).

1.10 Notes on warranty

The contents of this manual shall not become part of or modify any prior or existing agreement, commitment or legal relationship. The sales contract contains all obligations on the part of Siemens as well as the complete and solely applicable warranty conditions. Any statements regarding device versions described in the manual do not create new warranties or modify the existing warranty.

The content reflects the technical status at the time of publishing. Siemens reserves the right to make technical changes in the course of further development.

Safety notes

2.1 Prerequisites for safe use

This device left the factory in good working condition. In order to maintain this status and to ensure safe operation of the device, observe these instructions and all the specifications relevant to safety.

Observe the information and symbols on the device. Do not remove any information or symbols from the device. Always keep the information and symbols in a completely legible state.

2.1.1 Laws and directives

Observe the safety rules, provisions and laws applicable in your country during connection, assembly and operation. These include, for example:

- National Electrical Code (NEC - NFPA 70) (USA)
- Canadian Electrical Code (CEC) (Canada)

Further provisions for hazardous area applications are for example:

- IEC 60079-14 (international)
- EN 60079-14 (EU)

2.1.2 Conformity with European directives

The CE mark on the device is a sign of conformity with the following European directives:

Electromagnetic compatibility EMC 2014/30/EU	Directive of the European Parliament and of the Council on the harmonization of the laws of the Member States relating to electromagnetic compatibility
Low voltage directive LVD 2014/35/EU	Directive of the European Parliament and of the Council on the harmonization of the laws of Member States relating to electrical equipment designed for use within certain voltage limits on the market
Measuring instruments directive MID 2014/32/EU	Directive of the European Parliament and of the Council on the harmonization of the laws of the Member States relating to the making available on the market of pressure equipment on the market

The applicable directives can be found in the EU conformity declaration of the specific device.



WARNING

Improper device modifications

Risk to personnel, system and environment can result from modifications to the device, particularly in hazardous areas.

- Only carry out modifications that are described in the instructions for the device. Failure to observe this requirement cancels the manufacturer's warranty and the product approvals.

2.2 Requirements for special applications

Due to the large number of possible applications, each detail of the described device versions for each possible scenario during commissioning, operation, maintenance or operation in systems cannot be considered in the instructions. If you need additional information not covered by these instructions, contact your local Siemens office or company representative.

Note

Operation under special ambient conditions

We highly recommend that you contact your Siemens representative or our application department before you operate the device under special ambient conditions as can be encountered in nuclear power plants or when the device is used for research and development purposes.

2.3 Improper commissioning



WARNING

Improper commissioning

Before commissioning, make sure that the machine in which the device is installed complies with the regulations or specifications of the Machinery Directive 2006/42/EC.

2.4 Service and maintenance

Note

The device is maintenance-free.

**WARNING****Impermissible repair of the device**

- Repair must be carried out by Siemens authorized personnel only.

Description

3.1 Area of application

The described weighing terminal is the optimal solution wherever signals from weighing sensors or force transducers are to be acquired and processed. The SIWAREX WT231 is equipped for the following applications:

- Fill-level monitoring of silos and hoppers
- Platform scales

The electronic weighing system of the weighing terminal is used to measure and register the current weight value. You have the possibility to start the electronic weighing system directly on the Touch Panel of the weighing terminal. You can also connect the weighing terminal or the electronic weighing system to any automation environment or to a PC via Modbus RTU.

Note

SIWAREX WT231 is not approved for operation requiring official calibration.

3.2 Design

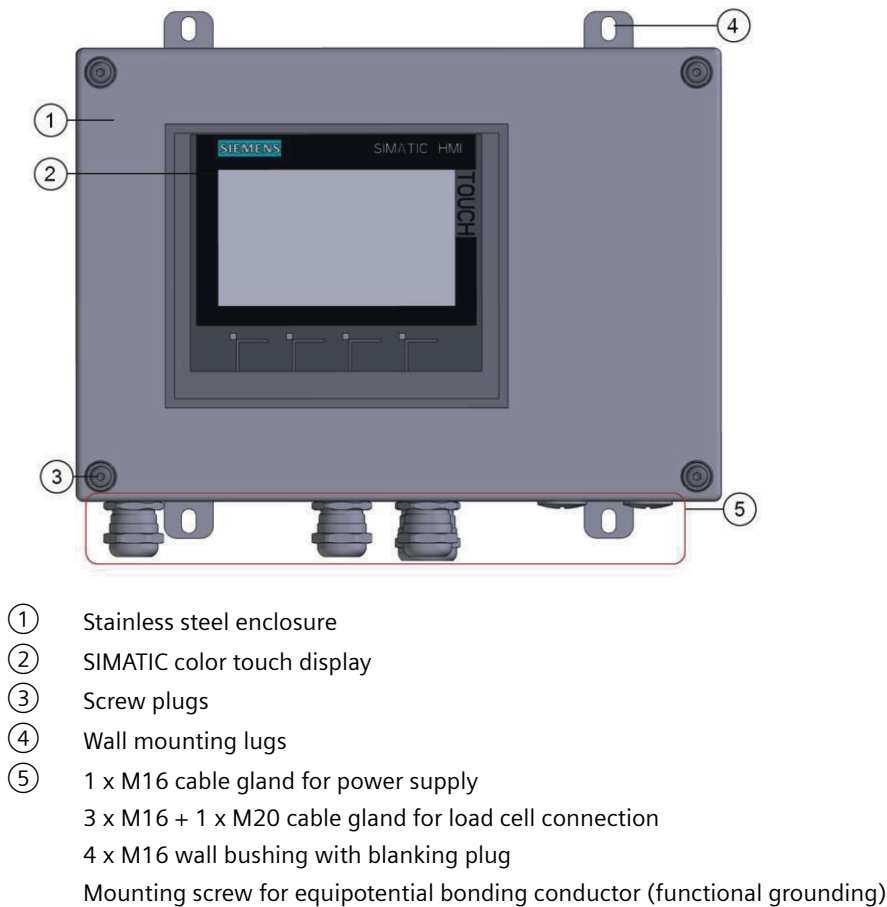


Figure 3-1 Front view


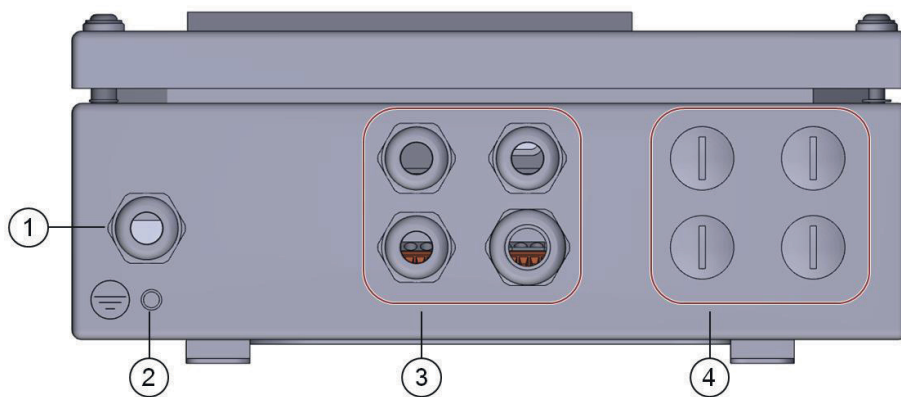


Figure 3-2 Underside with connections

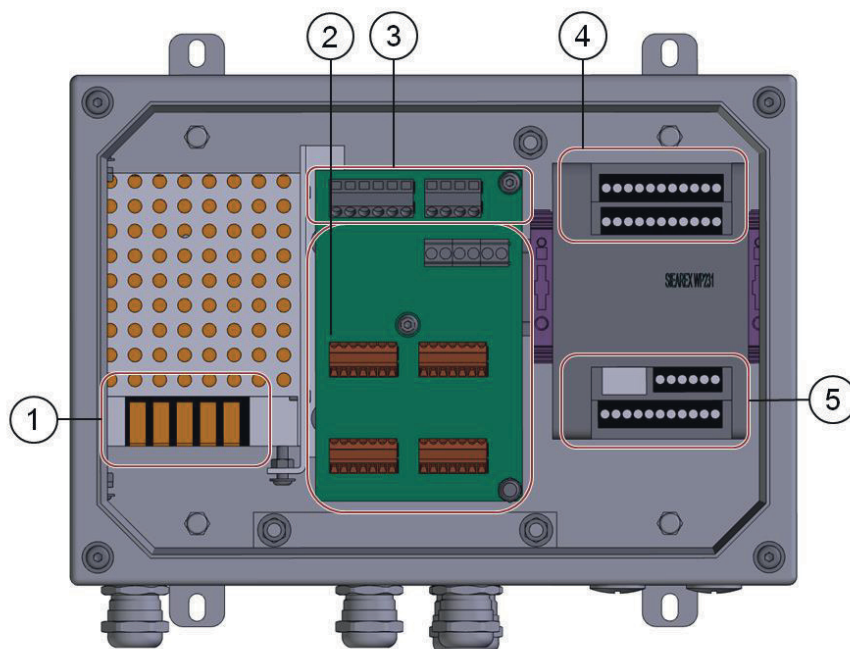

- ① Power supply
- ② Printed circuit board for connection of load cells and analogue output
- ③ SIWAREX WP231/WP241 connections - prewired at the factory to ④.
- ④ SIWAREX WP231/WP241 upper terminal block - prewired at the factory to ③
- ⑤ Lower terminal block SIWAREX WP231/WP241 – digital inputs, digital outputs, RS485

Figure 3-3 Internal view

Installation

NOTICE

Incorrect assembly

The device can be damaged or destroyed or its functionality impaired through incorrect assembly.

- Make sure before installing the device that there is no visible damage.
- Check that the process connections are clean and the right seals and cable glands have been used.
- Mount the device using a suitable tool.

4.1 Wall mounting

The weighing terminal is designed for wall mounting. For this, the device has 4 longitudinal lugs on the rear with which the device can be screwed to a wall.

When selecting the screwed connection, note the material and condition of the load-bearing wall. The longitudinal holes of the wall mounting are designed for M5 screws.

For dimensions and hole pattern, see section: Drilling template (Page 165).

4.2 EMC-compliant setup

4.2.1 Introduction

Overview

The electronic weighing system described here was developed for use in industrial environments and complies with high EMC requirements. Nevertheless, before installing your devices you should prepare an EMC plan and identify and take into consideration possible interference sources.

EMC

EMC (electromagnetic compatibility) describes the capability of electrical equipment to operate without errors in a given electromagnetic environment, without being subject to external influence and without influencing external devices in any way.

4.2.2 Possible effects of interference

Electromagnetic interferences can influence the electronic weighing system described here in various ways:

- Electromagnetic fields having a direct influence on the system
- Interferences transported by communication cables
- Interferences having an effect via process cables
- Interferences entering the system via the power supply and/or protective ground

Interferences can impair the fault-free functioning of the electronic weighing system.

4.2.3 Coupling mechanisms

Depending on the propagation medium (conducted or non-conducted) and the distance between the interference source and the device, interferences can enter the faulty device through four different coupling mechanisms:

- Electrical coupling
- Capacitive coupling
- Inductive coupling
- Radiation coupling

4.3 Five basic rules for securing EMC

Observe these five basic rules to secure EMC.

Rule 1: Large area grounding contact

- When installing the devices, make sure that the surfaces of inactive metal parts are properly bonded to chassis ground (see following sections).
- Bond all inactive metal parts to chassis ground, ensuring large area and low-impedance contact (large cross-sections).
- When using screw connections on varnished or anodized metal parts, support contact with special contact washers or remove the protective insulating finish on the points of contact.
- Wherever possible, avoid the use of aluminum parts for ground bonding. Aluminum oxidizes very easily and is therefore less suitable for ground bonding.
- Provide a central connection between chassis ground and the ground/protective conductor system.

Rule 2: Proper cable routing

- Organize your wiring system into cable groups (high-voltage/power supply/signal/measurement/data cables).
- Always route high-voltage and data cables in separate ducts or in separate bundles.
- Install the measurement cables as close as possible to grounded surfaces (e.g. supporting beams, metal rails, steel cabinet walls).

Rule 3: Fixing the cable shielding

- Ensure proper fixation of the cable shielding.
- Always use shielded data cables. Always connect both ends of the data cable shielding to ground on a large area.
- Keep unshielded cable ends as short as possible.
- Always use metal/metalized connector housings only for shielded data cables.

Rule 4: Special EMC measures

- All inductors that are to be controlled should be connected with suppressors.
- For cabinet or enclosure lighting in the immediate range of your controller, use incandescent lamps or interference suppressed fluorescent lamps.

Rule 5: Homogeneous reference potential

- Create a homogeneous reference potential and ground all electrical equipment.
- Use sufficiently dimensioned equipotential bonding conductors if potential differences exist or are expected between your system components. Equipotential bonding is absolutely mandatory for applications in hazardous areas.

Connecting

5.1 Basic safety instructions

5.1.1 Transient overvoltages

WARNING
Transient overvoltages
Take measures to ensure that temporary transient overvoltages do not occur.

WARNING
Missing PE/ground connection
Risk of electric shock.
Depending on the device version, connect the power supply as follows:
• Power plug: Ensure that the used socket has a PE/ground conductor connection. Check that the PE/ground conductor connection of the socket and power plug match each other. • Connecting terminals: Connect the terminals according to the terminal connection diagram. First connect the PE/ground conductor.

CAUTION
Dangerous voltage at open device
Danger of electrocution when the enclosure is opened or enclosure parts are removed.
• Disconnect the device before you open the enclosure or remove enclosure parts.

WARNING
Hazardous contact voltage
Risk of electric shock in case of incorrect connection.
• For the electrical connection specifications, refer to the information in Technical specifications (Page 155). • At the mounting location of the device observe the applicable directives and laws for installation of electrical power installations with rated voltages below 1000 V.

**CAUTION****Unsafe extra-low voltage**

Danger of injury or damage to device.

- Connect the device to an extra-low voltage with safe isolation (SELV).
- Ensure that the sum of the connected extra-low voltage supplies with safe isolation (SELV) does not exceed the maximum permissible touch voltage.

**CAUTION****Cables outside the building**

Damage to device or faults in the Ethernet or power supply.

- Only connect the device to the Ethernet inside the building.
- Only connect the device to Ethernet, not to TNV network (Telecommunication Network Voltage) or WAN (Wide Area Network).
- Only connect the device to the power supply inside the building.

Note**Improvement of interference immunity**

The device can be damaged or destroyed or its functionality impaired through incorrect assembly.

- Lay signal cables separately from high-voltage cables.
 - If possible, use cables with twisted wires.
 - Keep the device and the cables at a distance from strong electromagnetic fields.
 - Observe the communication conditions described in the section Technical specifications (Page 155).
-


5.2 Requirements

1. Install an emergency stop switch.
 - Mark the emergency stop switch as an emergency stop switch.
 - Install the emergency stop switch in such a way that it is easily accessible and in the vicinity of the device.
2. Install overcurrent protection. See section Technical specifications (Page 155).


5.3 Color coding of cables

The color code complies with European directives. The device is supplied pre-wired.

- Connect the PE/ground conductor first.

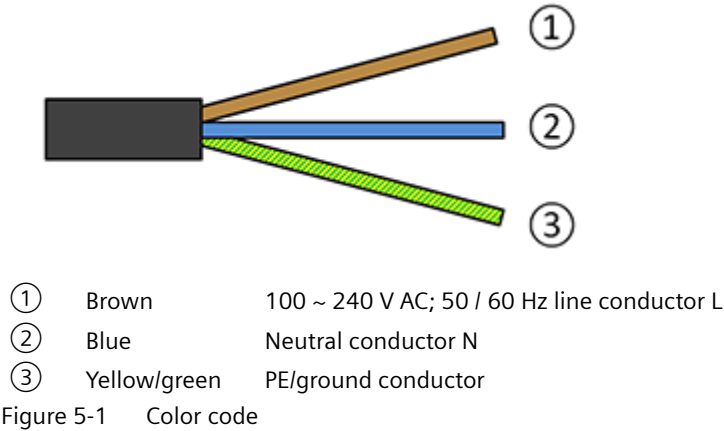

5.4 230 V AC connection

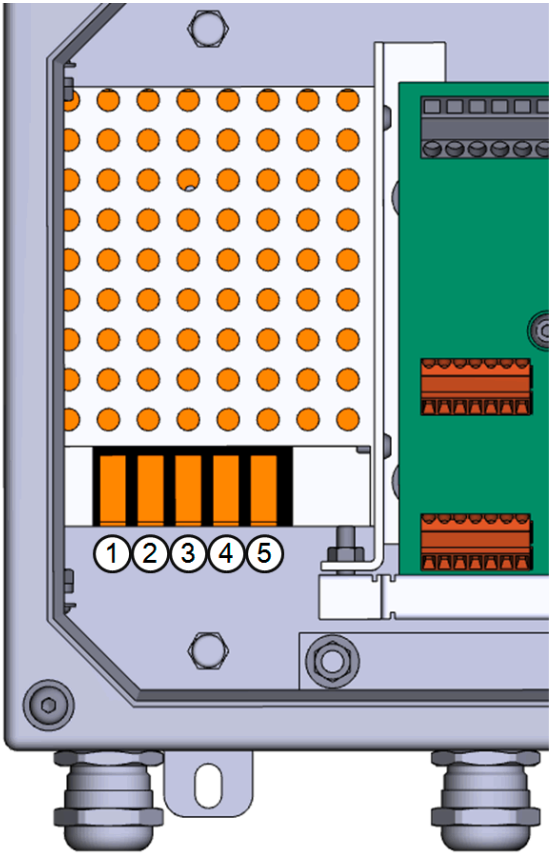


Labeling / color	Function
①	Terminal for 100 ~ 230 V AC; 50/60 Hz -- L
②	Terminal for neutral conductor

③	Terminal for PE
④	Ground voltage supply
⑤	+24 V voltage supply

1. Connect the supply voltage to the power supply built into the enclosure.
 - Use terminals 1, 2 and 3 for connecting the 230 V AC supply voltage.

5.5 24 V DC connection

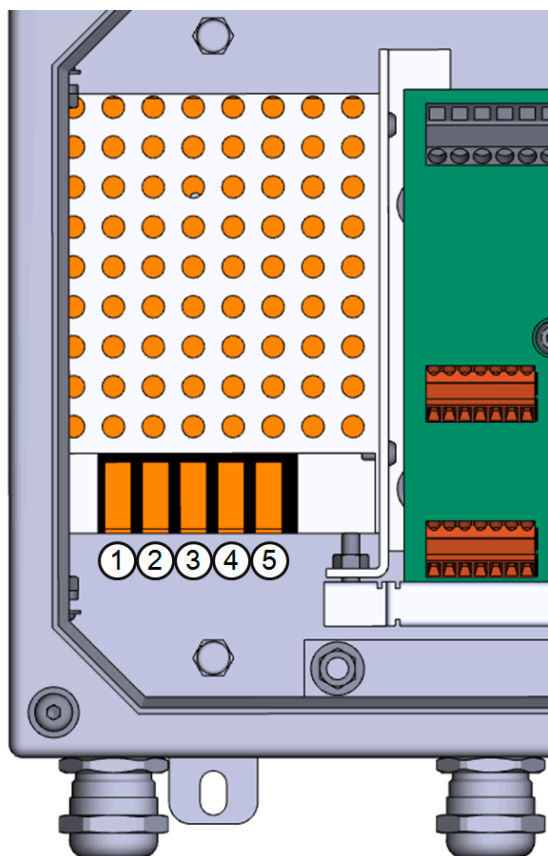


Labeling / color	Function
①	Not wired
②	Not wired
③	Not wired
④	Ground voltage supply
⑤	+24 V power supply

1. Connect the supply voltage to the 24 V output of the power supply.
 - Use only terminals 4 and 5 for this. Terminals 1, 2 and 3 must remain free.

5.6 Connection of analog load cells

Sensors equipped with expansion measuring strips (EMS) can be connected to the electronic weighing system. These sensors meet the requirements in section Analog load cell interface connection (Page 155).

5.6.1 Connect load cells to the weighing terminal

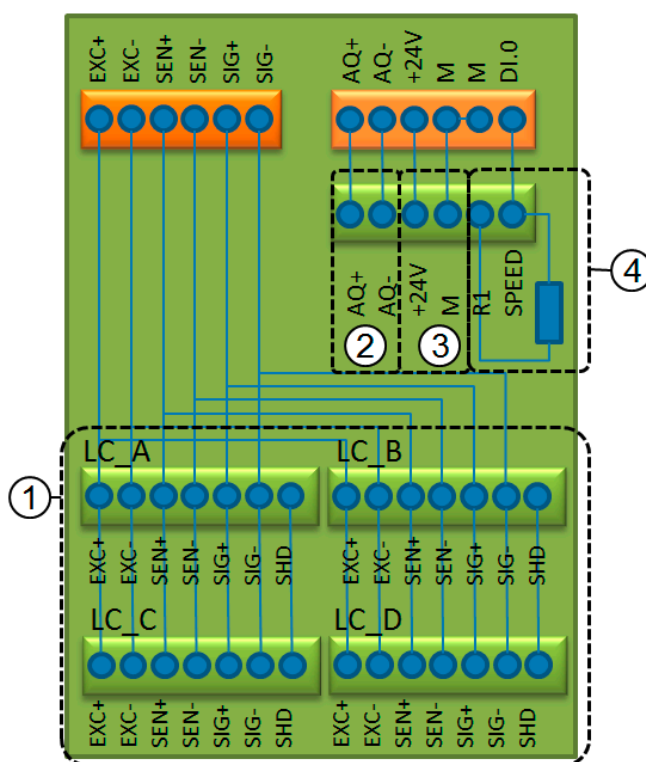

- ① Connection terminals for load cells
- ② Connection terminals for analogue output
- ③ 24 V DC wiper
- ④ Connection of speed sensors (only relevant for SIWAREX WT241)

The load cells are connected to the weighing terminal using the PCB provided inside the unit. There are connection terminals for a total of 4 load cells on the PCB. The connection terminals are marked as follows: LC_A, LC_B, LC_C, LC_D.

The selection and sequence of the connection terminals used are irrelevant. For example, if only one load cell is used, you can connect the load cell to LC_A or LC_B or LC_C or LC_D.


5.6 Connection of analog load cells

If a terminal box is needed, you can make the connection at any load cell terminal block (LC_A...LC_D) on the PCB. A terminal box is required if you use more than 4 load cells, for example.

Table 5-1 Signal designation of load cells

Labeling	Function
Sig-	Measurement cable load cell -
Sig+	Measurement cable load cell +
Sen-	Sensor cable load cell -
Sen+	Sensor cable load cell +
Exc-	Supply load cell -
Exc+	Supply load cell +


1. Connect the load cells to the electronic weighing system according to the circuit diagram. Load cells are marked as follows: LC_A, LC_B, LC_C, LC_D.

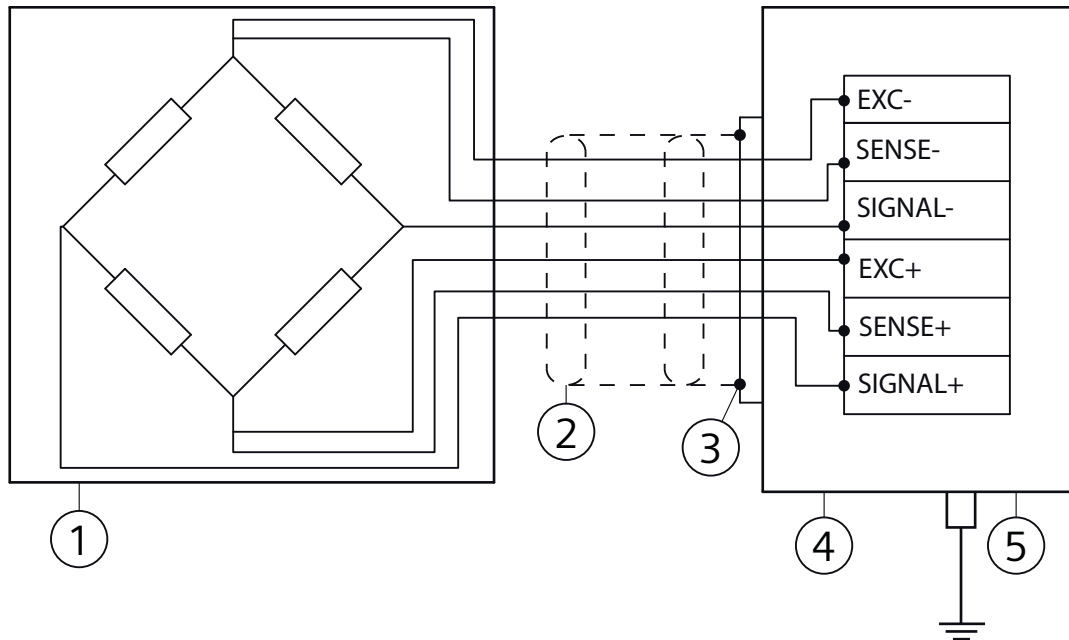

- ① Load cell
- ② Shield of the load cell cable
- ③ Shield connection cable gland
- ④ SIWAREX WT231/WT241 weighing terminals
- ⑤ Ground connection

Figure 5-2 Connection DMS load cells with six-wire system

1. Connect the load cells to the electronic weighing system according to the circuit diagram.

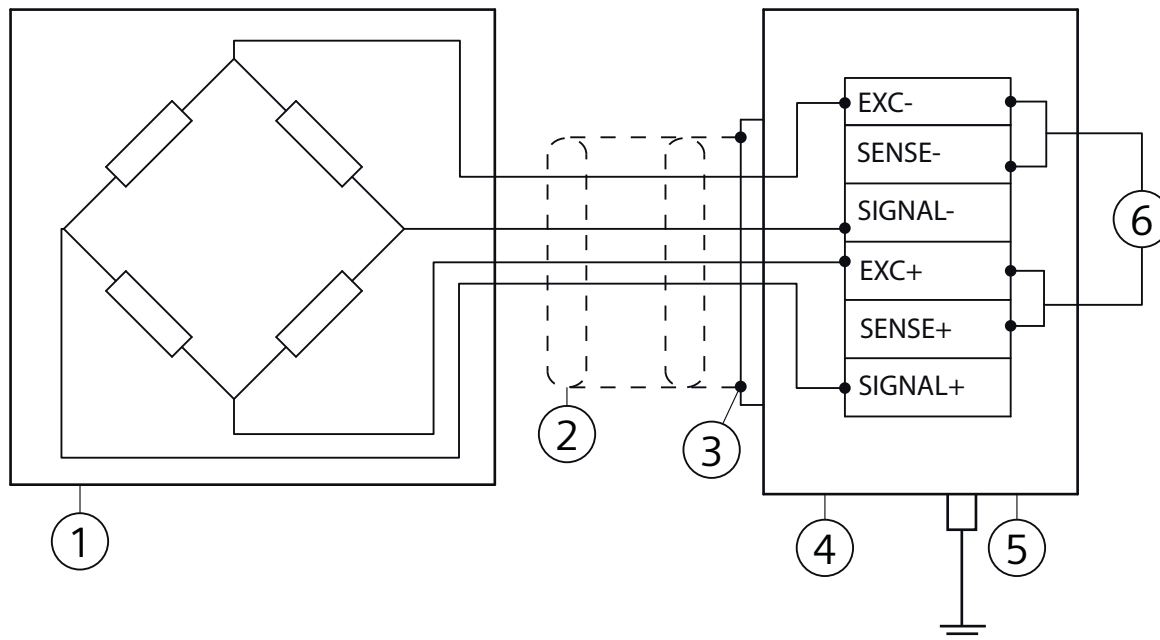

- ① Load cell
- ② Shield of the load cell cable
- ③ Shield connection cable gland
- ④ SIWAREX WT231/WT241 weighing terminals
- ⑤ Ground connection
- ⑥ Jumpers

Figure 5-3 Connection DMS load cells with four-wire system

2. Place jumpers between the EXC- and SEN- and EXC+ and SEN+ terminals on the corresponding LC_A...LC_D terminals in the terminal block ① "Connection terminals for load cells". If the jumpers are missing, the error message "Cable break" is displayed.

5.6.2 Connecting the cable

Requirement

You require a screwdriver with a maximum blade width of 3.5 mm.

Procedure

1. In EMC cable glands, lay the cable shielding over a large area.

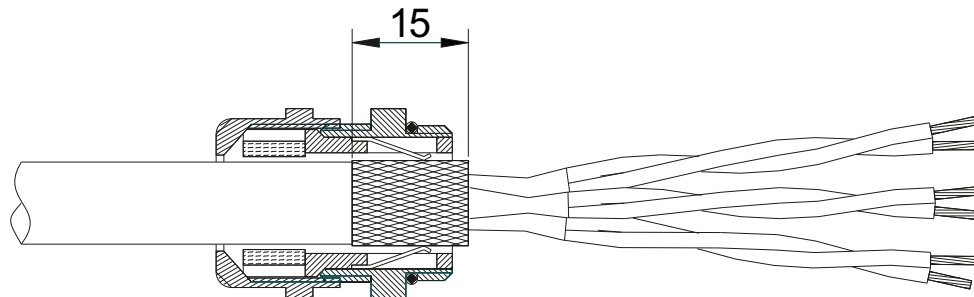


Figure 5-4 Place the cable shield in the EMC cable gland

2. With plastic cable glands, place the corresponding wire of the SIWAREX load cell on the shield terminal.
3. Strip at least 6 mm of insulation from the load cell cable.

 


Figure 5-5 Strip cable

4. Insert the stripped load cell cable into the square opening of the screw terminal as far as it will go.
5. Tighten the screws with the specified tightening torque.

Result

The tightened screw firmly holds the stripped wire and establishes the contact.

5.7 Connection of digital outputs (4 x DQ)

CAUTION

Unknown assignment of digital outputs

The assignment of the digital outputs is not known at the time of connection. Digital outputs can be active immediately after turning on the power supply. This may damage parts of the system.

Do not create a connection with the digital outputs before you know the assignment of the digital outputs.

The electronic weighing system described here has four digital outputs. They are not permanently assigned to process values in the delivery state. Assignment of these digital outputs to functions as well as definition of the response in the event of a fault is carried out

during commissioning by parameter assignment of data record 7. The 24 V power supply for the digital outputs is provided via terminals 3L+ and 3M with electrical isolation.

Table 5-2 Connection of the digital outputs

Labeling	Function
DQ.0	Digital output 0
DQ.1	Digital output 1
DQ.2	Digital output 2
DQ.3	Digital output 3
DQ.3L+	+24 V DC power supply for digital outputs
DQ.3M	Ground of power supply for digital outputs

5.8 Connection of digital inputs (4 x DI)



CAUTION

Unknown assignment of digital inputs

If the assignment of the digital inputs is not known at the time of connection, this may damage parts of the system.

Do not create a connection with the digital inputs before you know the assignment.

The electronic weighing system described here has four digital inputs. The digital inputs are not permanently assigned to commands in the delivery state. Assignment of the digital inputs to commands is carried out during commissioning by parameter assignment of data record 7. The external 24 V switching signal is connected electrically isolated to the desired input, the associated ground to terminal 2M.

Table 5-3 Connection of the digital inputs

Labeling	Function
DI.0	Digital input 0
DI.1	Digital input 1
DI.2	Digital input 2
DI.3	Digital input 3
DI.2M	Reference ground potential of the digital inputs

5.9 Connection of the analog output (1 x AQ)

⚠ CAUTION

Unknown assignment of the analog outputs

The assignment of the analog output is not known at the time of connection. The analog output can be active immediately after turning on the power supply. This may damage parts of the system.

- Do not create a connection with the analog output before you know the assignment.

The analog output is not permanently assigned to a process value in the delivery state. Assignment of the analog output to the process value as well as its response in the event of a fault is carried out during commissioning in data record 7. If a wire break occurs, the LED labeled "AQ" flashes red. The output can be configured as 0 to 20 mA or 4 to 20 mA output.

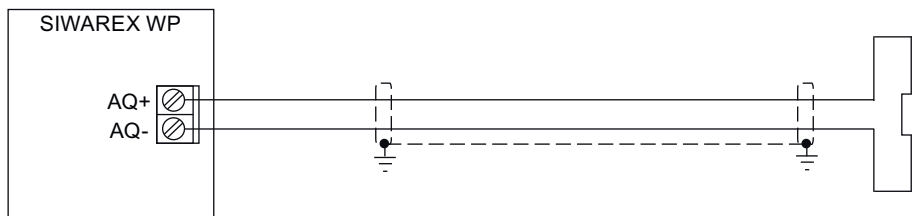


Figure 5-6 Analog output connection

5.10 Connection of RS485 serial interface

Devices can be connected to the serial interface RS485 in accordance with the information in section Technical data (Page 155)

Table 5-4 Connection of RS485 serial interface

Labeling	Function
EIA-485 T+	RS485 termination +
EIA-485 T-	RS485 termination -
EIA-485 D+'	RS485 data line +' for looping through of bus signal
EIA-485 D-'	RS485 data line -' for looping through of bus signal
EIA-485 D+	RS485 data line + for feeding in of bus signal
EIA-485 D-	RS485 data line - for feeding in of bus signal

If the electronic weighing system forms the termination of an RS485 network, insert wire jumpers between the D+' and T+ terminals and between the D-' and T- terminals for termination of the bus network.

5.11 Connection of Siebert display via RS485

A Siebert display S102 with the order no. S102-W6/14/OR-000/0B-SM can be connected to the RS485 interface of the weighing module. Connect a 24 V DC supply to the Siebert display. Connect the latter to the RS485 interface of the weighing module as shown in the figure below.

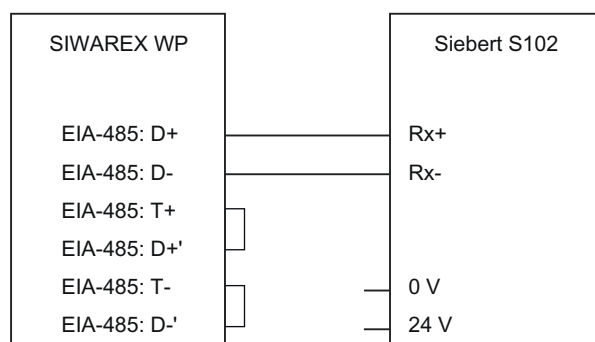


Figure 5-7 Connection of Siebert display S102

The RS485 interface in the DR 13 of the SIWAREX WP is set as follows:

- Baud rate: 9600 bps
- Character parity: Even
- Number of data bits: 8
- Number of stop bits: 1

The S102 is set as follows:

Table 5-5 Settings of Siebert display S102

Menu item	Setting	Meaning
1 Interface	485	RS485 interface
9 Station address	01	Address meaning:
		Address Weight value
		01 Verifiable weight
		02 Total
		03 Net
		04 Tare
t Timeout	2	e.g. timeout after 2 seconds
C	0.0	No decimal point
F Segment test	----*	No segment test when switching on
	8.8.8	Segment test when switching on

5.12 Connection of digital load cells from the Wipotec company

You can connect a Wipotec load cell for which the "SIWAREX protocol" and firmware FS911 V1.690 or FS276 V3.560 or higher is set to the RS485 interface.


5.12 Connection of digital load cells from the Wipotec company

The electronic weighing system communicates with the load cell through a point-to-point connection via RS485/RS422.

5.12.1 Electrical connection of load cells with plug-in connection

Make the following wiring between the load cell and the electronic weighing system:

Electronic weighing system terminals	Load cell terminals	Comment
T+	-	Jumper to D+'
T-	-	Jumper to D-'
D+'	2	RS422 positive send line
D-'	4	RS422 negative send line
D+	1	RS422 positive reception line
D-	6	RS422 negative reception line
1L+	7	Supply voltage 24 V DC
1M	3	Supply voltage M
$\perp$	8	Protective ground

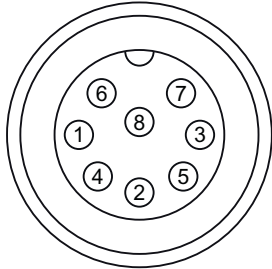Terminals of the cable of the digital load cell	SIGNAL	Designation	Connector 1
1	RX+	RS422 pos. receive line	
2	Tx+	RS422 pos. send line	
3	GND	Reference potential supply	
4	TX-	RS422 negative send line	
5	(EIN 1)	Binary input (optional)	
6	RX-	RS422 negative reception line	
7	24 V DC	Supply voltage	
8	PE	Protective ground	
			Cable digital load cell

5.12.2 Electrical connection of load cells with terminal block (SW-D-FS series)

Make the following wiring between the load cell and the electronic weighing system:

Load cell Terminal block X1	SIGNAL	Connection to electronic weighing system
1	Current transfer channel 7 ³⁾	
2	Current transfer channel 6 ³⁾	
3	Current transfer channel 2 ³⁾	
4	Current transfer channel 1 ³⁾⁴⁾	

5.12 Connection of digital load cells from the Wipotec company

Load cell Terminal block X1	SIGNAL	Connection to electronic weighing system
5	0 V supply voltage weighing sensor ¹⁾	1M
6	24 V supply voltage weighing sensor ¹⁾	1L+
7	24 V supply voltage weighing sensor ¹⁾	
8	0 V supply voltage weighing sensor ¹⁾	
9	Binary input 1 ³⁾	
10	Binary input 2 ³⁾	
11	Binary input 3 ³⁾	
12	Binary input 4 ³⁾	
13	Binary output 1 ³⁾	
14	Binary output 2 ³⁾	
15	Binary output 3 ³⁾	
16	Binary output 4 ³⁾	

1) The signal/potential is live on the two clamping points for distribution purposes. The two clamping points are equivalent.

3) Option

4) Internally connected to the enclosure

Load cell terminal block X2	SIGNAL	RS422	CAN	Connection to electronic weighing system
1	Current transfer channel 4 ^{1) 3)}			
2	Current transfer channel 4 ^{1) 3)}			
3	Current transfer channel 3 ^{1) 3)}			
4	Current transfer channel 3 ^{1) 3)}			
5	Current transfer channel 5 ³⁾			
6	Interface 1 ²⁾	RX-	CANGND	D-
7	Interface 1 ²⁾	RX+	--	D+
8	Interface 1 ²⁾	--	CANL ¹⁾	
9	Interface 1 ²⁾	TX-	CANL ¹⁾	D-'
10	Interface 1 ²⁾	TX+	CANH ¹⁾	D+'
11	Interface 1 ²⁾	--	CANH ¹⁾	
12	Interface 2: GND2			
13	Interface 2: TxD			
14	Reserve			
15	Interface 2: RxD			
--	--			

1) The signal/potential is live on the two clamping points for distribution purposes. The two clamping points are equivalent.

2) Interface 1 can be optionally fitted ex factory as RS422 or CAN.

3) Option

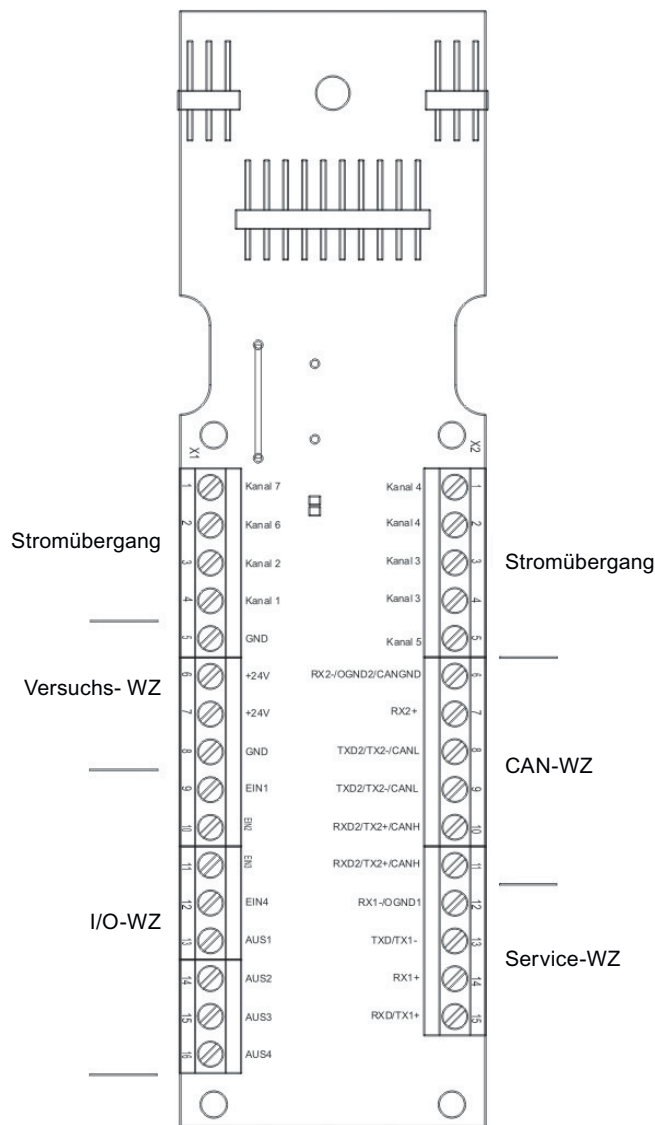


Figure 5-8 Connecting load cells with terminal block

5.13 Connection of digital load cells from the Mettler-Toledo company

You can connect the digital Mettler-Toledo load cells, WMS and WMH and PBK9-APW and PFK9-APW, to the RS485 interface.

Connect the Mettler-Toledo TYPE WM and WHM with the RS485 interface of the electronic weighing system as shown in the following figure.

5.13 Connection of digital load cells from the Mettler-Toledo company

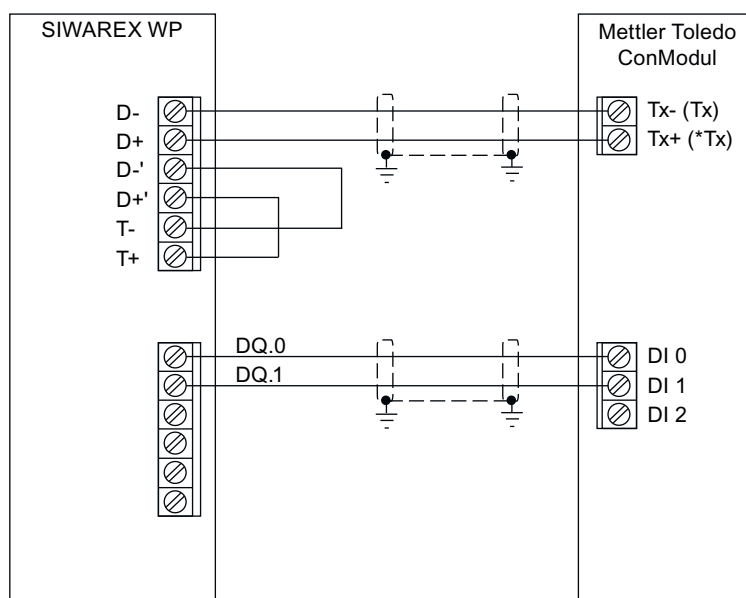


Figure 5-9 Connecting SIWAREX WP to Mettler Mettler-Toledo ConModul

The Mettler configuration software of the sensor is used to set application-dependent scale and sensor parameters.

For communication with the electronic weighing system, make the following settings (per command) at the load cell:

- PROT_2 (framework protocol)
- COM_1_8_0_0 (RS422 interface, 38400 baud, 7 bits, even parity, 1 stop bit)

Setting the digital inputs:

- DIN1_SIR_0_1 (input 1 for the SIR command, positive edge, output via RS422)
- DIN1_SI_0_1 (input 1 for the SIR command, positive edge, output via RS422)

Connect the Mettler-Toledo TYPE PBK9-APW and PFK9-APW with the RS485 interface of the electronic weighing system as shown in the following figure.

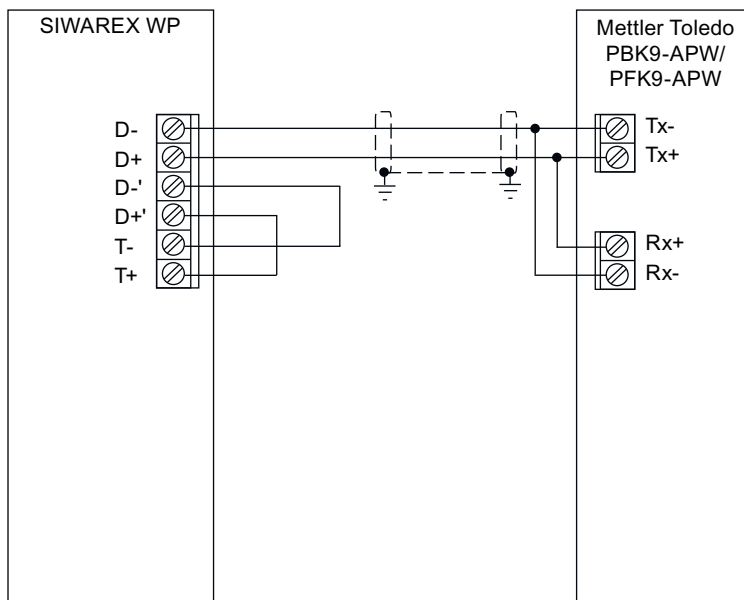


Figure 5-10 Connecting SIWAREX WP to Mettler Toledo PBK9-APW/PFK9-APW

The Mettler configuration software of the sensor is used to set application-dependent sensor parameters.

For communication with the electronic weighing system, make the following settings (per command) at the load cell:

- COM_1_8_0_0 (RS422 interface, 38400 baud, 7 bits, even parity, 1 stop bit)

5.14 Connection of the SIWAREX DB

5.14.1 Connecting SIWAREX DB


Procedure

1. Open the cover of the SIWAREX DB.
2. Screw in an M16 x 1.5 cable gland for each load cell.
3. Screw in an M20 x 1.5 EMC cable gland for the signal cable to the SIWAREX WP electronic weighing system.

- Attach the cables from SIWAREX DB to the load cell and the SIWAREX WP electronic weighing system.

Connect the cable (Page 43)

The maximum distance between SIWAREX DB and the WP electronic weighing system is 1000 m when using the recommended cable 7MH4702-8AG.

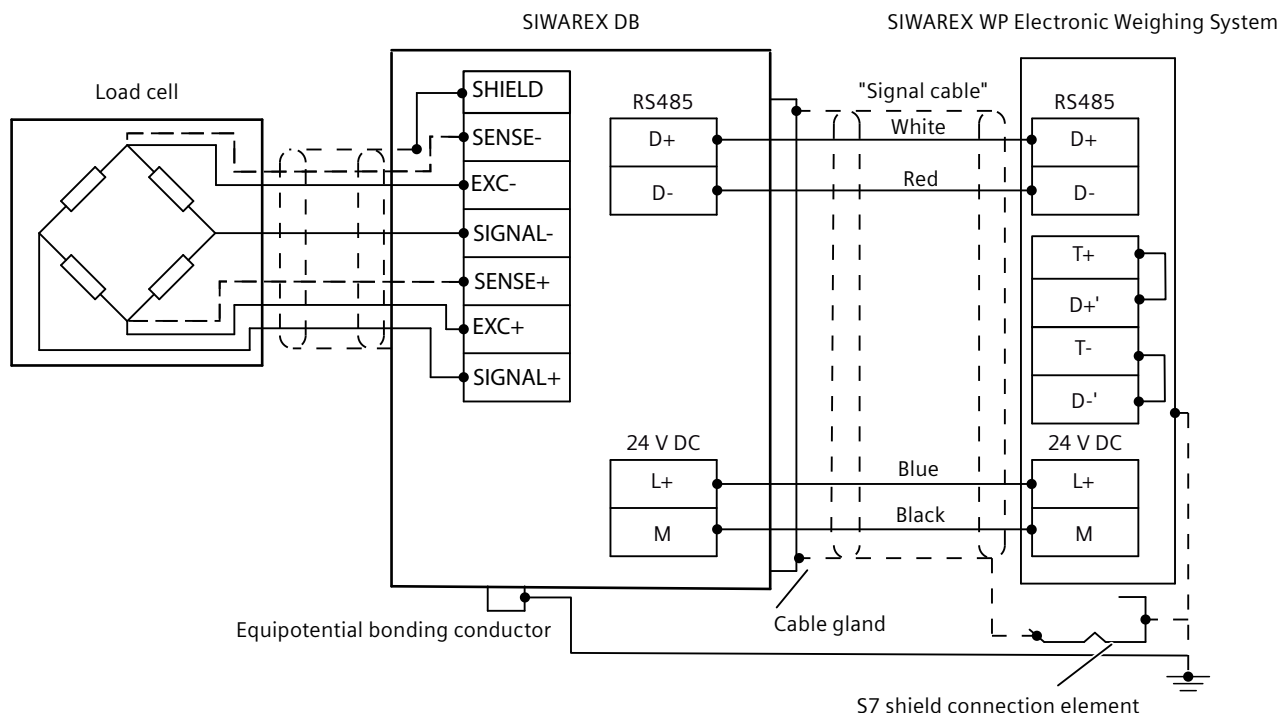

- With SIWAREX WP weighing electronics, insert wire jumpers between terminals D+' and T+ and between terminals D-' and T- for termination of the bus network.
- Close any unused opening in the enclosure with a blanking plug.
- Connect the equipotential bonding conductor (functional grounding) to the enclosure exterior. Use shielded cable lugs.
- Close the cover of the SIWAREX DB according to the tightening torque 1.5 to 2 Nm.

5.14.2 Connect the cable

Condition

You require a screwdriver with a maximum blade width of 2.5 mm.

You can use the SIWAREX cable for supply voltage and RS-485 communications. Ordering data (Page 163)

Procedure

1. Place the cable shield in the EMC cable gland over a large area.

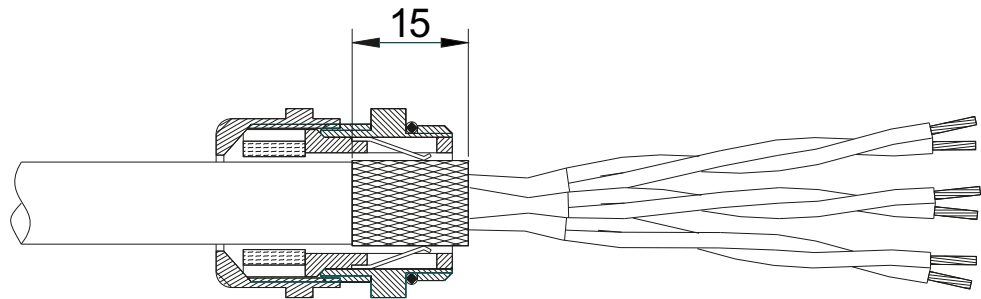


Figure 5-11 Place the cable shield in the EMC cable gland.

2. For plastic cable glands, connect the corresponding wire of the SIWAREX load cell to the shield terminal.
3. Strip the cable ends at least 6 mm.
4. Push the screwdriver into the rectangular opening of the terminals.
5. Insert the stripped cable into the round opening as far as it will go.
6. Remove the screwdriver from the rectangular opening.

Commissioning

6.1 Introduction

Commissioning consists mainly of checking the mechanical scale structure, setting parameters, calibration, and verification of the envisaged functionality.

6.2 Commissioning via Quick Start

6.2.1 Start

Commissioning using Quick Start

The weighing terminal offers the possibility for quick commissioning within 5 minutes (Quick Start).

To carry out the quick start, select the "1.0 Setup" function in the main menu and then "1.2 Quick Start". You will be guided through the individual tasks for setting the most important parameters.

The remaining parameters are factory-set in such a way that they can be used in most cases without any changes.

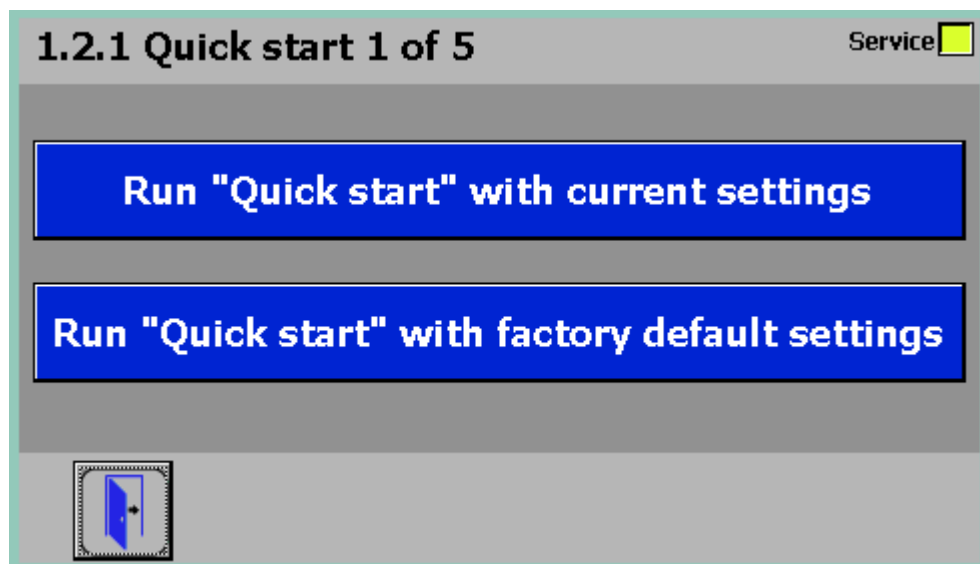


Figure 6-1 Quick start step 1

"Quick start" with current settings.

- The parameter settings of the module are retained for the quick commissioning.

"Quick start" with default factory settings

- The quick commissioning is performed with factory settings. All parameter settings are overwritten with the default values

6.2.2 Standard parameter settings

Standard parameter settings

The quick setup is based on the standard parameter settings. The previously set parameters must therefore be reset prior to the quick setup (except the Ethernet address and Modbus parameters).

Service mode must be switched on first. Resetting to the standard parameters can then be carried out.

Note

Do not forget to save

Changes to the scale settings are only accepted if the diskette symbol in the lower menu bar is pressed.

1.2.2 Quick start 2 of 5 Service ☐

Scale name	
Weight unit	kg
Indicator for gross	B for Gross
Resolution (d)	0.1000 kg
Minimum weight	20 d
Maximum weight	100.0000 kg

Bottom menu bar icons:    

Figure 6-2 Quick start step 2

6.2.3 Selecting the calibration method

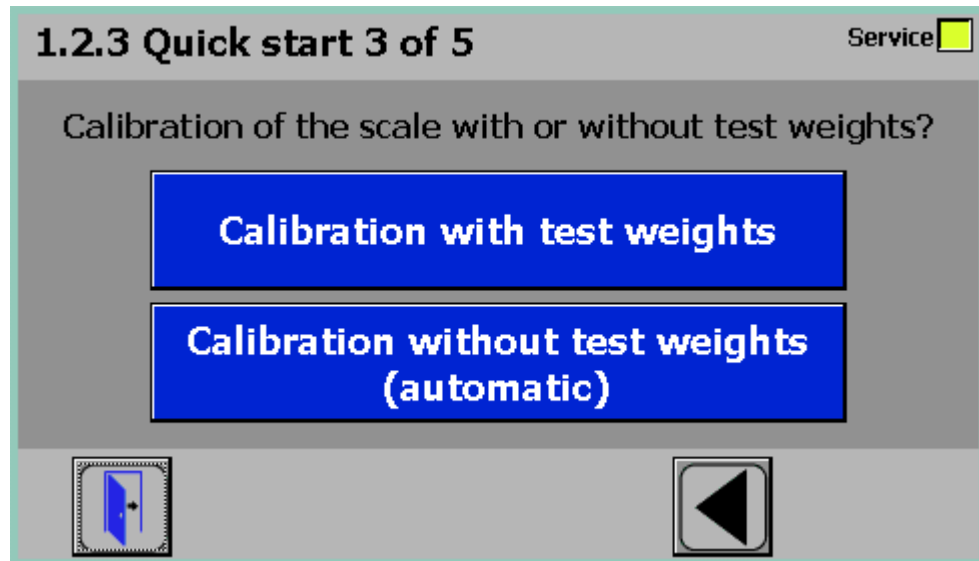


Figure 6-3 Quick start step 3

The weighing terminal can always be calibrated in two different ways:

- Using reference weights: in the case of a calibration with weights, mechanical influences of the scale construction are also partially taken into account.
- Without weights, using the technical specifications of the connected load cell(s): in the case of automatic calibration, the accuracy of the scale is influenced by the mechanical properties to a greater extent than with calibration using reference weights.

With both methods, make sure that the mechanical properties of the scale are flawless prior to calibration.

6.2.4 Defining the calibration weights

The screenshot shows a digital scale's commissioning screen titled "1.2.4 Quick start 4 of 5". In the top right corner, there is a "Service" label next to a yellow square icon. The main area contains three rows for defining calibration weights, each with a label, a numeric input field, and a unit "kg".

Label	Value	Unit
Calibration weight 0	0.0000	kg
Calibration weight 1	100.0000	kg
Calibration weight 2 (optional)	0.0000	kg

At the bottom of the screen, there are four square buttons: a blue door icon, a blue floppy disk icon, a black left-pointing triangle, and a black right-pointing triangle.

Figure 6-4 Quick start step 4a

In step 4 you enter the calibration weights which are to be positioned on the scale during the calibration. If the scale is not empty and the current contents are known, you can define an "Calibration weight 0" with the current contents of the scale. With an empty scale, this parameter remains as 0 kg. "Calibration weight 1" usually defines the first reference point of the scale characteristic. A further reference point ("Calibration weight 2") can also be set in addition. This is optional, and may not be necessary depending on the mechanical properties of the scale.

Note that the interval between the calibration weights must be at least 2% of the nominal load of the scale. With a 1 000 kg scale, a calibration weight of at least 20 kg must therefore be used.

6.2.5 Setting calibration points

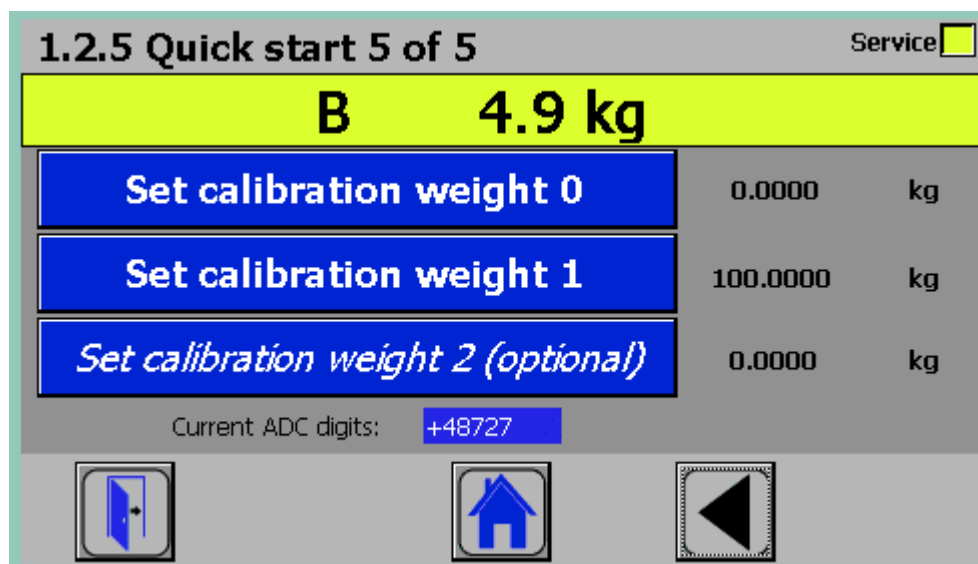


Figure 6-5 Quick start step 5a

Carry out the calibration commands at the end of the quick start:

1. Carry out the "Set calibration weight 0" command. The "Calibration weight 0" defined in step 4 is now visible in the display.
2. Place the "Calibration weight 1" defined in step 4 on the scale construction, and execute the "Set calibration weight 1" command.
3. If an "Calibration weight 2" was selected:
Place "Calibration weight 2" defined in step 4 on the scale construction, and execute the "Set calibration weight 2" command.
4. Calibration of the scale is now complete. Return to the start screen by clicking on the house icon.

6.2.6 Calibrating the scale automatically

The scale can also be calibrated without weights. To do this, it is necessary to enter data specific to the load cells. In addition, it is essential that the scale is empty.

1.2.6 Quick start 4 of 5 Service 

AC power line frequency	50Hz	
Number of mechanical support points	3	
Averaged characteristic value	2.0000	mV/V
Nominal load of one load cell	60.00	kg






Figure 6-6 Quick start step 4b

The number of points of support corresponds with a silo, for example, to the number of clamps or feet of the silo. A quadratic platform scale with a load cell at each corner has 4 support points. The characteristic values of the individual load cells are required to calculate the average characteristic value of the cells.

The equation for the calculation is as follows:

$$(\text{characteristic of cell 1} + \text{characteristic of cell 2} + \text{characteristic of cell n}) / n$$

If the exact characteristic values are unknown, it is permissible to also use rounded-off numbers (e.g. 1.0 mV/V, 2.0 mV/V). The nominal load of an individual load cell (not the nominal load of the complete scale!) must subsequently be defined.

6.2.7 Performing the automatic calibration

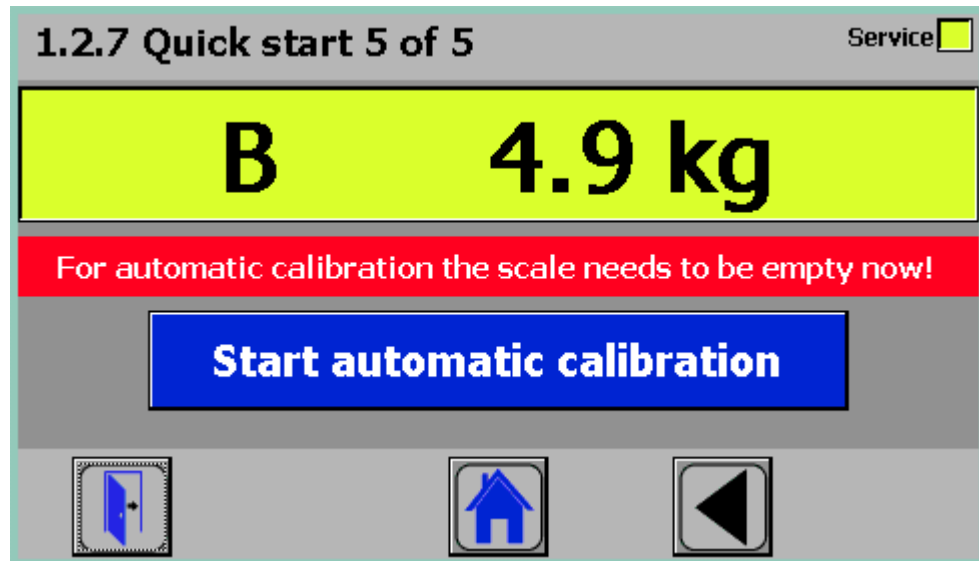


Figure 6-7 Quick start step 5b

Subsequently enter the "Perform automatic calibration" command with the scale empty. The scale is calibrated directly, and clicking on the house icon returns you to the start screen.

6.2.8 Checking the scale following calibration

If the scale is only used for company-internal purposes, a simple check is sufficient.

Perform the following steps:

1. The scale is unloaded and shows "0 kg".
2. Place a known reference weight on the scale.
Check the displayed value.
3. If a second known reference weight is available, place it on the scale in addition.
Check whether the scale displays the sum of the reference weights.
4. Remove the reference weights from the scale.
Check that the display is "0 kg" again.

6.3 Operating view

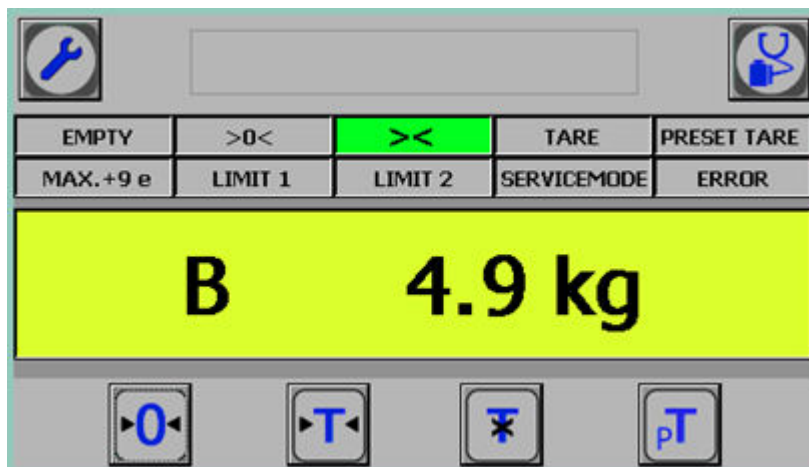


Figure 6-8 Operating view

The weighing terminal is operated via the integrated Touch Panel. The starting point for each application step is the operating view.

Variable	Description
	Branches to the main menu
	Branches to the diagnostics menu
	Zero setting (semi-automatic)
	Taring (semi-automatic)
	Delete current tare weight
	Branches to the Preset Tare menu
EMPTY	Set if "Empty" condition is met. Empty range is specified in 1.3.1 Limits
>0< (ZERO)	Set if gross is less than $\pm 0.25e$
>< (standstill)	Set if standstill condition is met. Parameters are assigned with the menu item "1.4.3 Advanced scale parameters 3 of 4"
TARE	Set if tare memory is not equal to zero
PRESET TARE	Set if the tare memory is assigned an external specified value 1
MAX. +9e	Set if the weight has exceeded the gross weighing range by more than 9 display steps (d)
LIMIT 1	Limit 1 has responded. Limits are set in 1.3.1. Limits.

Variable	Description
LIMIT 2	Limit 2 has responded. Limits are set in 1.3.1. Limits.
SERVICE MODE	Service mode is enabled
ERROR	Operating fault

6.4 Menu structure

Overview

To operate the device, the following main menus are available:

- Menu 1.0 Setup (Page 53)
- → Menu 1.1 Recalibration (Page 53)
- → Menu 1.2 Quick Start (Page 54)
- → Menu 1.3 Limits (Page 54)
- → Menu 1.4 Advanced scale parameters (Page 55)
- → Menu 1.5 Communication & interfaces (Page 56)
- → Menu 1.6 Recovery point (Page 60)
- Menu 2.0 Diagnostics (Page 61)
- → Menu 2.1 Messages (Page 61)
- → Menu 2.2 Scale status (Page 61)
- → Menu 2.3 Load trend (Page 65)
- → Menu 2.4 Module information (Page 65)
- → Menu 2.5 Start / stop trace (Page 65)
- → Menu 2.6 Increased resolution (Page 66)
- Menu 3.0 Language, Date & Time (Page 66)
- Menu 4.0 User administration (Page 66)

6.5 Menu 1.0 Setup

6.5.1 Menu 1.1 Recalibration

Overview

The Recalibration menu enables the scale to be quickly re-calibrated.

The calibration weights stored in the Commissioning menu are used for this. Conversely, this means that the corresponding weights must also be applied.

The recalibration function allows calibration with up to three breakpoints.

6.5.2 Menu 1.2 Quick Start

You can find a detailed description in section → Commissioning via Quick Start (Page 45).

6.5.3 Menu 1.3 Limits

The weighing terminal provides two freely configurable limits as well as an empty range monitoring function. These functions can be set in "Menu 1.3" with the Limit ON, Limit OFF and Delay parameters.

1.3.1 Limits

	Limit 1		Limit 2		Empty range	
Limit "ON"	99.00	%	50.00	%	1.00	%
Delay "ON"	0.000	s	0.000	s	1.000	s
Limit "OFF"	98.00	%	49.00	%	% of 100.0	kg
Delay "OFF"	0.000	s	0.000	s		
Reference	Gross weight (% of max. weigh					

Navigation icons: Left arrow, Right arrow, Save (floppy disk), and Exit (door).

Figure 6-9 Limits

Table 6-1 Menu 1.3.1 Limits

Setting	Description
Limit 1 ON, Limit 2 ON, Limit 1 OFF, Limit 2 OFF	See section: Limit value 1 ON, limit value 2 ON, limit value 1 OFF, limit value 2 OFF (Page 107)
Delay time for Limit 1 ON, delay time for Limit 2 ON	See section: Delay time for limit value 1 ON, delay time for limit value 2 ON (Page 108)
Delay time for Limit 1 OFF, delay time for Limit 2 OFF	See section: Delay time for limit value 1 OFF, delay time for limit value 2 OFF (Page 108)

Setting	Description
Limit "Empty" ON	See section: Limit value "Empty" ON (Page 108)
Delay time for Limit "Empty" ON	See section: Delay time for limit value "Empty" ON (Page 109)

6.5.4 Menu 1.4 Advanced scale parameters

Setting

Menu 1.4 Advanced scale parameters

- Scale name (Page 91)
- Unit of weight (Page 91)
- Gross identifier (Page 91)
- Scale interval (Page 93)
- Minimum weighing range (Page 92)
- Maximum weighing range (Page 92)
- Automatic zero adjustment (Page 93)
- Zero by power-on (Page 93)
- Zero by power-on when tare $\neq$ 0 (Page 93)
- Maximum negative zero setting limit (semi-automatically) (Page 95)
- Maximum positive zero setting limit (semi-automatically) (Page 95)
- Rounding for process values (Decimal places for process values (Page 94))
- Subtractive / additive tare device (Page 94)
- Enable Weight simulation (Page 94)
- Maximum tare load (Page 94)
- Standstill range (Standstill range (Page 95))
- Standstill time (Page 96)
- Standstill waiting time (Page 96)
- Limit frequency low pass filter 1 (Page 97)
- Order number low pass filter 1 (Page 97)
- Mean value filter depth (Page 98)
- Limit frequency low pass filter 2 (Page 97)
- Order number low pass filter 2 (Page 98)

6.5.5 Menu 1.5 Communication & interfaces

Menu 1.5.1 Digital input and output settings

Table 6-2 Menu 1.5.1.1 Digital input and output settings 1 of 2

Parameter	Description
Input DI.0 ... DI.3	A command trigger can be assigned to each digital input. When selecting the corresponding field, a drop-down menu appears with the assignable commands and their command number. A description can be found in the command list (Page 75).
Filter digital input	To ensure that the inputs do not respond too quickly to the signal change, a minimum signal pending time can be specified. The pending signal is not processed further until this time has elapsed. The following values can be set: • 0.2 ms • 0.4 ms • 0.8 ms • 1.6 ms • 3.2 ms • 6.4 ms • 12.8 ms

Table 6-3 Menu 1.5.1.1 Digital input and output settings 2 of 2

Parameter	Description
Output DQ.0 ... DQ.3	Various process values can be assigned to the digital outputs. When selecting the corresponding field, a drop-down menu appears with the assignable status messages. A description is provided in the process value list (Page 113).
Error-stop status	This parameter defines the response of the analogue output to faults in the electronic weighing system or SIMATIC STOP. Setting options: • All "Off" - All DQs are set to "0" • Retain function • Predefined values • All "TRUE"

Menu 1.5.2 Analogue output settings

The weighing terminal provides an analogue output.

Parameter	Description
Range	This parameter is used to define the output current range. 0 ... 20 mA 4 ... 20 mA
Reference	The analogue output can be used for a range of purposes. This parameter defines the tag that controls the analogue output. - Gross / net value - Gross value - Net value - Test / force the analogue output
Start value (0/4mA)	This parameter defines the specified value at which 0 or 4 mA is output. The value can be greater or less than the end value.
End value (20 mA)	This parameter defines the specified value at which 20 mA is output. The value can be greater or less than the start value.
Error state	This parameter defines the response of the analogue output following a fault of the SIWAREX module or SIMATIC STOP. 0 mA - Retain value - Predefined value - Output maximum value (24 mA, NAMUR)

Menu 1.5.3 Weight simulation

For test purposes, weight simulation can be enabled instead of actual weighing. Weight simulation can, in certain situations, facilitate scale testing and commissioning. The simulated weight is indicated on the main display with the word "TEST".

To do this, the function must first be activated in the menu item "1.4.3 Advanced scale parameters".

NOTICE
From the start of simulation, all configured limits, inputs and outputs etc. refer to the simulation weight and are therefore in effect.

Parameter	Description
Weight to simulate	Only use weight simulation values which are within the measuring range of the scales. The word "TEST" is displayed on the main display during simulation and a status bit is set. From the start of simulation, all configured limits, inputs and outputs etc. refer to the simulation weight.
Start simulation / Stop simulation	Enables or disables the simulation mode.
Dig. Inputs Dig. Outputs Analogue output Limits	The lower part of the menu item provides visualization of the behavior of the configured limits, inputs and outputs.

Menu 1.5.4 Test & force digital outputs

The digital outputs can be controlled manually in this menu. This requires the assignment of the process value "Test / force output" in the menu item "1.5.1 Digital input and output settings".

Menu 1.5.5 Test & force analogue output

The analogue output can be controlled manually in this menu. This requires the assignment of the process value "Test / force output" in the menu item "1.5.2 Analog output settings".

Menu 1.5.6 RS485 settings

This menu command contains the parameters which define the response of the RS485 interface. If the interface is not used, the default values can be retained.

Parameter	Description
Protocol	This parameter defines the protocol used for communication via the RS485 interface. • No communication/protocol • Modbus RTU • SIEBERT display • SIWAREX DB
Baud rate	This parameter defines the baud rate for the RS485 interface. • 1 200 bps • 2 400 bps • 9 600 bps • 19 200 bps • 38 400 bps • 57 600 bps • 115 200 bps (for SIWAREX DB)

Parameter	Description
Character parity	This parameter defines the character parity for the RS485 interface. - Even (for SIWAREX DB and Mettler-Toledo digital load cell) - Odd (WIPOTEC digital load cell)
Number of data bits	This parameter defines the number of data bits for the RS485 interface. 7 (for digital load cell from Mettler-Toledo) 8 (for SIWAREX DB and digital load cell from WIPOTEC)
Number of stop bits	This parameter defines the number of stop bits for the RS485 interface. 1 (for SIWAREX DB and digital load cells) 2
Modbus address RTU	This parameter defines the Modbus address (1 to 230) for communication with the Modbus protocol via the RS485 interface.
Decimal point remote display	A fixed decimal place must be specified if a Siebert indicator is used. The following values are permitted: 0 ... 4

Menu 1.5.7 Trace settings

The trace function enables logging of all process values, limits, inputs and outputs.

The evaluation of traces is only possible via SIWATOOL → Configuration package (Page 163).
For additional information, refer to the operating instructions of the electronic weighing system.

Parameter	Description
Trace rate	The trace function is used for the continuous recording of measured values. The recording rate is defined with the parameter. - Recording every 10 ms - Recording every 100 ms - Recording every second - Recording every 10 s
Memory type	This parameter is used to specify the response of the trace memory. - Trace recording runs as circular buffer - Trace is stopped when the trace memory is full

Menu 1.5.8 Ethernet settings

The Ethernet parameters of the electronic weighing system can be viewed in this menu. These values cannot be changed.

Parameter	Description
MAC address	The MAC address of the electronic weighing system.
IP address	The IP address of the electronic weighing system. By default this is 192.168.0.21.

Menu 1.5.9 SIWAREX DBTable 6-4 **Menu 1.5.9.2 SIWAREX DB settings 1 of 2**

Variable	Description
Load cell input 1	Location designation of sensor
Load cell input 2	
Load cell input 3	
Load cell input 4	
Channel active	Bit 0: Load cell input 1 Bit 1: Load cell input 2 Bit 2: Load cell input 3 Bit 3: Load cell input 4

Table 6-5 **Menu 1.5.9.2 SIWAREX DB settings 2 of 2**

Variable	Description
Sensor manufacturer	Load cell manufacturer
Sensor order number	Load cell order number
Sensor characteristic value	Characteristic value of the load cell or load cells [mV/V], the mean value is used if there is more than one cell.
Sensor type	0: 4-wire sensor 1: 6-wire sensor

6.5.6 Menu 1.6 Recovery point

Parameter	Description
Create recovery point	Creates an image of the current scale parameters. Execution is not acknowledged.
Load recovery point	Loads the most recently created image of the scale parameters. Execution is not acknowledged.
Load standard scale parameters	-
Load factory settings	The factory settings for scale parameters are restored.

6.6 Menu 2.0 Diagnostics

6.6.1 Menu 2.1 Messages

Opens the message window of the electronic weighing system.

6.6.2 Menu 2.2 Scale status

Menu 2.2.1 Scale status 1 of 4

This overview shows the main status bits.

Parameter	Description
1/4d zero	Set if gross is less than $\pm 0.25e$
9e max	Set if the weight has exceeded the gross weighing range by more than 9 display steps (d)
Tared	Set if tare memory is not equal to zero
pTare	Set if the tare memory is assigned an external specified value
Standstill	Set if standstill condition is met
Maintenance	Set if module is waiting for standstill to execute command
Empty	Set if "Empty" condition is met
GW 1	Limit 1 has responded
GW 2	Limit 2 has responded
Min.	Set if min. is violated
Error clock	Time incorrect due to empty buffer. Reset the time.
Trace active	Set if trace is running
Error DI	Set if command at one of the 4 digital inputs was rejected.
Calibrated	SIWAREX is calibrated
Service	Service mode is enabled
Simulation mode	Simulation mode is enabled
P-PR	Write protection jumper is set.
Error analogue output	Error analogue output - the signal line is interrupted.
Startup	Startup or restore to recovery point has occurred, deleted after 5 seconds
Fault	Operating fault is present (e.g. load cell incorrectly wired, overloaded or underloaded)

Menu 2.2.2 Scale status 2 of 4

You set the central weight defaults in this menu.

Parameter	Description
Preset tare weight	The Preset tare weight status value shows the currently preset tare value. Up to three tare weights can be specified. The presetting is performed in the main menu, "Preset Tare weight" menu item.
Tare (semi-automatic)	Displays the tare value determined semi-automatically.
Initial zero	The scales can automatically be set to zero when the supply voltage is switched on. If the "Zero setting upon startup" (→ menu item 1.4.2 "Advanced scale parameters") is enabled, this still does not specify whether the initial zeroing is also to be performed when the tare weight in the tare memory is not equal to zero. The initial zero status value shows the weight value that was zeroed at the last startup.
Zeroing (semi-automatic)	The scale can be set to zero semi-automatically by the user with the "Zeroing" command if required (see main menu page 49). The zeroing (semi-automatic) status value displays the last zeroed weight value.
Current zero offset (zero-tracking)	The automatic calibration sets the scale to zero without a further command in the event of slow zero drifting. Slow drift is assumed if the OIML R76 criteria for this are met.
Dead load (calculated)	The dead load calculated during the automatic calibration. See 7.2.5 Perform automatic calibration; P. 46

Menu 2.2.3 Scale status 3 of 4

Parameter	Description
Gross (F1) Net (F1)	Gross or net weight value after passing through the low pass filter 1 and average value filter. Gross (F1) and net (F1) are the values shown in the main display. The filters are configured in 1.4.4 Advanced scale parameters.
Tare (process)	Current tare value
Gross (F2) Net (F2)	Gross or net weight value after passing through the low pass filter 2 and average value filter. The filters are configured in 1.4.4 Advanced scale parameters. Gross (F2) and net (F2) can be used to evaluate the signal behavior with different filter settings.
G/N weight	The current weight for the main display.
G/N x 10	The current weight for the main display in higher resolution. The increased resolution is configured in menu item 2.6 Increased resolution.
Tare (display)	Current tare value, rounded.
Refresh counter	Measured values are recalculated every 10 ms in the SIWAREX module. A counter is incremented by 1 each time. Once the counter reaches the value 65536, it starts again from zero.

Menu 2.2.4 Scale status 4 of 4

Parameter	Description
ADC digits	The values at the output of the AD converter - Without filtering - After low pass filter 1 - After low pass filter 2
Status digital inputs	Shows the status of the 4 digital inputs. A set input is indicated by a green field.
Status digital outputs	Shows the status of the 4 digital outputs. A set output is marked by a green field.
Status analogue output	Shows the current value of the analogue output and the corresponding digit value.

Menu 2.2.5 SIWAREX DB status

Table 6-6 Status 1

Variable	Note
Load cell input 1: Load (%)	Current percentual load of the load cell in relation to the rated load of the load cell.
Load cell input 2: Load (%)	
Load cell input 3: Load (%)	
Load cell input 4: Load (%)	

Table 6-7 Status 2

Variable	Note
G/N weight	The current weight for the main display.
Load cell manufacturer	Load cell manufacturer
Serial number	Serial number SIWAREX DB
FW version	FW version number SIWAREX DB
Temperature	Current temperature (°C) of the SIWAREX DB electronic system
Excitation voltage EXC	Excitation voltage EXC (V) with which the load cells are supplied.

Menu 2.2.6 SIWAREX DB inputs

Table 6-8 Input 1 to 4

Variable	Note
Load cell input 1: Status	Bit 0: QI flag Bit 1: Underload Bit 2: Overload Bit 3: SEN error Bit 4: Impedance error Bit 5: EXC short circuit Bit 6: Power supply failure
Load cell input 2: Status	
Load cell input 3: Status	
Load cell input 4: Status	
Load cell input 1: Filtered digit value	Filtered digit value of AD converter from SIWAREX DB according to dig. Filter 1
Load cell input 2: Filtered digit value	
Load cell input 3: Filtered digit value	
Load cell input 4: Filtered digit value	
Load cell input 1: Signal voltage SIG (mV)	Currently measured load cell signal
Load cell input 2: Signal voltage SIG (mV)	
Load cell input 3: Signal voltage SIG (mV)	
Load cell input 4: Signal voltage SIG (mV)	
Load (%)	Current percentual load of the load cell in relation to the rated load of the load cell.
Load cell input 1: Impedance value (Ohm)	Current impedance (Ohm) of connected load cell
Load cell input 2: Impedance value (Ohm)	
Load cell input 3: Impedance value (Ohm)	
Load cell input 4: Impedance value (Ohm)	
Load cell input 1: Sense voltage SEN (V)	Current voltage (V) which is measured between SENSE+ and SENSE- of the load cell
Load cell input 2: Sense voltage SEN (V)	
Load cell input 3: Sense voltage SEN (V)	
Load cell input 4: Sense voltage SEN (V)	

Variable	Note
Load cell input 1: Excitation current (mA)	Current excitation current (mA) which is required for the supply of the load cell.
Load cell input 2: Excitation current (mA)	
Load cell input 3: Excitation current (mA)	
Load cell input 4: Excitation current (mA)	

6.6.3 Menu 2.3 Load trend

Setting/Description

The load trend enables the graphical representation of the weight curve. The gross value (F1) is displayed here. The scaling is performed automatically on the basis of the gross value.

6.6.4 Menu 2.4 Module information

Setting

Table 6-9 Menu 2.4 Module information

Parameter	Description
Order number	Order number of the electronic weighing system contained in the weighing terminal.
Serial number	Serial number of the electronic weighing system contained in the weighing terminal.
Version	Hardware (HW) and firmware (FW) version of the electronic weighing system contained in the weighing terminal.
Version HMI project	Version of the user interface loaded on the Touch Panel.
Support	Phone number and email address of Siemens weighing support.

6.6.5 Menu 2.5 Start / stop trace

Setting/Description

The trace function enables logging of all process values, limits, inputs and outputs. The trace can be started and stopped here. The trace function is configured in menu item 1.4.7. Trace function.

The evaluation of traces is only possible via SIWATOOL. For additional information, refer to the operating instructions of the electronic weighing system.

6.6.6 Menu 2.6 Increased resolution

Setting/Description

If you activate this function, the weight value is displayed with 10 times the resolution. The display switches directly to the operating view and then switches back to the standard resolution after 5 seconds.

6.7 Menu 3.0 Language, Date & Time

Overview

You make the following settings in this menu:

- Language
- Date and
- Time

Three buttons appear after changing a language. Clicking the "Start" button starts the user interface with the newly selected system language. These language settings are retentively stored in the HMI device.

The system time/date is buffered in the weighing module using a capacitor. The buffering time is approx. 8 days. If the system time is lost, e.g. due to a longer downtime, this is indicated in the scale status (menu item 2.2.1) via the "Clock error" status display. The time must then be set again in the menu "3.0 Language, Date & Time" or alternatively via Modbus RTU.

6.8 Menu 4.0 User administration

Overview

The weighing terminal has password protection. This can be deactivated or activated using a DIP switch on the electronic weighing system (inside the weighing terminal).

When the password is active, user management and password assignment are available in the "User password" menu. Password protection affects the "Setup", "Language, Date & Time" and "User Management" menus.

The factory default login information is as follows:

User: ADMIN

Password: WT231 or WT241

Activating the function with the DIP switch

There are two DIP switches on the bottom of the electronic weighing system to the left of the Ethernet connector. These switches are accessible through the ventilation opening.

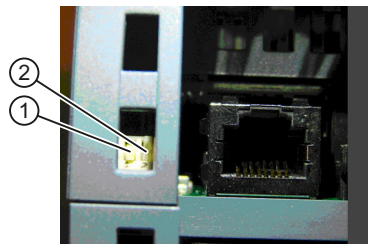


Figure 6-10 DIP switch

Table 6-10 Activation/deactivation of the password protection

Position of DIP switch	① Password protection.	② Operating environment
Up	Password protection activated	Integrated in SIMATIC mode
Down	Password protection deactivated	Stand-alone mode (without SIMATIC controller)

Both switches are in the "down" position ex factory. This deactivates the password protection ex factory and sets the electronic weighing system for stand-alone operation.

To deactivate password protection, set the left DIP switch ① to the "Up" position.

The right DIP switch ② must remain in the "Down" position!

NOTICE

Ensure that the selected access data (user name, password) are stored safely. Without password, there is no more possibility to change the scale parameters or to recalibrate them etc. If the password is lost, the visualization software must be re-installed.

User management

The default password "WT231" or "WT241" can be changed in the "User Management" menu item. New or additional users can be created as well. New users must be assigned to the "Admin group"! The "User" group is currently not supported.

NOTICE

If the default password of the "ADMIN" standard user is changed, the new password should not be lost, otherwise the user management can only be reset with external software!

6.9 Screen saver

In order to protect the Touch Panel, the screen saver of the control panel switches on automatically in the factory after 30 minutes without user input. The time until the screen saver is activated can be freely set between five and 360 minutes. Alternatively, the screen saver can also be fully disabled. To change the settings, proceed as follows:

Start the weighing terminal. Before the application interface appears on the display, the three buttons "Transfer", "Start" and "Control Panel" are visible for five seconds. Press the "Control Panel" button to access the control panel of the operating unit. The screen saver can be set as described above in the "Screensaver" item. Additionally, an acoustic feedback for all touch inputs can be activated in the "Sound Settings" menu item. All other setting options may not be changed or are not relevant for the weighing terminal.

Messages

7.1 Message types

The messages in the electronic weighing system described here are divided into three types.

System status messages

System status messages can be generated spontaneously at any time by an unexpected event. They include internal and external hardware problems which can occur spontaneously during weighing.

Data and operating errors

The data and operating errors are always a response to a command due to a plausibility check.

These are data errors if a plausibility error has been detected in a data packet which was sent to the module and receipt of the packet has been rejected by the module.

These are operating errors if the module cannot execute the sent command in its current operating state.

Technology errors

Technology errors occur spontaneously due to the process flow of a weighing.

Status bits, on the other hand, are not messages. The status displays describe the status of the scale during normal operation and can be monitored or evaluated at any time.

7.2 Message paths

You can read out the messages using different paths. You define the path for forwarding and processing of messages during configuration.

The messages are processed for two basic purposes:

- For display on an Operator Panel for the operator
- For linking in the control software to control specific reactions in the process.

The following message paths are possible:

- Output of the message buffer to the SIWATOOL program (takes place automatically)
- Output by means of function block as bit field in Scale data block
- Output by means of data records DR 30 and DR 32 in case of communication with a Modbus master

7.3 Evaluating messages with the help of SIWATOOL

The electronic weighing system has a message buffer that can hold up to 80 entries. If the number of alarms in the alarm buffer exceeds 80, the oldest entry is overwritten. The message buffer can be read out at any time with the help of SIWATOOL (menu item "Receive all data") and saved together with the scale parameters. This facilitates the detection, analysis and correction of errors in the system.

SIWAREX DB

If you use SIWAREX DB, the type of error of the load cell input affected is reported in SIWATOOL via Supplementary info 1.

7.4 Message list

The message list is an overview of all messages that the SIWAREX module can generate. A message can be quickly identified by the message code (number).

7.4.1 System status message list

Operating errors (code 1000 to 1999) sorted by code no.	Error code	Description and remedy
1000 Operational error exists	1000	Group message, at least one operating error exists.
1001 Watchdog	1001	Watchdog, error is displayed for at least 10 seconds. A serious error has occurred in the function of the electronic weighing system, e.g. program error, severe electromagnetic influence on device, etc. Contact SIWAREX Support if the error occurs multiple times.
1002 RAM error	1002	RAM error. An error has occurred in the memory; the memory content is no longer correct. The electronic weighing system must be switched off. If the error occurs again, the electronic weighing system is defective.
1003 Checksum incorrect parameter	1003	Checksum error at parameter. Critical error because the parameters are no longer safe.
1004 Checksum incorrect program	1004	Checksum error program code. Critical error because the program is no longer safe.
1006 logbook error	1006	Error when writing/deleting, or logbook full
1102 ADU error	1102	AD converter error when reading in the measured value. If the error occurs again, make sure that the EMC recommendations are observed (chapter EMC-compliant setup (Page 23)).
1104 Undervoltage	1104	Undervoltage at sensor cables
1105 Overload	1105	Overload of scale (ca. 110%)
1106 Underload	1106	Underload of scale (ca. -10%)

Operating errors (code 1000 to 1999) sorted by code no.	Error code	Description and remedy
1107 Legal trade main display failure	1107	The calibratable display no longer communicates with the electronic weighing system
1110 SIWAREX DB or digital load cell not ready	1110	No communication with SIWAREX DB or digital load cell

7.4.2 Technology error message list

Technology error (code 2000 to 4999)	Error code	Description and remedy
2000 Technology error exists	2000	Group message, at least one technology error exists
2001 Timeout tare/set to zero	2001	Taring of scale or set to zero is not possible because a standstill was not reached during the standstill time. The command was discarded.
2002 Trace overload	2002	The set recording rate for trace function cannot be processed. Set a slower recording rate (chapter "Trace recording cycle (Page 116)")
2003 Set to zero not possible	2003	The switch-on weight is outside the configured value range for set to zero in data record DR 3 defined by the maximum positive and negative weight.

7.4.3 Data and operating errors message list

Data and command errors (code 5000 to 8999)	Error code	Description and remedy
5000 Data or comand error exists	5000	Group error, a bit is set in the data and operating error bits.
5001 Data record or comand unknown	5001	Command code or data record is not known with current application.
5002 Command or data change not possible because write protection is active	5002	The command or changing of data is not possible due to write protection. The data record was rejected.
5003 Cannot exit service mode	5003	Cannot exit calibration mode; calibration incomplete.
5004 Command or data transfer only permitted in service mode	5004	Activation of service mode is required to execute command or transmit data.
5006 Command or data transfer not possible while BUSY	5006	Command can currently not be executed because module is BUSY (data record or command transmission already active, ...).
5007 Command or data transmission not possible because module is faulty or SIMATIC CPU stop	5007	Command can currently not be executed because of a problem or SIMATIC CPU stop.
5102 Comand not possible while not standstill	5102	Scale command (set to zero, tare, log, ...) cannot be executed because standstill is missing.
5103 Command not possible because legal trade display is missing	5103	Command not possible because legal trade display is missing or not visible.
5104 Command not possible while limit exceeded	5104	Command (e.g. set to zero, tare, calibrate command) cannot be executed because the permitted range has been exceeded. The ranges are defined in DR 3.

7.4 Message list

Data and command errors (code 5000 to 8999)	Error code	Description and remedy
5105 Load cell parameters not plausible	5105	Load cell parameters in data record DR 10 are not plausible (number, support points, load specifications, etc.).
5107 Calibration characteristic shift not possible	5107	Characteristic cannot be moved due to possibility of range violation.
5108 ID does not exist	5108	Requested logbook ID not present in memory.
5109 Logging not possible because weight has not changed since last logging	5109	Standstill must be lost at least once after logging before new logging is possible.
5199 Error in command to DI	5199	Processing of a command triggered at the DIs is not possible. The cause can be determined in data record DR 32.
6002 Logging not possible because weight is too small	6002	Logging is not possible because the limits for the minimum weight or maximum weight were not observed.
7000 Permitted number range violated	7000	The permitted number range, such as for weight values, was violated.
7001 Restriction code unknown	7001	Regulation code for application requiring official calibration not known.
7002 Length of ASCII string not plausible	7002	The string header in a specified string variable is not plausible.
7003 Date / Time parameter not plausible	7003	Specifications for date and time are not plausible.
7004 Assignment of digital input or output incorrect	7004	An error occurred while assigning the digital inputs or digital outputs.
7006 Reserved	7006	Reserved
7007 Calibration weights / Calibration digits not plausible	7007	Specifications for calibration weights or digits in data record DR 3 are incorrect (minimum distance, reversal of incline).
7008 Zero- / Tare values not plausible	7008	The specifications for set to zero (data record DR 3) or tare specifications (data record DR 15) are not plausible.
7009 Standstill range / standstill wait time	7009	Standstill range or standstill wait time are not plausible.
7010 Scale interval / rounding	7010	Resolution or selection for rounding to decimal places is not plausible.
7011 Filter parameters	7011	Specification of filter parameters is not plausible.
7013 Interface assignment for legal-for-trade HMI not plausible	7013	The assignment of the interface to the legal-for-trade HMI is incorrect.
7014 Time parameter not plausible	7014	Specified time value is not plausible or may be signaled in connection with additional errors.
7016 Analog output parameter not plausible	7016	The parameters for the analog output (data record DR 7) are not plausible.
7017 MAC address cannot be changed	7017	
7018 Error in IP mask	7018	The specified IP addresses (DR12) are not plausible.
7019 RS485 parameter error	7019	The specified RS485 interface parameters (DR13) are not plausible.

7.4.4 Messages by LEDs on the electronic weighing system

The LEDs on the front of the electronic weighing system signal the following status and error messages.

Item	Color	Labeling	Function
Line 1			
LED 0	Red	DIAG	System fault
	Green		Ready
	Green		Service mode is switched on
	flashing		
LED 1	Yellow		Limit 1 activated
LED 2	Yellow		Limit 2 activated
LED 3	Yellow		Limit 3 responded (empty limit)
LED 4	Green		Standstill status
LED 5	Green	-0-	¼ d zero status
LED 6	Red		Max. violated (with NAW Max+9e)
LED 7	Yellow		Parameter input blocked (write protection)
LED 8			Not used
LED 9	Green	LC	Load cell(s) OK
	Red		Load cell(s) faulty
LED 10			Not used
LED 11			Not used
LED 12			Not used
LED 13			Not used
LED 14			Not used
LED 15			Not used
LED 16	Green	AQ	Analog output active
	Red		Analog output error
Line 2			
LED 1	Green	LINK	LAN connection exists
LED 2	Yellow	Rx/Tx	LAN communication active
LED 3			Not used
LED 4			Not used
LED 5	Green	DI.0	Digital input 0 active
LED 6	Green	DI.1	Digital input 1 active
LED 7	Green	DI.2	Digital input 2 active

7.4 Message list

Item	Color	Labeling	Function
LED 8	Green	DI.3	Digital input 3 active
LED 9			Not used
LED 10			Not used
LED 11	Yellow	Rx/Tx	RS485 communication active
LED 12			Not used
LED 13	Green	DQ.0	Digital output 0 active
LED 14	Green	DQ.1	Digital output 1 active
LED 15	Green	DQ.2	Digital output 2 active
LED 16	Green	DQ.3	Digital output 3 active

Command lists

8.1 Overview

The commands for the electronic weighing system described here can be transmitted by several interfaces:

- by the Operator Panel via the controller to the SIWAREX module
- by the Operator Panel directly to the SIWAREX module
- by SIWATOOL directly to the SIWAREX module
- by the digital inputs after corresponding assignment in data record DR 7

A data or command error is signaled if a command cannot be executed or if the sent data record is rejected.

Detailed descriptions of the commands can be found in the following command lists:

- Table 8-1 Commands 1 ... 99: Service commands (Page 76)
- Table 8-2 Commands 400 ... 449; log commands, statistics, logbook (Page 77)
- Table 8-3 Commands 450 ... 499: Trace commands (Page 78)
- Table 8-4 Commands 700 to 899: HMI display switching (Page 78)
- Table 8-5 Commands 1000 ... : Basic functions for weighing commands (Page 79)
- Command groups of the electronic weighing system (Page 80)

See also

Command lists (Page 75)

8.2 Command lists

The commands for the electronic weighing system described here can be transmitted by several interfaces:

- From the operator panel via the controller to the electronic weighing system
- From the operator panel directly to the electronic weighing system
- From SIWATOOL directly to the electronic weighing system
- Via the digital inputs after corresponding assignment in data record DR 7

A data or command error is signaled if a command cannot be executed or if the sent data record is rejected.

Table 8-1 Commands 1 ... 99: Service commands

Command code	Command	Description	Protected
1	Service mode On	Turn on service mode	
2	Service mode Off	Turn off service mode	
3	Test mode On (simulation)	Turn on test mode. The simulation value from data record 16 is used instead of the measured value for calculation of the process values.	
4	Test mode Off (simulation)	Switch off test mode.	
11	Load factory setting	The command resets the electronic weighing system to the "Ex factory" state. During this process: - All parameters and saved data (including protocol memory and logbook) as well as the restore point are loaded with the default values - All message buffers (diagnostic buffer, trace memory, etc.) are reset	P
12	Load standard parameters	Like "Load factory settings" (command code 11), but interface settings for Ethernet and Modbus RTU are not reset to the factory setting.	P
31	Load restore point	All parameters saved in the restore point are activated.	P
51	Create restore point	Saves the parameters of the restore point to the memory.	P
60	Set Calibration Point 0	Set Calibration Point 0 / save values for calibration point 0.	P
61	Set Calibration Point 1	Set Calibration Point 1 / save values for calibration point 1.	P
62	Set Calibration Point 2	Set Calibration Point 2 / save values for calibration point 2.	P
81	Characteristic shift	Move calibration characteristic. The command defines the current weight of the scale as the new zero point (0 kg) and shifts the complete characteristic without changing the gradient. The command can be used, for example, in order to compensate parts used for mounting calibration weights on the scale at the end of the calibration.	P

Command code	Command	Description	Protected
82	Perform automatic calibration	Calculating the scale characteristic curve with reference to the load cell from data record 10. The calculated characteristic curve is entered directly in data record 3 and 4, and thus activated immediately after executing the command. The scale must be empty when the command is executed.	P
83	Perform calibration check	The command calculates the theoretical digital values in relation to the calibration weights using the load cell parameters from data record 10 and the calibration weights 0, 1 and 2 from data record 3. The output of these theoretical digits is made in data record 4. The function can be used to check the plausibility of calibration digits in data record 3, which have been determined in a legal-for-trade calibration.	
905	Start communication with digital load cell	If a digital load cell (WIPOTEC or Mettler-Toledo) is used, initialize or start communication between the electronic weighing system and the load cell once using command 905. The command is stored retentively. When changing the interface parameters (baud rate, parity, etc.), stop the communication and restart it. The "Digital load cell ready" status bit in DS30 provides information on whether or not communication is taking place.	
906	Stop communication with digital load cell	If a digital load cell (WIPOTEC or Mettler-Toledo) is used, you can use command 906 to stop communication between the electronic weighing system and the load cell. This is required, for example, when replacing the load cell. When communication is removed, the "Digital load cell ready" bit in DS30 goes to FALSE and the electronic weighing system indicates a fault.	

Table 8-2 Commands 400 ... 449; log commands, statistics, logbook

Command code	Command	Description	Protected
401	Generate log	Log current parameters relevant to the calibration	
405	Delete log memory	Delete all logs	P
440		Delete the logbook. Only permitted in non-calibrated state.	
441	Reserve		

Table 8-3 Commands 450 ... 499: Trace commands

Command code	Command	Description	Protected
451	Trace RAM on	Start permanent tracing	
452	Trace RAM off	Stop permanent tracing	
453	Single trace RAM	Create single trace (current state)	
454	Delete trace RAM	Delete tracing memory.	

Table 8-4 Commands 700 to 899: HMI display switching

Command code	Command	Description	Protected
701	Increased resolution	Enable increased resolution on the main display and the SecureDisplay (x 10), for duration of 5 s	
705	Display current tare weight	Display current tare weight on main display and SecureDisplay	
710	Activate standard display	Enable the standard display for gross/net (main display and SecureDisplay)	
714	N process value (no write protection)	Display the net process weight on the main display, only permitted if OIML is not set as the restriction code (main display and SecureDisplay)	P
715	G process value (no write protection)	Display gross process weight on main display, only permitted if OIML R76 is not set as the regulation code (main display and SecureDisplay)	P
716	G process value after filter 2	Display gross process weight (commissioning) on main display, only permitted if OIML R76 is not set as the regulation code (main display and SecureDisplay)	P
801	Display currently set calibration regulation /country code	Display currently set calibration regulation temporarily on the main display (main display and SecureDisplay), for duration of 5 s	
802	Display weighing range data	Display weighing range data (min., max., digit step) in the legal trade display SecureDisplay (for duration of 10 s)	
860	Hide display	Hides the legal trade display SecureDisplay	
861	Legal trade display for variant 1	Acts on the legal trade display SecureDisplay. Enables version 1 for display size and position according to DisplayCali.xml file	
862	Legal trade display for variant 2	Acts on the legal trade display SecureDisplay. Enables version 1 for display size and position according to DisplayCali.xml file	
863	Legal trade display for variant 3	Acts on the legal trade display SecureDisplay. Enables version 1 for display size and position according to DisplayCali.xml file	

Command code	Command	Description	Protected
864	Legal trade display for variant 4	Acts on the legal trade display SecureDisplay. Enables version 1 for display size and position according to DisplayCali.xml file	
865	Legal trade display for variant 5	Acts on the legal trade display SecureDisplay. Enables version 1 for display size and position according to DisplayCali.xml file	
870	Display smallest representation of legal trade display	Shows the smallest possible display of the SecureDisplay according to parameter "Min. zoom factor Display%" in DR3	
871	Display current serial number	Display serial number of SIWAREX temporarily on the main display and in SecureDisplay for a duration of 5 s	
875	Display FW version	Display current firmware version of module on SecureDisplay	
876	Display SecureDisplay software version		
881	Display first logbook entry	The first logbook entry is displayed on the SecureDisplay.	
882	Display last logbook entry	The last logbook entry is displayed on the SecureDisplay.	
883	Display reading of previous entry	The logbook entry prior to the last read entry is displayed on the SecureDisplay.	
884	Display reading of subsequent entry	The logbook entry after the last read entry is displayed on the SecureDisplay.	
891	Display log entry (DS46)	The log entry requested in DS45 is displayed on the SecureDisplay, for duration of 10 s.	
Reserve			
Reserve			
Reserve			

Table 8-5 Commands 1000 ... : Basic functions for weighing commands

Command code	Command	Description	Protected
1001	Set to zero	Zeroing (semi-automatic)	
1011	Tare	Taring (semi-automatic)	
1012	Delete tare	Delete current tare weight	
1013	Tare specification 1 valid	Activate specification tare weight 1	
1014	Tare specification 2 valid	Activate specification tare weight 2	
1015	Tare specification 3 valid	Activate specification tare weight 3	
1016	SIMATIC tare specification	Specified tare weight from SIMATIC I/O interface	

8.3 Command groups of the electronic weighing system

The following commands can be triggered in the scale data block DB_SCALE in the range CMD1 to CMD3:

Command code	Description
1 ... 1999	The meanings of the commands correspond to the command list (see → Command lists (Page 75)).
2000 + X	Reading a data record from the electronic weighing system X = Data record number Example: Data record 3 transmitted by the electronic weighing system to the SIMATIC controller → 2000 + 3 = command code 2003
4000 + X	Writing of data record to the electronic weighing system X = Data record number Example: Data record 3 transmitted by the SIMATIC controller to the electronic weighing system → 4000 + 3 = command code 4003
7001	Read all data. Read all data from the electronic weighing system to the SIMATIC controller
7002	Write all data. Write all data from the SIMATIC controller to the electronic weighing system (service mode has to be turned on)

Communication via Modbus

The current process values and parameters can be exchanged via the RS485 interface with Modbus RTU or the Ethernet interface with Modbus TCP/IP. It is possible to use both interfaces for the communication.

Note

The electronic weighing system is designed for use in secure (closed) networks and does not have any protection against unauthorized data traffic.

The following chapters describe the specifications for handling communication. The following functions can be executed:

- Export parameters from the electronic weighing system
- Write parameters
- Export current process values
- Monitor messages

9.1 Principle of data transmission

This description is valid for communication via Modbus RTU and Modbus TCP/IP.

The standardized MODBUS protocol is used for communication. The connected communication partner always has the master function, while the electronic weighing system is always the slave.

Data transfer is bidirectional. The master function is always in the connected electronic weighing system which "controls" the communication with corresponding requests to the respective electronic weighing system address. The electronic weighing system is always the slave and responds to the requests of the master with a response frame, provided that the address matches.

Each Modbus partner has its own address. The electronic weighing system has the address 1 as the factory setting. You can change the address as a parameter (e.g. in SIWATOOL). This address is without significance if the Ethernet interface is used because the connection is based on the IP address.

If the RS485 interface is used, the following character frame is valid:

Start bit	1
Number of data bits	8
Parity	Even
Stop bit	1

9.3 Command mailboxes

You can set the following baud rates:

- 9 600 bps
- 19 200 bps (default setting)
- 38 400 bps
- 57 600 bps
- 115 200 bit/s

Functions which can be used by the master are listed below. The structure and contents of the registers are shown in section Scale parameters and functions (Page 85).

Service	Function code	Usage
Read Holding Registers	03	Read one or more 16-bit parameter registers
Write Single Register	06	Write a single parameter register
Write Multiple Registers	16	Write multiple registers

If a request of the master is answered by the electronic weighing system (slave), the electronic weighing system sends a response frame with or without errors. In the case of a response without error message, the response frame contains the received function code; in the case of errors, the highest bit of the function code is set. This corresponds to the Modbus standard. Afterwards, the master requests the data record DR 32 to check which process-related data or command errors exist.

9.2 Data record concept

The register assignment is an image of the data records. The chapter → Scale parameters and functions (Page 85) describes the data records, variables and functions, including the register addresses. The data records are always checked as complete data packets for plausibility. For this reason, you must follow a specific procedure to change individual parameters.

9.3 Command mailboxes

Corresponding command codes must be sent in order to execute commands and to read and write data records in the Modbus buffer memories. These are described in more detail in chapter → Command lists (Page 75). The following tables list the Modbus registers used to process these commands:

Table 9-1 Command mailbox 1: Highest priority

Variable	Note	Type	Modbus registers
CMD1_CODE	Code of command to be executed	USHORT	910
CMD1_TRIGGER	Trigger for starting the command	USHORT	911
CMD1_STATUS	0=job running; 1=job finished (1 cycle)	USHORT	912
CMD1_QUIT	0=no error; <>0=error code	USHORT	913

Table 9-2 Command mailbox 2: Medium priority

Variable	Note	Type	Modbus registers
CMD2_CODE	Code of command to be executed	USHORT	920
CMD2_TRIGGER	Trigger for starting the command	USHORT	921
CMD2_STATUS	0=job running; 1=job finished (1 cycle)	USHORT	922
CMD2_QUIT	0=no error; <>0=error code	USHORT	923

Table 9-3 Command mailbox 3: Low priority

Variable	Note	Type	Modbus registers
CMD3_CODE	Code of command to be executed	USHORT	930
CMD3_TRIGGER	Trigger for starting the command	USHORT	931
CMD3_STATUS	0=job running; 1=job finished (1 cycle)	USHORT	932
CMD3_QUIT	0=no error; <>0=error code	USHORT	933

9.4 Reading registers

The method for reading registers depends on whether they belong to the writable data records (DR 3 to DR 29) or can only be read as current values (DR 30 to DR 34).

If you wish to read the registers from the data records DR 3 to DR 29, you must first export these as a complete data record to the internal output buffer.

All Modbus registers of the individual parameters can be found in chapter → Scale parameters and functions (Page 85).

Example

A parameter is to be read from data record 3 (DR 3).

- First, write register CMD3_CODE with 2003 (2000 plus the number of the data record = read data record).
- Then write CMD3_TRIGGER with "1". DR3 is now updated in the Modbus buffer.
- It is now possible to read one or more registers with the corresponding variable(s). The data consistency of the registers read at this time is guaranteed.

You can find all further command numbers in chapter → Command lists (Page 75).

Example

A current measured value is to be read out from DR 30.

⇒ The register can be directly requested because its contents are automatically refreshed in the SIWAREX module at the specified measuring rate of 100 Hz and are always available up-to-date.

9.5 Writing registers

If you wish to write registers from the data records DR 3 to DR 29, you must first export the corresponding data record to the internal output buffer using an appropriate command. Individual registers can then be written. The complete data record must subsequently be written internally using an appropriate command. A plausibility check of the complete data record is carried out in the process.

Example

A parameter from DR 3 is to be written.

- First, write register CMD3_CODE with 2003 (2000 plus the number of the data record).
- Then write CMD3_TRIGGER with "1". The DR 3 is then updated in the Modbus memory.
- You can now write or change one or more registers with the corresponding variable. If you wish to transfer the written/changed registers to the scale, it is necessary to write the complete data record:
- First, write register CMD3_CODE with 4003 (4000 plus the number of the data record = write data record).
- Then write CMD3_TRIGGER with "1".
- The data record is then transferred to the process memory in the SIWAREX module. All registers of the data record are checked for plausibility in the process.

If the plausibility check fails, the complete data record is not written and a message is output to the user (from the area of data/operator errors).

You can find all further command numbers in chapter → Command lists (Page 75).

In addition, an online document is available for working with SIWAREX WP231 and Modbus → Modbus communication of WP231 (<http://support.automation.siemens.com/WW/view/de/77913998>).

Scale parameters and functions

10.1 Parameters and functions

All parameters are set to default values in the factory. You can restore the configuration to factory settings using the "Load factory settings" command.

You can also create your own restore point. You can reload the saved configuration at a later point in time with the "Load recovery point" command.

The default parameters are set such that the scale is immediately ready for operation. The weight value indicates changes in weight on the load cell, but only corresponds to the actual weight following a calibration. You do not need to re-enter all parameters. The advantage of this solution is that you can decide the default values to be retained and the parameters that need to be adapted for your application.

The scale functions governed by the parameters are also described in the parameter description below.

First, the parameters of a given data record are displayed in a table. The detailed parameter description for the parameters of this data record then follows.

When it receives new parameters, the electronic weighing system runs a plausibility check. In the event of a parameter assignment error, the data record is not applied (not saved) by the electronic weighing system and a data operator error is reported.

10.2 Assigning parameters to the electronic weighing system with SIWAREX DB

Introduction

You can assign parameters to the SIWAREX WP electronic weighing systems using the SIMATIC HMI, the SIWATOOL or the SIMATIC S7 control system. The procedure described for you is oriented to the data records (DS) from SIWATOOL and the SIMATIC S7 control system.

Procedure

1. Set the Load cell type parameter to SIWAREX DB in data record DR03. (Not relevant for SIWAREX WP321)
2. Set the RS 485 protocol parameter to SIWAREX DB and the RS 485 baud rate to 115 200 bits/s in data record DR13.
3. Activate the load cell input for every connected load cell in the data record DR70.
4. Specify whether 4- or 6-wire load cells are connected for the Sensor type parameter in data record DR70.

10.4 DR 3 calibration parameters

5. In order to identify the load cell type and the installation location of your load cells enter the Load cell manufacturer, Load cell order number and Location Designation of Sensor in the data record DR70.
6. The details of the data data records and parameters are specified in the parameter assignment tables.

See also

Scale parameters and functions (Page 85)

10.3 DR 2 command code

DR 2 is a special data record used to transfer commands to the SIWAREX module by SIWATOOL.

10.4 DR 3 calibration parameters

The calibration parameters need to be checked and if necessary modified for all scales.

The scale is basically defined by calibration parameters and calibration operation. A wire jumper on the P-PR (Parameter Protection) terminals means that the DR 3 data can no longer be changed (write-protected). All changes in data record 3 require service mode to be switched on for the module. If service mode is not active, all parameter inputs are directly rejected with an error.

Procedure

- Check all parameters and modify them as required
- Transfer the DR 3 data record from SIWATOOL to the scales
- Calibrate the scale
- Transfer the DR 3 data record from the scales to SIWATOOL

Table 10-1 Assignment of data record 3

Variable	Note	Type	Length (bytes)	Read/Write protection	Default	Min.	Max.	Modbus registers
Data record number	Contains no. of data record	USHORT	2	r	3	-	-	1000
Length	Data record length information	USHORT	2	r	192	-	-	1001
Application	Information on which application the DR belongs to	USHORT	2	r	101	-	-	1002
Version identifier	Information on the current data record version	USHORT	2	r	1	1	65635	1003

Variable	Note	Type	Length (bytes)	Read/write protection	Default	Min.	Max.	Modbus registers
Scale name header	Maximum length and actual length of string for scale name	UBYTE[2]	2	rwP	12,12	-	-	1004
Scale name (Page 91)	Scale name specified by user	CHAR[12]	12	rwP	" "	-	-	1005
Weight unit header	Maximum length and actual length of string for unit of weight (e.g.: g, kg, t, ...)	UBYTE[2]	2	rwP	04,04	-	-	1011
Unit of weight (Page 91)	Weight unit	CHAR[4]	4	rwP	"kg••"	-	-	1012
Gross identifier header	Maximum length and actual length of string for weight unit	UBYTE[2]	2	rwP	02,02	-	-	1014
Gross identifier (Page 91)	Abbreviation of gross (B or G), only one byte is used!	CHAR[2]	2	rwP	"B"	"B"	"G"	1015
Load cell type	Type of connected load cell: 0: Analog DMS load cell/DMS load cells 1: Digital load cell Mettler-Toledo type WMS/WMH 2: Digital load cell Mettler-Toledo type PBK9-APW/PFK9-APW 3: Digital load cell Wipotec 4: SIWAREX DB	USHORT	2	rw	0	-	-	1016
Code for regulations (Page 92)	0: None 1: OIML R76 (available soon)	USHORT	2	rwP	0	-	-	1017
Minimum weighing range (Page 92)	Minimum number d	USHORT	2	rwP	20	0	65535	1018
Reserve	Reserve	USHORT	2	rw	0	-	-	1019
Maximum weighing range (Page 92) ¹⁾	Maximum weight	FLOAT	4	rwP	100	> weighing_range_min	maximum number range	1020

10.4 DR 3 calibration parameters

Variable	Note	Type	Length (bytes)	Read/write protection	Default	Min.	Max.	Modbus registers
Calibration weights 0, 1, 2 and calibration digits 0, 1, 2 (Page 93)	Calibration weight 0 ¹⁾ (usually the zero point)	FLOAT	4	rwP	0	1	maximum number range	1022
	Calibration weight 1 ¹⁾	FLOAT	4	rwP	100	1	maximum number range	1024
	Calibration weight 2	FLOAT	4	rwP	0	1	maximum number range	1026
	Calibration digits 0 determined during calibration with calibration weight 0	FLOAT	4	rwP	0	-1000000	1000000	1028
	Calibration digits 1 determined during calibration with calibration weight 1	FLOAT	4	rwP	2000	0	1000000	1030
	Calibration digits 2 determined during calibration with calibration weight 2	FLOAT	4	rwP	0	0	1000000	1032
Scale interval (Page 93) ¹⁾	Resolution weighing range 1 ($1 \cdot 10^{**k}$, $2 \cdot 10^{**k}$, $5 \cdot 10^{**k}$]; k: -3 ... 2)	FLOAT	4	rwP	0.1	0.001	50	1034
Zero by power-on (Page 93)	Zero by on 0: Zero by on off 1: Zero by power-on on	BIT	0	rw	0	0	1	1036.16
Zero by power-on when tare $\neq$ 0 (Page 93)	Zero by on when tare $\neq$ 0 0: No zero by on performed when tare weight $\neq$ 0 1: Zero by power-on when tare $\neq$ 0	BIT	0	rw	0	0	1	1036.15
Automatic zero adjustment (Page 93)	0: auto. zero adjustment off 1: Autom. zero adjustment on	BIT	0	rw	0	0	1	1036.14
Subtractive / additive tare device (Page 94)	Subtractive / additive tare device 0: Subtractive tare device 1: Additive tare device	BIT	0	rwP	0	0	1	1036.13
Weight simulation (Page 94)	Weight simulation 0: Weight simulation, disabled 1: Weight simulation value of DR16 applied Weight simulation is always disabled when write protection is enabled	BIT	0	rwP	0	0	1	1036.12
Bit 5	Bit 5: Reserve	BIT	0	rw	0	0	1	1036.11

Variable	Note	Type	Length (bytes)	Read/write protection	Default	Min.	Max.	Modbus registers
Bit 6	Bit 6: Reserve	BIT	0	rw	0	0	1	1036.10
Bit 7	Bit 7: Reserve	BIT	0	rw	0	0	1	1036.9
Bit 8	Bit 8: Reserve	BIT	0	rw	0	0	1	1036.8
Bit 9	Bit 9: Reserve	BIT	0	rw	0	0	1	1036.7
Bit 10	Bit 10: Reserve	BIT	0	rw	0	0	1	1036.6
Bit 11	Bit 11: Reserve	BIT	0	rw	0	0	1	1036.5
Bit 12	Bit 12: Reserve	BIT	0	rw	0	0	1	1036.4
Bit 13	Bit 13: Reserve	BIT	0	rw	0	0	1	1036.3
Bit 14	Bit 14: Reserve	BIT	0	rw	0	0	1	1036.2
Bit 15	Bit 15: Reserve	BIT	2	rw	0	0	1	1036.1
Decimal places for process values (Page 94)	0: No rounding 1: Rounding to 1 decimal place 2: Rounding to 2 decimal places 3: Rounding to 3 decimal places 4: Rounding to 4 decimal places 5: Rounding to 5 decimal places 6: Rounding to 6 decimal places	USHORT	2	rwP	0	0	6	1037
Maximum tare load (Page 94)	Range of the subtractive tare device [in % of max. weighing range] (must not exceed 100% with regulation code "OIML")	FLOAT	4	rwP	0	0	250	1038
Maximum negative zero setting limit (power-on) (Page 95)	Negative range of the zero by on device [in % of maximum weight WBmax] (amount of positive + negative zero setting limit must not exceed 20% with country code "OIML")	FLOAT	4	rwP	1.0	0	100.0	1040
Maximum positive zero setting limit (power-on) (Page 95)	Positive range of the zero by on device [in % of maximum weight WBmax] (amount of positive + negative zero setting limit must not exceed 20% with country code "OIML")	FLOAT	4	rwP	3.0	0	100.0	1042
Maximum negative zero setting limit (semi-automatically) (Page 95)	Negative range of the semi-automatic zeroing [in % of maximum weight WRmax] (amount of positive + negative zero setting limit must not exceed 4% with country code "OIML")	FLOAT	4	rwP	10.0	0	100.0	1044
Maximum positive zero setting limit (semi-automatically) (Page 95)	Positive range of the semi-automatic zeroing [in % of maximum weight WRmax] (amount of positive + negative zero setting limit must not exceed 4% with country code "OIML")	FLOAT	4	rwP	3.0	0	100.0	1046

10.4 DR 3 calibration parameters

Variable	Note	Type	Length (bytes)	Read/Write Protection	Default	Min.	Max.	Modbus registers
Standstill range (Page 95)	Standstill range (in d)	FLOAT	4	rwP	0.1	0	maximum number range+	1048
Standstill time (Page 96)	Standstill time 1 in ms	TIME	4	rwP	2000	10	10000	1050
Standstill waiting time (Page 96)	Waiting time until standstill. 0: standstill-dependent scale command, if there is no standstill, immediately rejected. > 0: Maximum waiting time until command is executed	TIME	4	rw	2000	0	10000	1052
Low-pass cut-off frequency (Page 97)	Frequency low pass filter 1: 0: Filter disabled	FLOAT	4	rwP	0.5	tbd	tbd	1054
Low-pass filter number (Page 97)	Ordinal number of low-pass filter 1: Filter ordinal number 2*(1 ... 5)	USHORT	2	rwP	4	2	10	1056
Reserve 2	Reserve	USHORT	2	rw	0	-	-	1057
Low-pass filter limit frequency (commissioning) (Page 97)	Frequency low pass filter 2: 0: Filter disabled	FLOAT	4	rw	0	tbd	tbd	1058
Low-pass filter number (commissioning) (Page 98)	Ordinal number of low-pass filter 2: Filter ordinal number 2*(1 ... 5)	USHORT	2	rw	4	2	10	1060
Mean value filter depth (Page 98)	Filter for digit values, Permissible filter depth: 0 ... 250	USHORT	2	rwP	10	0	250	1061
Display weighing range data (Page 98)	Display weighing range data 0: No 1: Yes	USHORT	2	rwP	0	0	1	1062
Interface for legal trade display (Page 98)	Selection of interface for SecureDisplay: 0: SecureDisplay not used 1: SecureDisplay over SIWAREX Ethernet port 2: SecureDisplay on CPU 1200	USHORT	2	rw	0	0	3	1063
Firmware version SecureDisplayHeader	Maximum length and actual length of string for FW version of SecureDisplay	UBYTE[2]	2	rw	12, 12			1064

Variable	Note	Type	Length (bytes)	Read/write protection	Default	Min.	Max.	Modbus registers
Firmware version SecureDisplay (Page 98)	FW version of the SecureDisplay used on the HMI	CHAR[12]	12	rw				1065
Reserve	Reserve	UBYTE[2]	2	rw	0	-	-	1071
Reserve	Reserve	CHAR[20]	20	rw	0	-	-	1072
Reserve	Reserve	UBYTE[2]	2	rw	0	-	-	1082
Reserve	Reserve	CHAR[20]	20	rw	0	-	-	1083
Minimum display size [%] (Page 98)	Maximum factor for minimizing the SecureDisplay. Value must not be smaller than the smallest value defined in the DisplayCali file.	USHORT	2	rwP	0	-	-	1093
Reserve 4	Reserve	FLOAT	4	rw	0	-	-	1094

¹⁾ Parameter for calculation of calibration points with theoretical calibration

10.4.1 Scale name

You can select any name, but it may not exceed 12 characters. You can enter any designation.

Note

The scale name cannot be changed after official verification.

10.4.2 Unit of weight

A string with up to four digits can be specified as the unit of weight, e.g.: t, kg, lbs. The defined unit of weight applies to all weight specifications. Entries are not be converted if the unit of weight has changed. Entries must be left-aligned.

10.4.3 Gross identifier

The gross identifier specifies the letter, B (for brutto) or G (for gross), to be used in the display for gross weights.

10.4.4 Load cell type

Sets the connected load cell type.

Communication with the digital load cells is started with command 905 and stopped with command 906. The receipt of the cyclic weight telegrams from the digital load cell is monitored. If no telegram is received for the configured time, for example, 2000 ms, the electronic weighing system reports an operation fault "Digital load cell is not ready". A status bit in the DR 30 also provides information about whether the digital load cell is ready. If the status bit is not set, the weight values cannot be evaluated because no plausible weight values are received. In addition to selecting the digital load cell, the standstill time and standstill range is configured as follows in DR 3:

- Stability time = 0 or stability weight = 0 status information of the Mettler load cells for standstill display
- Stability time = 0 or stability weight = 0 Electronic weighting system calculates the stability as with connected analog load cell from the stability parameters

10.4.5 Code for regulations

Activates a parameter check in accordance with OIML for operation requiring verification of the scales.

Selection code	
0 (default)	No regulations
1	OIML regulations

10.4.6 Minimum weighing range

The weight value can only be used above the minimum weighing range for legal trade registration with the specified scale interval. The minimum weighing range in the unit "d" (scale interval) is defined during calibration/official verification.

The factory setting is 0 d. 20 d is generally entered for legal trade scales.

10.4.7 Maximum weighing range

For purposes requiring official calibration, the weight can only be used with the defined scale interval below the maximum weight (+ 9 d, d = scale interval). The maximum weight is defined during commissioning.

The maximum weight depends on the number and type of load cells used.

10.4.8 Calibration weights 0, 1, 2 and calibration digits 0, 1, 2

The calibration weights and corresponding calibration digits define the characteristic curve of the scales. A detailed description can be found in section Calibration procedure (Page 99).

10.4.9 Scale interval

The scale interval for the weighing range can be defined in accordance with EN 45501 (0.0001 to 50).

10.4.10 Zero by power-on

The scales can automatically be set to zero when the supply voltage is switched on (in legal trade operation, this is at the end of the startup waiting time). A weight of $\pm 10\%$ of the maximum measuring range can be set to zero by power-on for legal trade scales.

NOTICE
If the scales are not being used in legal trade operation (no OIML restrictions), fully loaded scales can also be set to zero once this function is enabled. The function can, however, be limited by setting a maximum and minimum weight for zero by power-on. See the section on maximum and minimum weights for zero by power-on.

10.4.11 Zero by power-on when tare $\neq 0$

The scales can automatically be set to zero when the supply voltage is switched on. If the Zero by power-on (Page 93) function is enabled, this still does not specify whether zero by power-on is also to be performed if the tare weight in the tare memory is not equal to zero.

If the "Zero by power-on activated for tared scales" parameter is set, the tare weight is also be cleared upon zero by power-on; if the parameter is not set, the scales are not set to zero.

10.4.12 Automatic zero adjustment

If necessary, the scales can be set semi-automatically to zero by the user by means of the "Zeroing" command.

The automatic adjustment sets the scale to zero without a further command in the event of slow zero drifting. Slow drift is assumed if the OIML R76 criteria for this are met.

Note

If the scales are not being used in legal trade operation (no OIML restrictions) and this function is enabled, the scales may eventually read zero after a slow drift even if they are fully loaded. The function can, however, be limited by setting a maximum and minimum weight for zeroing.

10.4.13 Subtractive / additive tare device

If necessary, the scales can be tared using the Tare" command.

The display value is hidden when a subtractive tare is enabled if the gross value exceeds the maximum weighing range by more than 9e.

When an additive tare is enabled, the display value is not hidden until the net weight exceeds the maximum weighing range. The maximum subtractive tare is 100 % and the maximum additive tare 250 % of the maximum weighing range.

The current tare value is deleted if you switch between additive and subtractive taring.

NOTICE
There is no automatic evaluation of whether there is sufficient load cell measuring range capacity for an additive tare.

10.4.14 Weight simulation

For test purposes, weight simulation can be enabled instead of actual weighing. The simulated weight is specified using the DR 16 data record. Weight simulation can, in certain situations, facilitate scale testing and commissioning. The simulated weight is indicated on the main display with the word "TEST".

10.4.15 Decimal places for process values

This parameter is used to specify the number of decimal places to which the process values are to be rounded. This specification separates the main weight display, which is subject to the legal trade restrictions, and the values used in the control software.

10.4.16 Maximum tare load

The weighing module accepts any external tare specification which is less than the maximum tare load (percentage of maximum weighing range). Tare commands are also accepted provided that the current gross weight is less than the configured maximum tare load.

10.4.17 Maximum negative zero setting limit (power-on)

Zeroing means the scales are automatically set to zero when the supply voltage is switched on.

If zero by power-on upon supply voltage ON is enabled, you can limit the effect of this function. The limitation is based not on the actual weight, but rather on the weight which the scales would display had there been no zeroing.

10.4.18 Maximum positive zero setting limit (power-on)

Zeroing means the scales are automatically set to zero when the supply voltage is switched on.

If zero by power-on upon supply voltage ON is enabled, you can limit the effect of this function. The limitation is based not on the actual weight, but rather on the weight which the scales would display had there been no zeroing.

10.4.19 Maximum negative zero setting limit (semi-automatically)

Zeroing defines the current weight of the scales as zero.

You can restrict the effect of the zeroing function by defining limits. The limitation is based not on the current gross weight, but rather on the weight which the scales would display had there been no zeroing (time of scale calibration).

For legal trade scales, the limitation is 4 % of the weighing range between the negative and positive weight for zeroing.

10.4.20 Maximum positive zero setting limit (semi-automatically)

You can restrict the effect of the zeroing function by defining limits. The limitation is based not on the current weight, but rather on the weight which the scales would display had there been no zeroing (time of scale calibration).

For legal trade scales, the limitation is a maximum of 4 % of the weighing range between the negative and positive weight for zeroing.

10.4.21 Standstill range

Standstill monitoring checks whether the scales are correctly balanced. Scale standstill is registered if the weight changes by less than a specified fluctuation in d (standstill value) over a specified time (standstill time). Standstill monitoring is used in static scale mode (commands: zeroing, taring). The diagram below illustrates how standstill monitoring works.

The current weight can only be registered in legal trade applications if standstill is reached.

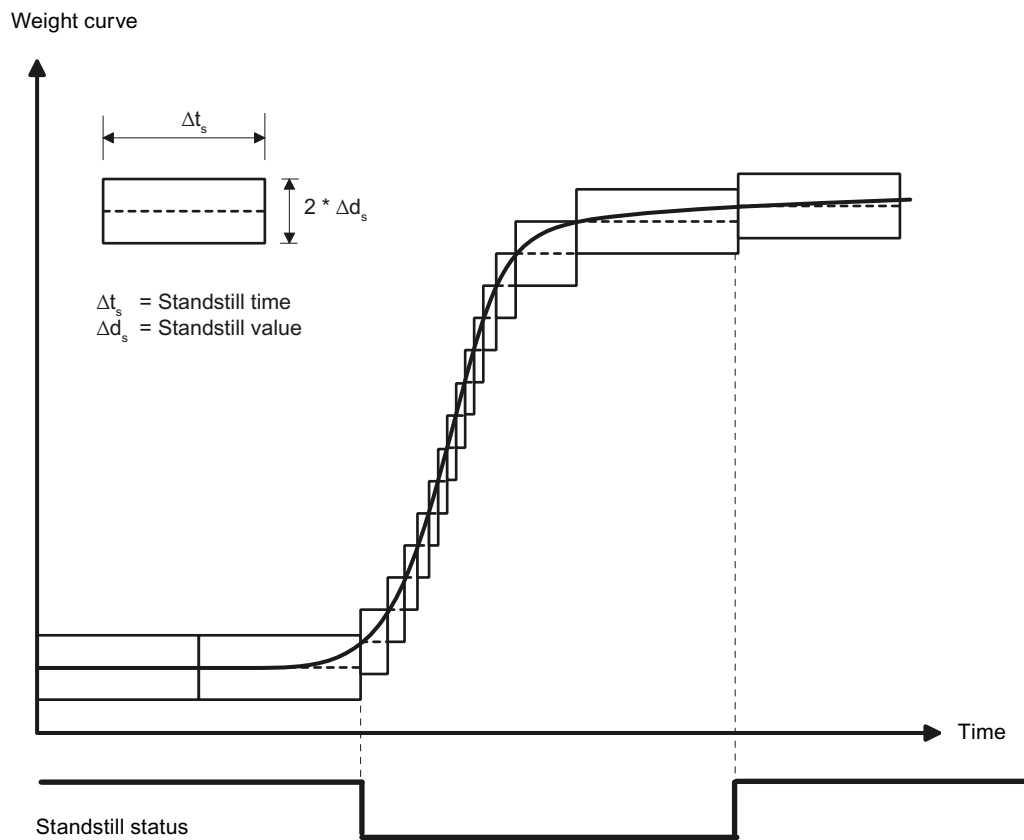


Figure 10-1 Standstill monitoring

10.4.22 Standstill time

Standstill monitoring checks whether the scales are correctly balanced. Scale standstill is registered if the weight changes by less than a specified fluctuation in d (standstill value) over a specified time (standstill time). Standstill monitoring is used in static scale mode (with the following commands: zeroing, taring).

The current weight can only be registered in legal trade applications if standstill is reached.

10.4.23 Standstill waiting time

Standstill waiting time is a maximum waiting time for standstill upon the execution of a command which depends on standstill (taring, zeroing, registering). A technology message is generated if the command cannot be executed during the standstill waiting time because there is no standstill.

If the standstill waiting time is equal to zero, a command requiring standstill is rejected immediately if there is no standstill.

10.4.24 Low-pass cut-off frequency

There is a critically damped low-pass filter for suppressing faults. The diagram below shows the step response of the filter ($f = 2$ Hz). The entry "0" means that the filter is switched off. A cut-off frequency between 0.05 and 20.0 Hz can be specified.

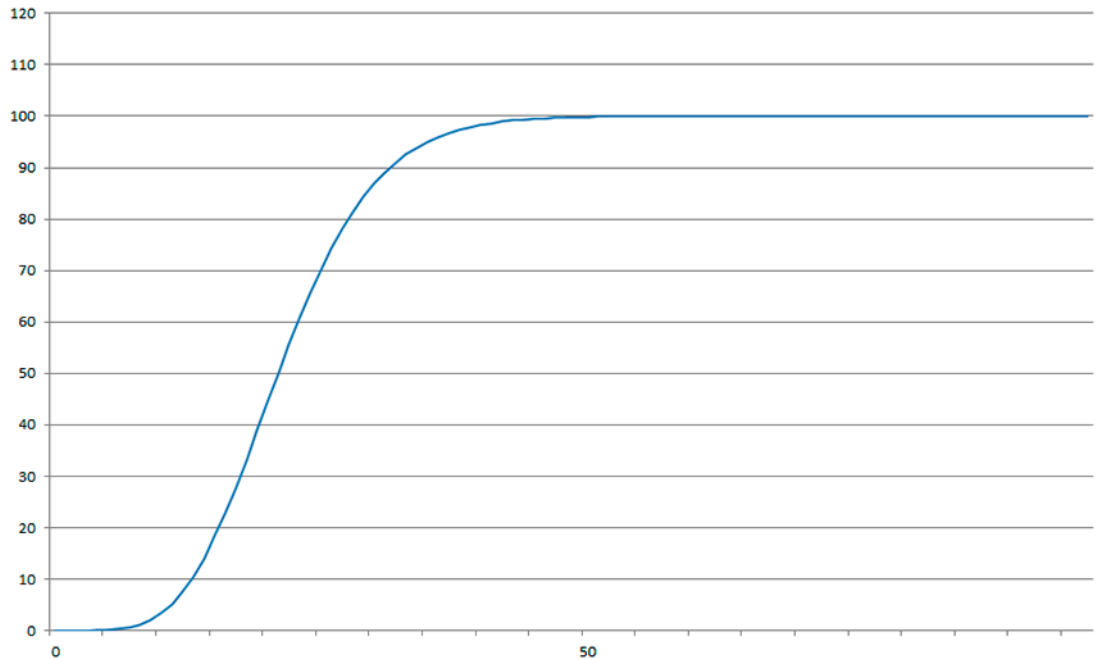


Figure 10-2 Step-forced response of the digital low-pass filter when $f = 2$ Hz

The definition of the cut-off frequency is extremely important for the suppression of faults. Defining the cut-off frequency defines the "speed" of the scale's response to changes in the measured value.

A value of 5 Hz, for example, results in a relatively rapid response to a change in weight; a value of 0.5 Hz makes the scales "slower".

10.4.25 Low-pass filter number

The number of the filter defines the effect of damping. The values 2, 4, 6, 8, and 10 can be set. The higher the selected filter number, the higher the effect.

10.4.26 Low-pass filter limit frequency (commissioning)

The second low-pass filter can be used for test purposes. Its function is identical to that of the (operating) low-pass filter. An analysis of the signal curve after this low-pass filter can provide additional information on the environment of the scales.

10.4.27 Low-pass filter number (commissioning)

The second low-pass filter can be used for test purposes. Its function is identical to that of the (operating) low-pass filter. An analysis of the signal curve after this low-pass filter can provide additional information on the environment of the scales.

10.4.28 Mean value filter depth

The mean value filter is used to steady the weight against random interference. The weight is the mean value of n ($n = \text{max. } 250$) weights which are recorded by the weighing module every 10 ms, e.g. when $n = 10$, the mean of 10 weights is calculated. Every 10 ms, the oldest value is discarded and the newest value included in the calculation.

10.4.29 Display weighing range data

The weighing range data is relevant to operation with verification capability. The "Display weighing range data" parameter is used to define whether the weighing range data is to be output permanently in the "SecureDisplay" on the HMI. Alternatively, it can be displayed separately using the command "802".

10.4.30 Interface for legal trade display

This parameter is used to define whether the legal trade display "SecureDisplay" is to be made on a panel directly connected over Ethernet or via a SIMATIC CPU which is connected to a panel.

10.4.31 Firmware version SecureDisplay

The version of the SecureDisplay software is entered in the "FW-Version SecureDisplay" Parameter. If the version is not entered correctly, a scale value is not output on the SecureDisplay, and the display indicates "Start Up".

10.4.32 Minimum display size [%]

The minimum display size defines the smallest zoom factor for the legal trade display "SecureDisplay". If the zoom factor for the minimum display size does not correspond to the smallest zoom factor stored in the "DisplayCali.xml" file in the display unit, the weight value is hidden and the text "Start Up" is displayed.

10.5 Calibration procedure

10.5.1 Calibration with calibration weights

The incoming analog measured value from the load cells is converted into a digital value in an analog-to-digital converter. A weight is calculated using this digital value. This weight is then used by all weighing module functions for messages and for determining the status.

The characteristic curve of the measuring system must be defined before the weight can be calculated from the digital value. In the simplest case, the characteristic curve is defined with points 0 and 1. The first working point (point 0) is defined by the empty scales (no load) at their own weight. The load cells return a voltage measurement to the weighing module as a result of the weight of the scales themselves. Following analog-to-digital conversion of the measured voltage, the zero point is assigned to the digital value (calibration digits for the zero point).

If the scales are loaded with a defined calibration weight (e.g. 50% of the measuring range), the new digital value returned by the analog-to-digital converter is assigned the calibration weight.

The characteristic curve can also be determined with a third point, which must be higher than point 1.

Make sure that the difference between two calibration weights is at least 40 000 digits, as the calibration command may otherwise be rejected.

The calibration procedure involves the following steps:

- Define the calibration weight and other parameters of the DR 3 data record.
- Transfer the DR 3 data record to the scales.
- Trigger "Calibration weight 0 valid" for empty scales.
- Load the scales with the defined calibration weight.
- Trigger "Calibration weight 1 valid".
- Transfer data record DR 3 from the scales to SOWATOOL and save the data on a data medium.

You must follow the correct calibration sequence with increasing calibration weights.

Load cell characteristic value	Digits (approx.) at nominal load
1 mV/V	1 000 000
2 mV/V	2 000 000
4 mV/V	4 000 000

The diagram below illustrates the relationship between calibration digits and the calibration weight.

10.5 Calibration procedure

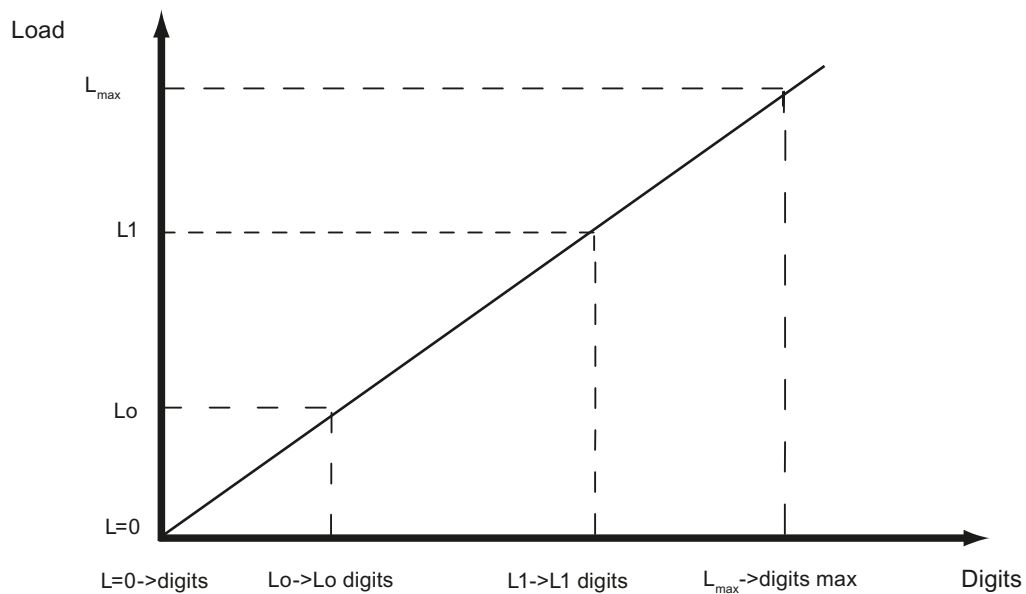


Figure 10-3 Calibration digits and calibration weight

Load	Comment	Load	Digits
L=0	100 kg load cell (2 mV/V) not loaded		Approx. 0
L0	Mechanical installation on load cell (dead load)	25 kg	Approx. 500 000
L1	Calibration weight 1 placed on-to scale	e.g. 60 kg	Approx. 1 200 000
L _{max}	Nominal weight of load cell	100 kg	2 000 000
L _{max} +10%	Rated weight + approx. 10 %	Approx. 110 kg	2 200 000

You do not need to perform calibration if the calibration digits and the calibration weights are known to the weighing module described here. They are simply sent to SIWAREX by data record DR 3 and the scales are ready for use immediately.

The SIWATOOL program facilitates rapid calibration.

Following commissioning and calibration, all data records must be read from the weighing module and saved as a scale file.

Identical scales can be put into operation immediately. Connect the PC to the new scales and enable the "Send all data records" function. This transfers the parameters for calibration weights and calibration digits, and the characteristic curve are determined immediately. The same applies when you change a weighing module.

Note

Two working points are usually sufficient for determining the scales' characteristic curve. An additional working point is only required for non-linear systems.

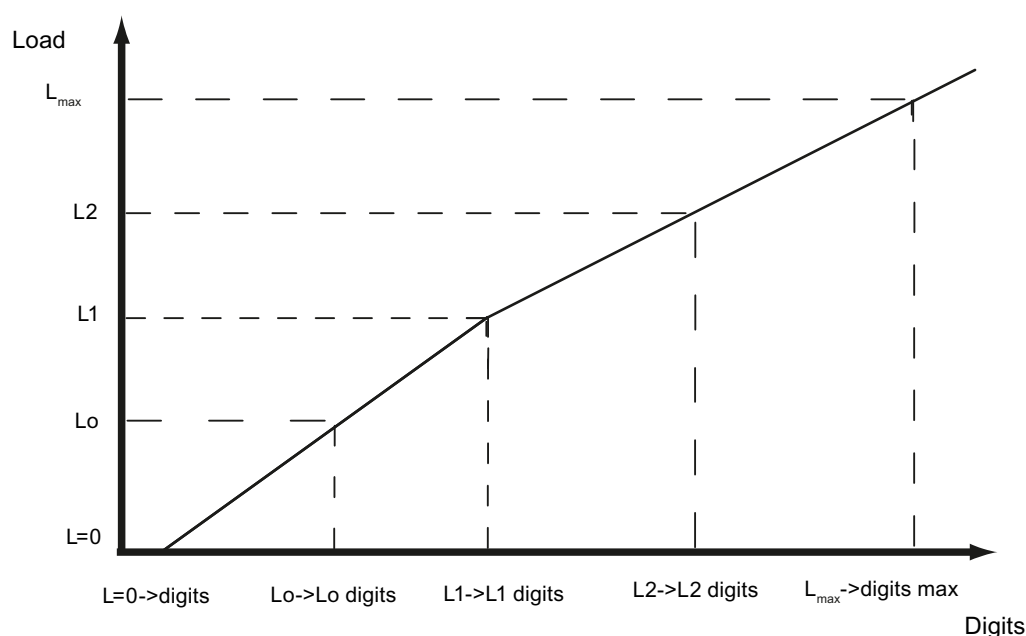


Figure 10-4 Linearizing the scales' characteristic curve

Load	Comment	Load	Digits
L=0	100 kg load cell (2 mV/V) not loaded		Approx. 0
L0	Mechanical installation on load cell (dead load)	e.g. 25 kg	Approx. 500 000
L1	Calibration weight 1 placed on-to scale	e.g. 60 kg	Approx. 1 200 000
L2	Calibration weight 2 placed on-to scale	e.g. 80 kg	Approx. 1 650 000
L _{max}	Nominal weight of load cell	100 kg	Approx. 2 000 000
L _{max} +10 %	Rated weight + approx. 10 %	Approx. 110 kg	Approx. 2 200 000

10.5.2 Automatic calibration

Scales can be rapidly commissioned with automatic calibration. The accuracy of the scale greatly depends on the entered parameters and the mechanical properties of the scale. The best level of accuracy for the scale can be achieved by calibrating with calibration weights.

During initial commissioning with automatic calibration, the module must be reset using the "Load factory settings" or "Load standard parameters" command.

10.6 DR 4 Output of calculated calibration digits

The load cell parameters must subsequently be defined in data record 10. Command 82 "Perform automatic calibration" then uses this data and the currently applied dead load to calculate the characteristic curve of the scale. The characteristic curve is active immediately.

Note

The characteristic curve data in data record 3 active prior to execution of command 82 is directly overwritten.

Automatic calibration requires the following criteria:

- Correct mechanical installation of the scale
- Scale is empty (only mechanical installation (= dead load) present on the cells)
- Installed load cell or load cells are evenly loaded
- There are no shunt circuits

10.6 DR 4 Output of calculated calibration digits

Data record DR 4 outputs the digits calculated from the automatic scale calibration and the calibration check. This data record cannot be sent to the scales.

Table 10-2 Assignment of data record 4

Variable	Note	Type	Length (bytes)	Rw	Default	Min.	Max.	Modbus Register
Data record number	Contains no. of data record	USHORT	2	r	4	-	-	1200
Length	Data record length information	USHORT	2	r	28	-	-	1201
Application	Information on which application the DR belongs to	USHORT	2	r	101	-	-	1202
Version identifier	Information on the current data record version	USHORT	2	r	1	1	65635	1203
Calibration digits 0, 1, 2 (calculated) (Page 103)	Calibration digits 0 (calculated): calibration digits calculated by 'automatic calibration'	LONG	4	r	200000	0	1600000	1204
	Calibration digits 1 (calculated): calibration digits calculated by 'automatic calibration'	LONG	4	r	0	0	1600000	1206
	Calibration digits 2 (calculated): calibration digits calculated by 'automatic calibration'	LONG	4	r	0	0	1600000	1208
Reserve 1	Reserve	SHORT	2	r	0	-	-	1210
Reserve 2	Reserve	USHORT	2	r	0	-	-	1211
Reserve 3	Reserve	FLOAT	4	r	0	-	-	1212

10.6.1 Calibration digits 0, 1, 2 (calculated)

The calculation is based on the parameters from DR 10 and is executed using command no. 82 or 83.

10.7 DR 5 zeroing memory

Data record DR 5 displays the current values in the tare memory and the zeroing memory.

In legal trade operation, the data record is not write-protected.

Procedure

- Check all parameters
- Transfer the data record to the scales

Table 10-3 Assignment of data record 5

Variable	Note	Type	Length (bytes)	RW protection	Default	Min.	Max.	Modbus Register
Data record number	Contains no. of data record	USHORT	2	r	5	-	-	1214
Length	Data record length information	USHORT	2	r	40	-	-	1215
Application	Information about which application the DR belongs to	USHORT	2	r	101	-	-	1216
Version identifier	Information about the current data record version	USHORT	2	r	1	1	65635	1217
Effective tare weight - from specification 1, 2 or 3 (Page 104)	Current tare weight (tare setting)	FLOAT	4	rwP	0	0	Depends on specification in DR 3	1218
Effective tare weight (semi-automatic) (Page 104)	Current tare weight (semi-automatic)	FLOAT	4	rwP	0	0	Depends on specification in DR 3	1220
Zero by power-on (value when switching on) (Page 104)	Current zero by power-on weight (affected by switch-on)	FLOAT	4	rwP	0	Depends on specification in DR 3	Depends on specification in DR 3	1222
Zero weight (semi-automatic) (Page 105)	Current zero weight (semi-automatic)	FLOAT	4	rwP	0	Depends on specification in DR 3	Depends on specification in DR 3	1224

10.7 DR 5 zeroing memory

Variable	Note	Type	Length (bytes)	RW protection	Default	Min.	Max.	Modbus Register
Current zero tracking weight (Page 105)	Current zero weight (zero adjustment)	FLOAT	4	rwP	0	Depends on specification in DR 3	Depends on specification in DR 3	1226
Dead load (Page 105)	Dead load calculated during automatic calibration	FLOAT	4	r	0	Depends on specification in DR 3	Depends on specification in DR 3	1228
Reserve 1	Reserve	SHORT	2	rw	0	-	-	1230
Reserve 2	Reserve	USHORT	2	rw	0	-	-	1231
Reserve 3	Reserve	FLOAT	4	rw	0	-	-	1232

10.7.1 Effective tare weight - from specification 1, 2 or 3

Up to three tare weights can be specified in the DR 15 data record. You activate a specified tare weight with a command (see commands 1013, 1014, 1015). From this point on, the activated tare weight is factored into the weight calculations. The "Delete tare" command deactivates the active tare weight. This does not delete the specification in data record DR 15.

10.7.2 Effective tare weight (semi-automatic)

The corresponding command (see command 1011) applies the current gross weight as the active tare weight. From this point on, the activated tare weight is factored into the weight calculations. The "Delete tare" command deactivates the active tare weight.

10.7.3 Zero by power-on (value when switching on)

If the automatic zero by power-on is configured, the scale is automatically set to "Zero" when the power supply is switched on provided the gross weight is within the defined zero setting limits. The current gross weight is saved as the zero by power-on weight. The zero by power-on weight must be within the specified range (usually $\pm 10\%$).

10.7.4 Zero weight (semi-automatic)

The zero weight command (see command 1001) entered by the user sets the current gross weight to "Zero" provided it is within the defined zero setting limits. The current gross weight is saved as the zero weight. The zeroing weight must be within the specified range (usually +3 / -1 % of the set zero point).

10.7.5 Current zero tracking weight

The current zero tracking weight is recorded in this parameter if automatic zero tracking is activated.

10.7.6 Dead load

The characteristic curve of the scales is determined during calibration. When there is no load, the main display returns "0". The dead load is the weight of the empty scales, i.e. the weight of the scales themselves.

10.8 DR 6 limit value settings

The switch-on and switch-off values for the limits are configured in data record DR 6.

In legal trade operation, the data record is not write-protected.

Procedure

- Check all parameters and modify them as required
- Transfer the data record to the scale

Table 10-4 Assignment of data record 6

Variable	Note	Type	Length (bytes)	Rw	Default	Min.	Max.	Modbus Register
Data record number	Contains no. of data record	USHORT	2	r	6	-	-	1234
Length	Data record length information	USHORT	2	r	60	-	-	1235
Application	Information on which application the DR belongs to	USHORT	2	r	101	-	-	1236
Version identifier	Information on the current data record version	USHORT	2	r	1	1	65635	1237

10.8 DR 6 limit value settings

Variable	Note	Type	Length (bytes)	Rw	Default	Min.	Max.	Modbus Register
Limit reference	Reference value for limits 0: Gross weight in % of max. weighing range 1: Net weight in % of max. weighing range 2: Gross weight, absolute 3: Net weight, absolute	USHORT	2	rw	0	0	1	1238
Reserve 1	Reserve	USHORT	2	rw	0	0	-	1239
Limit value 1 ON (Page 107)	Switch-on point for Limit 1	FLOAT	4	rw	0	maximum number range	maximum number range	1240
Delay time for Limit 1 ON (Page 108)	Time for delayed switch-on of limit value 1 in ms	TIME	4	rw	0	0	maximum number range+	1242
Limit value 1 OFF (Page 107)	Switch-off point for Limit 1	FLOAT	4	rw	0	maximum number range	maximum number range	1244
Delay time for Limit 1 OFF (Page 108)	Time for delayed switch-off of limit value 1 in ms	TIME	4	rw	0	0	maximum number range+	1246
Limit value 2 ON (Page 107)	Switch-on point for Limit 2	FLOAT	4	rw	0	maximum number range	maximum number range	1248
Delay time for Limit 2 ON (Page 108)	Time for delayed switch-on of limit value 2 in ms	TIME	4	rw	0	0	maximum number range+	1250
Limit value 2 OFF (Page 107)	Switch-off point for Limit 2	FLOAT	4	rw	0	maximum number range	maximum number range	1252
Delay time for Limit 2 OFF (Page 108)	Time for delayed switch-off of limit value 2 in ms	TIME	4	rw	0	0	maximum number range+	1254

Variable	Note	Type	Length (bytes)	Rw	Default	Min.	Max.	Modbus Register
Limit value "Empty" ON (Page 108)	Limit value "empty" ON With limit reference 0 and 1: Based on the gross weight in % of max. weighing range With limit reference 2 and 3: Based on absolute gross weight	FLOAT	4	rw	0	maximum number range	maximum number range	1256
Delay time for limit value "Empty" ON (Page 109)	Time for switch-on of "Empty" in ms	TIME	4	rw	0	0	maximum number range+	1258
Reserve 2	Reserve	USHORT	2	rw	0	-	-	1260
Reserve 3	Reserve	USHORT	2	rw	0	-	-	1261
Reserve 4	Reserve	FLOAT	4	rw	0	-	-	1262

10.8.1 Limit reference

Value	Limit values relate to
0	Gross weight in % of max. weighing range
1	Net weight in % of max. weighing range
2	Absolute gross weight
3	Absolute net weight

The limit value "Empty" always relates to gross weight zero.

10.8.2 Limit value 1 ON, limit value 2 ON, limit value 1 OFF, limit value 2 OFF

The switch-on and switch-off points can be specified separately for each limit as a percentage of the measuring range or as absolutely values (based on "Limit reference" parameter setting). This allows both minimum and maximum value violation monitoring with hysteresis. A delay time for switch-on and switch-off can also be specified. Either the current net weight or the current gross weight can be selected as the reference value for limits 1 and 2. Negative limits are only possible with input of absolute values. Negative limits as percentage are rejected.

Maximum value monitoring is implemented with the following specifications:

- Switch-on value > switch-off value

Minimum value monitoring is implemented with the following specification:

- Switch-on value < switch-off value

The diagram below illustrates the function of limit values 1 and 2.

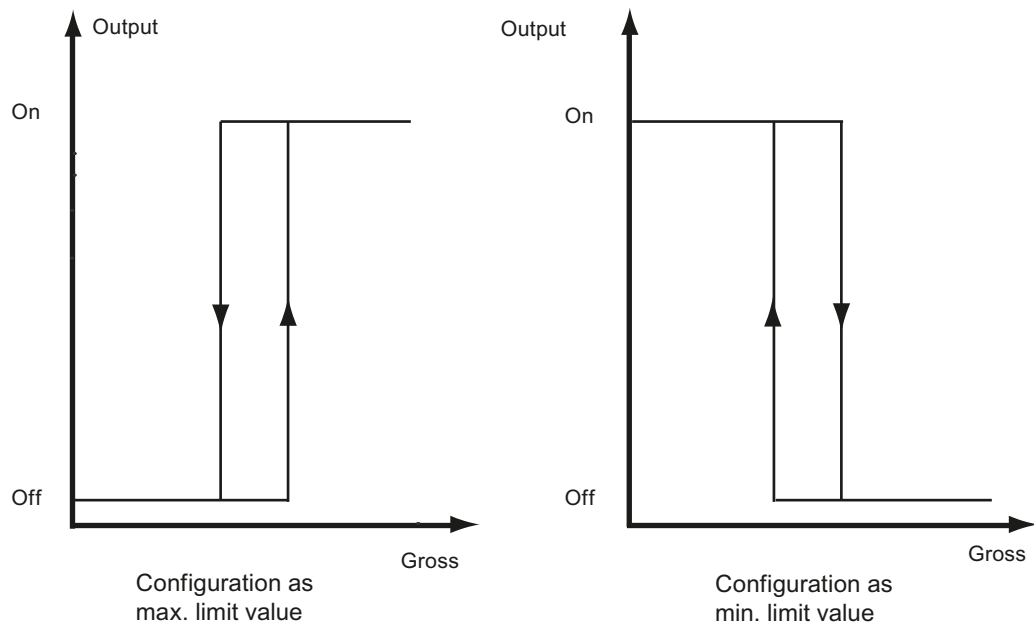


Figure 10-5 Limit value configuration

10.8.3 Delay time for limit value 1 ON, delay time for limit value 2 ON

If the weight reaches the specified switch value, a delay time (defined in ms) is launched. Once the delay time is over, the limit switch changes status provided the weight still reaches the specified switch value.

10.8.4 Delay time for limit value 1 OFF, delay time for limit value 2 OFF

If the weight reaches the specified switch value, a delay time (defined in ms) is launched. Once the delay time is over, the limit switch changes status provided the weight still reaches the specified switch value.

10.8.5 Limit value "Empty" ON

The value for the empty range is a limit value below which the weighing module registers and returns the status "empty". The values are entered as a percentage of the measuring range. The "Empty" limit always refers to the current gross weight in the scale.

The setting, whether absolute or a percentage, also affects the "Empty" limit.

10.8.6 Delay time for limit value "Empty" ON

If the weight reaches the specified switch value for scales status "empty", a delay time (defined in ms) is launched. Once the delay time is over, the switch for "empty" status changes status provided the weight still reaches the specified switch value.

10.9 DR 7 interface parameters

Data record DR 7 contains the parameters for defining the properties of the available I/O modules (digital inputs, digital outputs, analog output, serial ports).

If a port is not used, the default values can be retained.

Procedure

- Change the parameters if necessary
- Transfer the data record to the scale

Table 10-5 Assignment of data record 7

Variable	Note	Type	Length (bytes)	RW	Default	Min.	Max.	Modbus Register
Data record number	Contains no. of data record	USHORT	2	r	7	-	-	1300
Length	Data record length information	USHORT	2	r	60	-	-	1301
Application	Information on which application the DR belongs to	USHORT	2	r	101	-	-	1302
Version identifier	Information on the current data record version	USHORT	2	r	1	1	65635	1303
Assignment for digital input 0, 1, 2, 3 (Page 112)	Assignment for input 0: 0: No command assigned 1 ... 32767: Command is triggered at a rising edge (0->1 transition)	USHORT	2	rw	0	0	32767	1304
	Assignment for input 1: 0: No command assigned 1 ... 32767: Command is triggered at a rising edge (0->1 transition)	USHORT	2	rw	0	0	32767	1305
	Assignment for input 2: 0 : No command assigned 1 ... 32767: Command is triggered at a rising edge (0->1 transition)	USHORT	2	rw	0	0	32767	1306
	Assignment for input 3: 0: No command assigned 1 ... 32767: Command is triggered at a rising edge (0->1 transition)	USHORT	2	rw	0	0	32767	1307

Variable	Note	Type	Length (bytes)	RW	Default	Min.	Max.	Modbus Register
Input filtering (hardware setting) (Page 113)	1: 0.2 ms 2: 0.4 ms 3: 0.8 ms 4: 1.6 ms 5: 3.2 ms 6: 6.4 ms 7: 12.8 ms	USHORT	2	rw	5	0	7	1308
Assignment for digital output 0, 1, 2, 3 (Page 113)	Assignment for output 0: 0 ... 32767 of the status flags from byte 0 ... 3 (DR 30) 33: data record 18 34: S7 I/O 100-131: Bit no. of the status flags from bytes 0 ... 3 from data record 30, but inverted 253: Start the cyclic transmission of measured values of the Mettler-Tol- edo digital load cell (output 0 only) 255: Output always disabled 1000-1031: Operating error 1100-1131: Operating error, inver- ted 2000-2031: Technological error 2100-2131: Technological error, in- verted 3000-3063: Data/command error 3100-3163: Data/command error, inverted	USHORT	2	rw	0	0	3163	1309
	Assignment for output 1: (see Output 0) 254: Stop the cyclic transmission of measured values of the Mettler-Tol- edo digital load cell	USHORT	2	rw	0	0	3163	1310
	Assignment for output 2: (see Output 0)	USHORT	2	rw	0	0	3163	1311
	Assignment for output 3: (see Output 0)	USHORT	2	rw	0	0	3163	1312
Response of dig- ital outputs to faults or SIMAT- IC STOP (Page 113)	Response of digital outputs follow- ing module fault or CPU STOP: 0: Outputs are switched off 1: Outputs are not switched off, con- tinue 2: The relevant substitute value is activated 3: The outputs are switched on	USHORT	2	rw	0	0	3	1313

Variable	Note	Type	Length (bytes)	RW	Default	Min.	Max.	Modbus Register
Substitute value for DQ 0, 1, 2, 3 following fault or SIMATIC STOP (Page 114)	Substitute value for DQ 1 following fault or SIMATIC CPU STOP	BIT	0	rw	0	0	1	1314.16
	Substitute value for DQ 2 following fault or SIMATIC CPU STOP	BIT	0	rw	0	0	1	1314.15
	Substitute value for DQ 3 following fault or SIMATIC CPU STOP	BIT	0	rw	0	0	1	1314.14
	Substitute value for DQ 4 following fault or SIMATIC CPU STOP	BIT	0	rw	0	0	1	1314.13
Bit 4	Reserve	BIT	0	rw	0	0	1	1314.12
Bit 5	Reserve	BIT	0	rw	0	0	1	1314.11
Bit 6	Reserve	BIT	0	rw	0	0	1	1314.10
Bit 7	Reserve	BIT	0	rw	0	0	1	1314.9
Bit 8	Reserve	BIT	0	rw	0	0	1	1314.8
Bit 9	Reserve	BIT	0	rw	0	0	1	1314.7
Bit 10	Reserve	BIT	0	rw	0	0	1	1314.6
Bit 11	Reserve	BIT	0	rw	0	0	1	1314.5
Bit 12	Reserve	BIT	0	rw	0	0	1	1314.4
Bit 13	Reserve	BIT	0	rw	0	0	1	1314.3
Bit 14	Reserve	BIT	0	rw	0	0	1	1314.2
Bit 15	Reserve	BIT	2	rw	0	0	1	1314.1
Analog output range (Page 114)	0: 0 ... 20 mA 1: 4 ... 20 mA	USHORT	2	rw	0	0	1	1315
Analog output source (Page 115)	Basis of analog value output: 0 = G/N value 1 = Gross 2 = Net 3 = Ext. specification, DR 17 4 = Ext. specification, S7 interface	USHORT	2	rw	2	0	4	1316
Response of analog output to faults or SIMATIC STOP (Page 115)	0: Switch off 1: Continue 2: Output configured output value 3: Output maximum value (24 mA, NAMUR)	USHORT	2	rw	0	0	3	1317
Start value for the analog output (Page 115)	Value at which 0 ...4 mA is to be output	FLOAT	4	rw	0	maximum weight	maximum weight	1318
End value for the analog output (Page 115)	Value at which 20 mA is to be output	FLOAT	4	rw	0	maximum weight	maximum weight	1320
Output value following fault or SIMATIC STOP (Page 115)	Value to be output when the OutDis signal is enabled (in mA)	FLOAT	4	rw	0	0	24	1322

Variable	Note	Type	Length (bytes)	RW	Default	Min.	Max.	Modbus Register
Trace recording cycle (Page 116)	1: 10 ms 10: 100 ms 100: 1 s 1 000: 10 s	USHORT	2	rw	1	1	1000	1324
Trace memory type, bit 0	0: Trace recording runs as a circular buffer 1: Trace is stopped when the trace memory is full	BIT	0	rw	0	0	1	1325.16
Bit 1	Reserve	BIT	0	rw	0	0	1	1325.15
Bit 2	Reserve	BIT	0	rw	0	0	1	1325.14
Bit 3	Reserve	BIT	0	rw	0	0	1	1325.13
Bit 4	Reserve	BIT	0	rw	0	0	1	1325.12
Bit 5	Reserve	BIT	0	rw	0	0	1	1325.11
Bit 6	Reserve	BIT	0	rw	0	0	1	1325.10
Bit 7	Reserve	BIT	1	rw	0	0	1	1325.9
Bit 8	Reserve	BIT	0	rw	0	0	1	1325.8
Bit 9	Reserve	BIT	0	rw	0	0	1	1325.7
Bit 10	Reserve	BIT	0	rw	0	0	1	1325.6
Bit 11	Reserve	BIT	0	rw	0	0	1	1325.5
Bit 12	Reserve	BIT	0	rw	0	0	1	1325.4
Bit 13	Reserve	BIT	0	rw	0	0	1	1325.3
Bit 14	Reserve	BIT	0	rw	0	0	1	1325.2
Bit 15	Reserve	BIT	1	rw	0	0	1	1325.1
Reserve 1	Reserve	LONG	4	rw	0	0	-	1326
Reserve 2	Reserve	FLOAT	4	rw	0	0	-	1328

10.9.1 Assignment for digital input 0, 1, 2, 3

A command trigger can be assigned to a digital input. The assignment is made with the command number: → Command lists (Page 75).

Assignment for input 0, 1, 2, 3:

Value	Assignment
0	Not assigned
1 ... 32767	Command triggered by a rising edge (0 -> 1 transition)

10.9.2 Input filtering (hardware setting)

To ensure that the inputs do not respond too quickly to the signal change, a minimum signal pending time can be specified. The pending signal is not processed further until this time has elapsed.

10.9.3 Assignment for digital output 0, 1, 2, 3

You can assign the digital outputs different functions. The output of the scale status or the error messages as well as additional functions as listed in the following table are available for selection. This is done on the basis of the bit number.

Assignment for output 0, 1, 2, 3:

Value	Function of the digital output
0 - 31	Bit no. of the status flags from byte 0 .. 3 from data record 30
33	Control of output via data record 18
34	Control of output via SIMATIC S7 I/O
100-131	Bit no. of the status flag from byte 0 .. 3 from data record 30, but inverted
253	Only for digital output 1: Start the cyclic transmission of measured values of the WM type Mettler-Toledo digital load cell
254	Only for digital output 2: Stop the cyclic transmission of measured values of the WM type Mettler-Toledo digital load cell
255	Output always disabled
1000-1031	Operating error
1100-1131	Operating error, inverted
2000-2031	Technological error
2100-2131	Technological error, inverted
3000-3063	Data or command error
3100-3163	Data/command error, inverted

10.9.4 Response of digital outputs to faults or SIMATIC STOP

This parameter allows you to define the response of the digital outputs following a fault of the SIWAREX module or SIMATIC STOP.

Value	Response
0	Outputs are switched off
1	Outputs are not switched off (continue)
2	The relevant substitute value is activated
3	Outputs are switched on

10.9.5 Substitute value for DQ 0, 1, 2, 3 following fault or SIMATIC STOP

The outputs are usually reset following a module fault (operating error) or SIMATIC CPU STOP. This response is the default setting.

If an output is to be set following a fault, this response is defined using this parameter. The "Response of digital outputs to fault or SIMATIC STOP" parameter must also be set to "Output substitute value".

The substitute value definition is then valid.

Examples

Table 10-6 Bit 0 defines digital output 1 (DQ 1)

Value of bit 0	Value of DQ 1 following fault
0	0
1	1

Table 10-7 Bit 1 defines digital output 2 (DQ 2)

Value of bit 2	Value of DQ 2 following fault
0	0
1	1

NOTICE

Risk to the plant

If an output is set following a fault (operating error), this can pose a risk for the plant. Ensure that the parameters are correctly set.

10.9.6 Analog output range

This parameter is used to define the range of the output current.

Value	Output current
0	0 ... 20 mA
1	4 ... 20 mA

10.9.7 Analog output source

The analog output can be used for a range of purposes. This parameter defines the tag that controls the analog output.

Value	Basis for the analog output
0	Gross / net value
1	Gross value
2	Net value
3	External specification, DR 17 (Specified in mA)
4	Via SIMATIC S7 I/O modules

10.9.8 Response of analog output to faults or SIMATIC STOP

This parameter defines the response of the analog output following a fault of the SIWAREX module or SIMATIC STOP.

Value	Response
0	Switch off
1	Continue
2	Output configured output value, e.g. 3.5 mA
3	Output maximum value (24 mA, NAMUR)

10.9.9 Start value for the analog output

This parameter defines the specified value at which 0 or 4 mA is output. The value can be greater or less than the end value.

10.9.10 End value for the analog output

This parameter defines the specified value at which 20 mA is output. The value can be greater or less than the start value.

10.9.11 Output value following fault or SIMATIC STOP

The default settings set the analog output to the defined value following a module fault (operating error) or upon SIMATIC CPU STOP.

If the analog output is, for example, to be set to 3.5 mA following a fault, this is defined with this parameter. The current value to be output is entered.

NOTICE**System can be switched to unsafe state**

If the analog output is to be set to a given value following a fault (operating error), you must ensure that this poses no danger.

10.9.12 Trace recording cycle

The trace function is used for the continuous recording of measured values. The recording rate is defined with the parameter.

Value	Response
1	Recording every 10 ms
10	Recording every 100 ms
100	Recording every second
1 000	Recording every 10 s

10.9.13 Trace storage method

This parameter is used to specify the response of the trace memory.

Value	Response
0	Trace recording runs as circulating memory
1	Trace is stopped when the trace memory is full

10.10 DR 8 date and time

The weighing module has its own hardware clock. The current date and time is specified or read using data record DR 8. The clock is buffered by a capacitor and can continue to function without power for around 70 hours. If you are using the Modbus protocol, data record DR 48 must be used for the date and time.

Procedure

- Set the date and time
- Transfer the data record to the scales

Table 10-8 Assignment of data record 8

Variable	Note	Type	Length (bytes)	Rw	Default	Min.	Max.	Modbus registers
Data record number	Contains no. of data record	USHORT	2	r	8	-	-	1330
Length	Data record length information	USHORT	2	r	16	-	-	1331
Application	Information about which application the DR belongs to	USHORT	2	r	101	-	-	1332
Version identifier	Information on current data record version	USHORT	2	r	1	1	65635	1333
Date and time	SIMATIC DTL format	DTL	12	rw	DTL#1970-01-01 00:00:00.0	-	-	1334

10.11 DR 9 module information

No entries can be made in data record DR 9. This data record provides information on the inner workings of the SIWAREX module. This information is used to identify the module at the manufacturer plant (e.g. in the event of repairs). The entries in the data record are of no importance to the user for operation.

Table 10-9 Assignment of data record 9

Variable	Note	Type	Length (bytes)	Rw	Default	Min.	Max.	Modbus registers
Data record number	Contains no. of data record	USHORT	2	r	9	-	-	1340
Length	Data record length information	USHORT	2	r	68	-	-	1341
Application	Information on which application the DR belongs to	USHORT	2	r	101	-	-	1342
Version identifier	Information on the current data record version	USHORT	2	r	1	1	65635	1343
Order No. - header	Maximum and current string length for the order number	UBYTE[2]	2	r	16.16	-	-	1344
Order No.	Order number of the module 7MH ..	CHAR[16]	16	r	"7MH ..."	-	-	1345
Serial number - header	String header	UBYTE[2]	2	r	12,12	-	-	1352
Serial number	Serial number "XXX00001"	CHAR[12]	12	r	" "	-	-	1353
Firmware type - header	String header	UBYTE[2]	2	r	2.2	-	-	1359
Firmware type	Reference V - Release B - Test etc.	CHAR[2]	2	r	'V'	-	-	1360

10.12 DR 10 load cell parameters

Variable	Note	Type	Length (bytes)	Rw	Default	Min.	Max.	Modbus registers
FW - Version - 1st digit	Version 1.	USHORT	2	r	0	-	-	1361
FW - Version - 2nd digit	Version 2.	USHORT	2	r	0	-	-	1362
FW - Version - 3rd digit	Version 3.	USHORT	2	r	0	-	-	1363
Hardware version number	ES hardware version number (e.g. 03)	USHORT	2	r	1	-	-	1364
OS version header	String header	UBYTE[2]	2	r	1.1	-	-	1365
OS version (loader) - designation	Reference V - Release B - Test etc.	CHAR[2]	2	r	'V '	-	-	1366
OS version (loader) - designation	e.g. version n	USHORT	2	r	'V '	-	-	1367
DRAM memory	Flash memory	USHORT	2	r	0	-	-	1368
Flash memory	MRAM memory	USHORT	2	r	0	-	-	1369
MRAM memory	Memory type	USHORT	2	r	0	-	-	1370
Reserve 1	0	FLOAT	4	r	0	-	-	1371

10.12 DR 10 load cell parameters

The parameters of the analog load cells must be checked prior to the automatic calibration and modified if necessary. Only the parameters identified by bold font and asterisk (*) need be entered.

Procedure

- Check the parameters and modify them as required
- Transfer the data record to the scales
- Calibrate the scale

Table 10-10 Assignment of data record 10

Variable	Note	Type	Length (bytes)	Rw	Default	Min.	Max.	Modbus registers
Data record number	Contains no. of data record	USHORT	2	r	10	-	-	1400
Length	Data record length information	USHORT	2	r	44	-	-	1401
Application	Information on which application the DR belongs to	USHORT	2	r	101	-	-	1402

Variable	Note	Type	Length (bytes)	Rw	Default	Min.	Max.	Modbus registers
Version identifier	Information on the current data record version	USHORT	2	r	1	1	65635	1403
Number of load cells ¹⁾	Number of analog load cells (internal variable)	USHORT	2	rw	1	1	6	1404
50/60 Hz toggling (Page 119)	50/60 Hz toggling	USHORT	2	rw	0	0	1	1405
Number of support points (Page 119) ¹⁾	Number of support points	USHORT	2	rw	0	0	8	1406
	Reserve	USHORT	2	rw	0	0	0	1407
Load cell characteristic value (Page 120) ¹⁾	Characteristic value of the load cell or load cells [mV/V], the mean value is used if there is more than one cell.	FLOAT	4	rw	2	>0.1	10	1408
Zero point offset ¹⁾	Zero point offset in uV/V, the mean value is used if there is more than one cell (internal tag).	FLOAT	4	rw	0	-1000	1000	1410
Rated load of a load cell (Page 120) ¹⁾	Rated load of a load cell	FLOAT	4	rw	60	-	-	1412
Reserve	Reserve	FLOAT	4	rw	0	-	-	1414
Reserve	Reserve	FLOAT	4	rw	0	-	-	1416
Reserve 2	Reserve	SHORT	2	rw	0	-	-	1418
Reserve 3	Reserve	USHORT	2	rw	0	-	-	1419
Reserve 4	Reserve	FLOAT	4	rw	0	-	-	1420

¹⁾ Parameter for calculation of calibration points with theoretical calibration

10.12.1 50/60 Hz toggling

To improve the suppression of faults caused by the supply network, you can specify the network frequency for signal filtering.

10.12.2 Number of support points

If no anchor points are used, the number of support points is equal to the number of load cells.

If anchor points are used in addition to load cells, the number of support points is equal to the total number of load cells and fixed support points.

10.12.3 Load cell characteristic value

The load cell characteristic value is required to correctly interpret the output voltage from the load cell. This specification is also necessary for determining load cell overload. The exact value can be entered if the measurement log for the load cell is available. The mean value can be entered if there is more than one load cell.

Example

Characteristic value = 2.018 mV/V

10.12.4 Rated load of a load cell

The rated load of a load cell is required for checking the maximum weighing range of the scales. The rated load is entered in the specified units of weight.

10.13 DR 12 Ethernet parameters

To integrate the SIWAREX module into an Ethernet network, configure the Ethernet parameters.

Table 10-11 Assignment of data record 12

Variable	Note	Type	Length (bytes)	Rw	Default	Min.	Max.	Modbus registers
Data record number	Contains no. of data record	USHORT	2	r	12	-	-	1500
Length	Data record length information	USHORT	2	r	116	-	-	1501
Application	Information about which application the DR belongs to	USHORT	2	r	101	-	-	1502
Version identifier	Information on current data record version	USHORT	2	r	1	1	65635	1503
Device MAC address (Page 122)	Device MAC address 1	USHORT	2	r		0	FF	1504
	Device MAC address 2	USHORT	2	r		0	FF	1505
	Device MAC address 3	USHORT	2	r		0	FF	1506
	Device MAC address 4	USHORT	2	r		0	FF	1507
	Device MAC address 5	USHORT	2	r		0	FF	1508
	Device MAC address 6	USHORT	2	r		0	FF	1509
Port MAC address (Page 122)	Port MAC address 1	USHORT	2	r		0	FF	1510
	Port MAC address 2	USHORT	2	r		0	FF	1511
	Port MAC address 3	USHORT	2	r		0	FF	1512
	Port MAC address 4	USHORT	2	r		0	FF	1513
	Port MAC address 5	USHORT	2	r		0	FF	1514
	Port MAC address 6	USHORT	2	r		0	FF	1515

Variable	Note	Type	Length (bytes)	Rw	Default	Min.	Max.	Modbus regis- ters
IP address (Page 122)	IP address x.n.n.n	USHORT	2	RW	192	0	255	1516
	IP address n.x.n.n	USHORT	2	RW	168	0	255	1517
	IP address n.n.x.n	USHORT	2	RW	0	0	255	1518
	IP address n.n.n.x	USHORT	2	RW	21	0	255	1519
Subnet mask (Page 123)	Subnet mask x.n.n.n	USHORT	2	RW	255	0	255	1520
	Subnet mask n.x.n.n	USHORT	2	RW	255	0	255	1521
	Subnet mask n.n.x.n	USHORT	2	RW	255	0	255	1522
	Subnet mask n.n.n.x	USHORT	2	RW	0	0	255	1523
Gateway (Page 123)	Gateway x.n.n.n	USHORT	2	RW	192	0	255	1524
	Gateway n.x.n.n	USHORT	2	RW	168	0	255	1525
	Gateway n.n.x.n	USHORT	2	RW	0	0	255	1526
	Gateway n.n.n.x	USHORT	2	RW	21	0	255	1527
Device name (Page 123)	Current device name header	UBYTE[2]	2	rw				1528
	Current device name	CHAR[32]	32	RW	" "			1529
Byte swap for text fields (Page 123) (MODBUS TCP port 502)	0: Yes 1: No	SHORT	2	RW	0	0	1	1545.16
Byte swap for 16- bit values (Page 123) (MODBUS TCP port 502)	0: Big endian (MSB first) 1: Little endian (LSB first)	SHORT	2	rw	0	0	1	1545.15
Byte swap for 32- bit values (Page 123) (MODBUS TCP port 502)	0: Big endian (MSB first) 1: Little endian (LSB first)	SHORT	2	RW	0	0	1	1545.14
Word swap for 32-bit values (Page 123) (MODBUS TCP port 502)	0: Little endian (LSB first) 1: Big endian (MSB first)	SHORT	2	RW	0	0	1	1545.13
Bit 4	Reserve	SHORT	2	RW	0	0	1	1545.12
Bit 5	Reserve	SHORT	2	RW	0	0	1	1545.11
Bit 6	Reserve	SHORT	2	RW	0	0	1	1545.10
Deactivate MOD- BUS TCP port 502	0: Port is active 1: Port is deactivated	SHORT	2	RW	0	0	1	1545.9
Byte swap for text fields (Page 123) (MODBUS TCP port 503)	0: Yes 1: No	SHORT	2	RW	0	0	1	1545.8

Variable	Note	Type	Length (bytes)	Rw	Default	Min.	Max.	Modbus registers
Byte swap for 16-bit values (Page 123) (MODBUS TCP port 503)	0: Big endian (MSB first) 1: Little endian (LSB first)	SHORT	2	RW	0	0	1	1545.7
Byte swap for 32-bit values (Page 123) (MODBUS TCP port 503)	0: Big endian (MSB first) 1: Little endian (LSB first)	SHORT	2	RW	0	0	1	1545.6
Word swap for 32-bit values (Page 123) (MODBUS TCP port 503)	0: Little endian (LSB first) 1: Big endian (MSB first)	SHORT	2	RW	0	0	1	1545.5
Bit 4	Reserve	SHORT	2	RW	0	0	1	1545.4
Bit 5	Reserve	SHORT	2	RW	0	0	1	1545.3
Bit 6	Reserve	SHORT	2	RW	0	0	1	1545.2
Deactivate MODBUS TCP port 503 (Page 123)	0: Port is active 1: Port is deactivated	SHORT	2	RW	0	0	1	1545.1
Reserve 2	Reserve	FLOAT	4	r	0	-	-	1546
Reserve 3	Reserve	FLOAT	4	r	0	-	-	1548

¹⁾ Defines the format used for transfer over the Ethernet port (MODBUS TCP IP).

10.13.1 Device MAC address

Each SIWAREX module has a unique MAC address. This MAC address cannot be changed by the user.

10.13.2 Port MAC address

Each SIWAREX module has a unique MAC port address. This MAC address cannot be changed by the user.

10.13.3 IP address

Each electronic weighing system has an IP address. Do not change the IP address, otherwise the SIMATIC HMI will not work.

10.13.4 Subnet mask

Assign the subnet mask of your network.

10.13.5 Gateway

If a gateway is used between the electronic weighing system and the communication partner, you enter the address of the gateway here.

If no gateway is available, enter the IP address of the electronic weighing system.

10.13.6 Device name

This parameter can be used to assign a name to the weighing module in the Ethernet network. The length of the name is limited to 32 characters. Empty spaces must be filled by "x".

10.13.7 Byte/Word swap options

Defines the format used for transfer over the Ethernet interface (MODBUS TCP IP).

10.14 DR 13 RS485 parameters

The parameters which define the response of the RS485 interface are specified in data record DR 13. If the interface is not used, keep the default values.

If the interface is not used, the default values can be retained.

Procedure

- Check the parameters and modify them as required.
- Transfer the data record to the scale.

Table 10-12 Assignment of data record 13

Variable	Note	Type	Length (bytes)	Rw	Default	Min.	Max.	Modbus regis- ters
Data record number	Contains no. of data record	USHORT	2	r	13	-	-	1558
Length	Data record length information	USHORT	2	r	24	-	-	1559
Application	Information on which application the data record belongs to	USHORT	2	r	101	-	-	1560
Version identifier	Information on the current data record version	USHORT	2	r	1	1	65635	1561

Variable	Note	Type	Length (bytes)	Rw	Default	Min.	Max.	Modbus registers
RS485 protocol (Page 125)	0: No protocol 1: MODBUS RTU 2: SIEBERT display 3: Digital load cell Mettler-Toledo type WMS/WMH 4: Digital load cell Mettler-Toledo type PBK9-APW/PFK9-APW 5: Digital load cell Wipotec 6: SIWAREX DB	USHORT	2	rw	1	0	2	1562
RS485 baud rate (Page 125)	0: 1 200 bps 1: 2 400 bps 2: 9 600 bps 3: 19 200 bps 4: 38 400 bps (for digital load cell) 5: 57 600 bps 6: 115 200 bps (for SIWAREX DB)	USHORT	2	rw	3	0	6	1563
RS485 character parity (Page 125)	Character parity 0: even (for SIWAREX DB and digital load cell Mettler-Toledo) 1: odd (digital load cell Wipotec)	BIT	0	rw	0	0	1	1564.16
RS485 number of data bits (Page 125)	Number of data bits per character 0: 7 data bits (for digital load cell from Mettler-Toledo) 1: 8 bits (for SIWAREX DB and digital load cell Wipotec)	BIT	0	rw	1	0	1	1564.15
RS485 number of stop bits (Page 125)	Number of stop bits 0: 1 stop bit for SIWAREX DB and digital load cells 1: 2 stop bits	BIT	0	rw	0	0	1	1564.14
Bit 3	Reserve	BIT	0	rw	0	0	1	1564.13
Bit 4	Reserve	BIT	0	rw	0	0	1	1564.12
Bit 5	Reserve	BIT	0	rw	0	0	1	1564.11
Bit 6	Reserve	BIT	0	rw	0	0	1	1564.10
Bit 7	Reserve	BIT	0	rw	0	0	1	1564.9
Byte swap for text fields (Page 126)	0: Yes 1: No	BIT	0	rw	0	0	1	1564.8
Byte swap for 16-bit values (Page 126)	0: Big endian (MSB first) 1: Little endian (LSB first)	BIT	0	rw	0	0	1	1564.7
Byte swap for 32-bit values (Page 126)	0: Big endian (MSB first) 1: Little endian (LSB first)	BIT	0	rw	0	0	1	1564.6
Word swap for 32-bit values (Page 126)	0: Little endian (LSB first) 1: Big endian (MSB first)	BIT	0	rw	0	0	1	1564.5
Bit 12	Reserve	BIT	0	rw	0	0	1	1564.4

Variable	Note	Type	Length (bytes)	Rw	Default	Min.	Max.	Modbus regis- ters
Bit 13	Reserve	BIT	0	rw	0	0	1	1564.3
Bit 14	Reserve	BIT	0	rw	0	0	1	1564.2
Bit 15	Reserve	BIT	2	rw	0	0	1	1564.1
RS485 Modbus address (Page 126)	Modbus RTU address of the module	USHORT	2	rw	20	1	255	1565
Decimal place for Siebert indicator (Page 126)	Decimal place for Siebert display	SHORT	2	rw	0	-	-	1566
MODBUS RTU response delay (Page 126)	Delay time for response for MODBUS RTU in ms (RS485), with connection of digital load cell monitoring time load cell telegram	USHORT	2	rw	0	-	-	1567
Reserve 3	Reserve	FLOAT	4	rw	0	-	-	1568

¹⁾ Defines the format used for transfer over the Ethernet port (MODBUS TCP IP).

10.14.1 RS485 protocol

This parameter defines the protocol for communication via the RS485 interface.

10.14.2 RS485 baud rate

This parameter defines the baud rate for the RS485 interface.

10.14.3 RS485 character parity

This parameter defines the character parity for the RS485 interface.

10.14.4 RS485 number of data bits

This parameter defines the number of data bits for the RS485 interface.

10.14.5 RS485 number of stop bits

This parameter defines the number of stop bits for the RS485 interface.

10.14.6 Byte/Word swap options

Defines the format used for transfer over the Ethernet interface (MODBUS TCP IP).

10.14.7 RS485 Modbus address

This parameter defines the Modbus address (1 to 230) for communication via the RS485 interface with the Modbus protocol.

10.14.8 Decimal place for Siebert indicator

A fixed decimal place must be specified if a Siebert indicator is used. The following values are permitted: 0 ... 4

10.14.9 MODBUS RTU response delay

This parameter defines the delay of a response to a data request by the MODBUS RTU master (in ms).

10.15 DR 15 tare settings

Data record DR 15 is used for the external specification of up to 3 tare weights.

Procedure

- Enter the tare weight(s)
- Transfer the data record to the scale
- Enable a tare weight with a command

Table 10-13 Assignment of data record 15

Variable	Note	Type	Length (bytes)	Rw	Default	Min.	Max.	Modbus registers
Data record number	Contains no. of data record	USHORT	2	r	15	-	-	1578
Length	Data record length information	USHORT	2	r	28	-	-	1579
Application	Information on which application the DR belongs to	USHORT	2	r	101	-	-	1580
Version identifier	Information on the current data record version	USHORT	2	r	1	1	65635	1581

Variable	Note	Type	Length (bytes)	Rw	Default	Min.	Max.	Modbus regis- ters
Specification of tare weight 1, 2, 3 (Page 127)	Tare setting memory 1	FLOAT	4	rw	0	0	De- pends on speci- fication in DR 3	1582
	Tare setting memory 2	FLOAT	4	rw	0	0	De- pends on speci- fication in DR 3	1584
	Tare setting memory 3	FLOAT	4	rw	0	0	De- pends on speci- fication in DR 3	1586
Reserve 1	Reserve	SHORT	2	rw	0	0	-	1588
Reserve 2	Reserve	USHORT	2	rw	0	0	-	1589
Reserve 3	Reserve	FLOAT	4	rw	0	0	-	1590

10.15.1 Specification of tare weight 1, 2, 3

Up to three tare weights can be entered. If a tare weight is to be applied, it must be enabled with the corresponding command. The tare weights may not exceed the maximum values specified in data record DR 3.

10.16 DR 16 simulation value

Specifying a weight value using data record DR 16 disables the measuring input of the SIWAREX module and "simulates" a weight with the specified value. The SIWAREX module must first be released for simulation mode in DR 3 and then switched to simulation mode with command no. 3.

Procedure

- Release simulation mode in DR 3
- Enter the weight to be simulated
- Transfer the data record to the SIWAREX module
- Start the simulation using command "Weight simulation on (3)"
- Stop the simulation using command "Weight simulation off (4)"

10.17 DR 17 analog output control specifications

Table 10-14 Assignment of data record 16

Variable	Note	Type	Length (bytes)	Rw	Default	Min.	Max.	Modbus registers
Data record number	Contains no. of data record	USHORT	2	r	16	-	-	1592
Length	Data record length information	USHORT	2	r	16	-	-	1593
Application	Information about which application the data record belongs to	USHORT	2	r	101	-	-	1594
Version identifier	Information about current data record version	USHORT	2	r	1	1	65635	1595
Weight simulation specification (Page 128)	Weight value specification (only relevant if simulation mode is enabled)	FLOAT	4	rw	0	maximum weighing range	maximum weighing range	1596
Reserve 1	Reserve	SHORT	2	rw	0	0	-	1598
Reserve 2	Reserve	USHORT	2	rw	0	0	-	1599

10.16.1 Weight simulation specification

Only use weight simulation values which are within the measuring range of the scales. The word "TEST" is displayed on the main display during simulation and a status bit is set. From the start of simulation onward, all parameterized limits, inputs and outputs etc. refer to the simulation weight.

10.17 DR 17 analog output control specifications

If data record DR 17 is configured as the source for the analog output (see Analog output source (Page 115)), specifying a control output sends a corresponding output current at the analog output.

Procedure

- In data record DR 7, check that "Control by DR17" has been configured as the source for the analog output
- Check the analog output configuration (see Analog output source (Page 115))
- Enter a value in data record DR 17
- Transfer the data record to the scales

Table 10-15 Assignment of data record 17

Variable	Note	Type	Length (bytes)	Rw	Default	Min.	Max.	Modbus registers
Data record number	Contains no. of data record	USHORT	2	r	17	-	-	1600
Length	Data record length information	USHORT	2	r	16	-	-	1601
Application	Information about which application the data record belongs to	USHORT	2	r	101	-	-	1602
Version identifier	Information about current data record version	USHORT	2	r	1	1	65635	1603
Analog output specification (Page 129)	Value which is to be output (only relevant if source is "External specification", see DR 7)	FLOAT	4	rw	0	-	-	1604
Reserve 1	Reserve	SHORT	2	rw	0	0	-	1606
Reserve 2	Reserve	USHORT	2	rw	0	0	-	1607

10.17.1 Analog output specification

The value to be entered must be between the start value (Page 115) and the end value (Page 115) of the analog output.

10.18 DR 18 digital output control specifications

If a digital output is defined in data record DR 7 for control with data record DR 18 (see Assignment for digital output 0, 1, 2, 3 (Page 113)), you can control this output with data record DR 18. Transfer is always for all four digital outputs. Only outputs which are configured for control by DR 18 (see DR 7 interface parameters (Page 109)) are enabled or disabled in accordance with the content of data record DR 18.

Procedure

- Check or adapt the desired parameter settings of the digital outputs in data record 7
- Define the value for digital output 0, 1, 2, 3
- Transfer the data record to the scales

Table 10-16 Assignment of data record 18

Variable	Note	Type	Length (bytes)	Rw	Default	Min.	Max.	Modbus registers
Data record number	Contains no. of data record	USHORT	2	r	18	-	-	1608
Length	Data record length information	USHORT	2	r	12	-	-	1609

10.18 DR 18 digital output control specifications

Variable	Note	Type	Length (bytes)	Rw	Default	Min.	Max.	Modbus registers
Application	Information about which application the DR belongs to	USHORT	2	r	101	-	-	1610
Version identifier	Information on current data record version	USHORT	2	r	1	1	65635	1611
Specification for digital output 0, 1, 2, 3 (Page 130)	Specification for digital output 0=1 -> DA0 output enabled (only applies if output is assigned code 21, see DR 7)	BIT	0	rw	0	0	1	1612.16
	Specification for digital output 1=1 -> DA1 output enabled (only applies if output is assigned code 21, see DR 7)	BIT	0	rw	0	0	1	1612.15
	Specification for digital output 2=1 -> DA2 output enabled (only applies if output is assigned code 21, see DR 7)	BIT	0	rw	0	0	1	1612.14
	Specification for digital output 3=1 -> DA3 output enabled (only applies if output is assigned code 21, see DR 7)	BIT	0	rw	0	0	1	1612.13
Bit 4	Reserve	BIT	0	rw	0	0	1	1612.12
Bit 5	Reserve	BIT	0	rw	0	0	1	1612.11
Bit 6	Reserve	BIT	0	rw	0	0	1	1612.10
Bit 7	Reserve	BIT	0	rw	0	0	1	1612.9
Bit 8	Reserve	BIT	0	rw	0	0	1	1612.8
Bit 9	Reserve	BIT	0	rw	0	0	1	1612.7
Bit 10	Reserve	BIT	0	rw	0	0	1	1612.6
Bit 11	Reserve	BIT	0	rw	0	0	1	1612.5
Bit 12	Reserve	BIT	0	rw	0	0	1	1612.4
Bit 13	Reserve	BIT	0	rw	0	0	1	1612.3
Bit 14	Reserve	BIT	0	rw	0	0	1	1612.2
Bit 15	Reserve	BIT	2	rw	0	0	1	1612.1
Reserve 1	Reserve	USHORT	2	rw	0	-	-	1613

10.18.1 Specification for digital output 0, 1, 2, 3

Digital outputs 0 to 3 can be controlled using data record 18 with this parameter. This function can be used for commissioning purposes, for example.

10.19 DR 30 current process values

Current states and process values in the scales can be monitored using process values and advanced process values from data record DR 31. Monitoring selected data during commissioning is extremely useful as it helps you to optimize parameters.

Procedure

- Read data record DR 30 cyclically or on a time-triggered basis
- Display/analyze the required tags

It is not always necessary to cyclically read data record DR 30. If the relevant process tags are already selected in data record DR 14, they are immediately transferred via the I/O interface. In this case, these tags and all status bits and messages are accessible without data record communication.

Table 10-17 Assignment of data record 30

Variable	Note	Type	Length (bytes)	Rw	Default	Min.	Max.	Modbus registers
Data record number	Contains no. of data record	USHORT	2	r	30	-	-	3000
Length	Data record length information	USHORT	2	r	60	-	-	3001
Application	Information on which application the data record belongs to	USHORT	2	r	101	-	-	3002
Version identifier	Information on the current data record version	USHORT	2	r	1	1	255	3003
1/4d zero	Set if gross less than $\pm 0.25e$	BIT	2	r	0	-	-	3004.16
9e max	Set if the weight has exceeded the gross weighing range by more than 9 display steps (d)	BIT	0	r	0	-	-	3004.15
Tared	Set if tare memory is not equal to zero	BIT	0	r	0	-	-	3004.14
Manual tare 1 set (pT)	Set if the tare memory is assigned an external specified value 1	BIT	0	r	0	-	-	3004.13
Reserve		BIT	0	r	0	-	-	3004.12
Waiting for standstill	Set if module is waiting for standstill to execute command	BIT	0	r	0	-	-	3004.11
Standstill	Set if standstill condition is met	BIT	0	r	0	-	-	3004.10
		BIT	0	r	0	-	-	3004.9
Empty	Set if "Empty" condition is met	BIT	0	r	0	-	-	3004.8
Limit value 1	Limit value 1 has responded	BIT	0	r	0	-	-	3004.7
Limit value 2	Limit value 2 has responded	BIT	0	r	0	-	-	3004.6
Min violated	Set if min. is violated	BIT	0	r	0	-	-	3004.5
SIWAREX DB – EXC Error	Set if the supply voltage for the load cells is less than 4.7 V	BIT	0	R	0	-	-	3005.15

Variable	Note	Type	Length (bytes)	Rw	Default	Min.	Max.	Modbus registers
SIWAREX DB – Impedance warning	Impedance value of the load cells outside the defined range	BIT	0	R	0	-	-	3005.14
SIWAREX DB - Temperature warning	Temperature of SIWAREX DB outside the defined range	BIT	0	R	0	-	-	3005.13
Digital load cell ready	Set if the digital load cell sends valid telegrams	BIT	0	r	0	-	-	3005.12
Time incorrect	Time incorrect due to empty buffer. Reset the time.	BIT	0	r	0	-	-	3005.11
Trace active	Set if trace is running	BIT	0	r	0	-	-	3005.10
Command error at digit. input	Set with synchronization error by command to digital input	BIT	0	r	0	-	-	3005.9
Calibrated	SIWAREX is calibrated	BIT	0	r	0	-	-	3005.8
Service mode	Service mode is enabled	BIT	0	r	0	-	-	3005.7
Simulation mode	Simulation mode is enabled	BIT	0	r	0	-	-	3005.6
Write protection	Write-protect jumper is enabled	BIT	0	r	0	-	-	3005.5
Analog output disrupted	Analog output fault	BIT	0	r	0	-	-	3005.4
Reserve		BIT	0	r	0	-	-	3005.3
Startup	Startup or restore to recovery point has occurred, deleted after 5 seconds	BIT	0	r	0	-	-	3005.2
Fault status	Operating fault	BIT	0	r	0	-	-	3005.1
1000	Group message "Operating error" present	BIT	2	r	0	-	-	3006.16
Reserve		BIT	0	r	0	-	-	3006.15
1104	Undervoltage	BIT	0	r	0	-	-	3006.14
1105	Load high (Overload)	BIT	0	r	0	-	-	3006.12
1106	Underload	BIT	0	r	0	-	-	3006.11
1002	RAM error	BIT	0	r	0	-	-	3006.10
1102	ADC error	BIT	0	r	0	-	-	3006.9
1005	Reserved	BIT	0	r	0	-	-	3006.8
1003	Checksum error data	BIT	0	r	0	-	-	3006.7
1107	Reserve	BIT	0	r	0	-	-	3006.6
1004	Checksum error program	BIT	0	r	0	-	-	3006.5
Reserve	-	BIT	0	r	0	-	-	3006.4
1001	Watchdog	BIT	0	r	0	-	-	3006.3
Reserve	-	BIT	0	r	0	-	-	3006.2
Reserve	-	BIT	0	r	0	-	-	3006.1
2000	Group message "Technological error" present	BIT	2	0	0	-	-	3007.16
2001	Taring or zeroing timeout	BIT	0	r	0	-	-	3007.15

Variable	Note	Type	Length (bytes)	Rw	Default	Min.	Max.	Modbus regis- ters
2002	Trace not possible since a task is still active	BIT	0	r	0	-	-	3007.14
2003	Zeroing not possible	BIT	0	r	0	-	-	3007.13
Gross process weight (Page 133)	Gross weight (process value)	FLOAT	4	r	0	-	-	3008
Net process weight (Page 134)	Net weight (process value)	FLOAT	4	r	0	-	-	3010
Tare process weight (Page 134)	Tare weight (process value)	FLOAT	4	r	0	-	-	3012
Gross / net weight (Page 134)	Gross or net weight	FLOAT	4	r	0	-	-	3014
Gross / net weight with in- creased resolution (x 10) (Page 134)	Legal trade G/N weight with 10x res- olution	FLOAT	4	r	0	-	-	3016
Tare weight (Page 134)	Tare	FLOAT	4	r	0	-	-	3018
Gross process weight (commis- sioning aid) (Page 134)	Gross weight after dig. Filter 2 (proc- ess value)	FLOAT	4	r	0	-	-	3020
Net process weight (commis- sioning aid) (Page 134)	Net weight after dig. Filter 2 (proc- ess value)	FLOAT	4	r	0	-	-	3022
Refresh counter for process val- ues (Page 134)	Cycle counter incremented by 1 if weight values have been changed	USHORT	2	r	0	-	-	3024
Reserve 1	Reserve	SHORT	2	r	0	-	-	3025
Last report ID (Page 135)	Last generated report ID	ULONG	4	r	0	-	-	3026
Reserve 3	Reserve	FLOAT	4	r	0	-	-	3028

10.19.1 Gross process weight

The current gross weight. Values are rounded as specified in data record DR 3 with the "Decimal places for process values" (Page 94) parameter.

10.19.2 Net process weight

The current net weight. Values are rounded as specified in data record DR 3 with the "Decimal places for process values" (Page 94) parameter.

10.19.3 Tare process weight

The current tare weight. Values are rounded as specified in data record DR 3 with the "Decimal places for process values" (Page 94) parameter.

10.19.4 Gross / net weight

The current weight for the main display. The resolution corresponds to the scale interval (Page 93) specified in data record DR 3.

10.19.5 Gross / net weight with increased resolution (x 10)

The current weight for the main display in higher resolution. The resolution corresponds to the scale interval specified in data record DR 3 x 10.

10.19.6 Tare weight

The current tare weight (scale interval from DR 3). The resolution corresponds to the scale interval specified in data record DR 3.

10.19.7 Gross process weight (commissioning aid)

The current gross weight. Values are rounded as specified in data record DR 3 with the "Decimal places for process values" (Page 94) parameter.

10.19.8 Net process weight (commissioning aid)

The current net weight. Values are rounded as specified in data record DR 3 with the "Decimal places for process values" (Page 94) parameter.

10.19.9 Refresh counter for process values

Measured values are calculated every 10 ms in the SIWAREX module. A counter is incremented by 1 each time. Once the counter reaches the value 65536, it starts again from zero. The counter can be used as a time stamp for data record DR 30.

10.19.10 Last report ID

The last generated report ID is displayed.

10.20 DR 31 advanced current process values

Current states and process values in the scales can be monitored using advanced process values and process values (DR 30). This data is not required for standard operation of the scales.

Monitoring selected data during trial operation is extremely useful as it helps you to optimize parameters.

Procedure

- Read data record DR 31
- Display/analyze the required tags

Table 10-18 Assignment of data record 31

Variable	Note	Type	Length (bytes)	Rw	Default	Min.	Max.	Modbus registers
Data record number	Contains no. of data record	USHORT	2	r	31	-	-	3300
Length	Data record length information	USHORT	2	r	32	-	-	3301
Application	Information about which application the data record belongs to	USHORT	2	r	101	-	-	3302
Version identifier	Information about current data record version	USHORT	2	r	1	1	65635	3303
Unfiltered digit value (Page 136)	Unfiltered digit value of AD converters / digital load cells	LONG	4	r	0	-	-	3304
Filtered digit value (Page 136)	Filtered digit value of AD converters or digital load cells after dig. filter 1	LONG	4	r	0	-	-	3306
Filtered digit value (commissioning aid) (Page 136)	Filtered digit value of AD converters or digital load cells after dig. filter 2	LONG	4	r	0	-	-	3308
Reserve		SHORT	2	r	0	-100	100	3310
Digits for analog output (Page 136)	Digit value of the analog output currently being output	USHORT	2	r	0	0	65535	3311
Current status of input 0, 1, 2, 3 (Page 136)	Current status of input 0	BIT	0	r	0	0	1	3312.16
	Current status of input 1	BIT	0	r	0	0	1	3312.15
	Current status of input 2	BIT	0	r	0	0	1	3312.14
	Current status of input 3	BIT	0	r	0	0	1	3312.13
Bit 4	Reserve	BIT	0	r	0	0	1	3312.12
Bit 5	Reserve	BIT	0	r	0	0	1	3312.11
Bit 6	Position of DIP switch 1	BIT	0	r	0	0	1	3312.10

Variable	Note	Type	Length (bytes)	Rw	Default	Min.	Max.	Modbus registers
Bit 7	Position of DIP switch 2	BIT	0	r	0	0	1	3312.9
Current status of digital output 0, 1, 2, 3 (Page 137)	Current status of output 0	BIT	0	r	0	0	1	3312.8
	Current status of output 1	BIT	0	r	0	0	1	3312.7
	Current status of output 2	BIT	0	r	0	0	1	3312.6
	Current status of output 3	BIT	0	r	0	0	1	3312.5
Reserve		BIT	0	r	0	0	1	3312.4
Reserve		BIT	0	r	0	0	1	3312.3
Reserve		BIT	0	r	0	0	1	3312.2
Reserve		BIT	2	r	0	0	1	3312.1
Refresh counter for process values (Page 137)	Refresh counter incremented by 1 if weight values were changed	USHORT	2	r	0	-	-	3313
Current load cell signal in mV (Page 137)	Currently measured load cell signal	FLOAT	4	r	0	-	-	3314

10.20.1 Unfiltered digit value

The unfiltered digit value is the internal measured value immediately before filtering.

10.20.2 Filtered digit value

The filtered digit value is the internal measured value immediately after filtering.

10.20.3 Filtered digit value (commissioning aid)

The filtered digit value is the internal measured value immediately after filtering with the commissioning filter.

10.20.4 Digits for analog output

The current digit value for the digital-to-analog converter for the analog output. The resolution of the analog output is 16 bit.

10.20.5 Current status of input 0, 1, 2, 3

This parameter allows you to check the current status of the digital inputs.

10.20.6 Current status of digital output 0, 1, 2, 3

This parameter allows you to check the current status of the digital outputs.

10.20.7 Refresh counter for process values

Measured values are calculated every 10 ms in the SIWAREX module. A counter is incremented by 1 each time. Once the counter reaches the value 65536, it starts again from zero. The counter can be used as a time stamp for data record DR 30.

10.20.8 Current load cell signal in mV

Display of currently measured signal voltage of the load cell or load cells in mV.

10.21 DR 32 display of data and operator errors

Data record DR 32 is used for Modbus communication with a Modbus master. If a function which is used to write to the holding register is completed with an error, the data or operator error reported can be read from data record DR 32. Messages are displayed for at least five seconds and do not need to be acknowledged in the SIWAREX module.

Data record DR 32 does not need to be polled upon positive completion of a function for writing to the SIWAREX register.

Table 10-19 Assignment of data record 32

Variable	Note	Type	Length (bytes)	Rw	Default	Min.	Max.	Modbus registers
Data record number	Contains no. of data record	USHORT	2	r	32	-	-	3500
Length	Data record length information	USHORT	2	r	28	-	-	3501
Application	Information about which application the data record belongs to	USHORT	2	r	101	-	-	3502
Version identifier	Information about current data record version	USHORT	2	r	1	1	65635	3503
5000	Data or operating error exists	BIT		r	0	0	1	3504.16
5001	Command code or data record unknown	BIT		r	0	0	1	3504.15
5002	Command or data change not possible because write protection is active	BIT		r	0	0	1	3504.14
5003	Leaving calibration mode not possible	BIT		r	0	0	1	3504.13
5004	Command or data transmission only available in service mode	BIT		r	0	0	1	3504.12

Variable	Note	Type	Length (bytes)	Rw	Default	Min.	Max.	Modbus registers
5005	Command or data transmission not possible because service mode is active	BIT		r	0	0	1	3504.11
5006	Command or data transmission not possible because BUSY	BIT		r	0	0	1	3504.10
5007	Command or data transmission not possible because module is faulty or ODIS is active	BIT		r	0	0	1	3504.9
Reserve	-	BIT		r	0	0	1	3504.8
Reserve	-	BIT		r	0	0	1	3504.7
5101	Command is not permissible in this operating state	BIT		r	0	0	1	3504.6
5102	Command not possible because not at standstill	BIT		r	0	0	1	3504.5
5104	Command not possible because range is exceeded	BIT		r	0	0	1	3504.4
5105	Load cell parameter not plausible	BIT		r	0	0	1	3504.3
Reserve		BIT		r	0	0	1	3504.2
5107	Shifting characteristic not possible	BIT		r	0	0	1	3504.1
5199	Error in command to DI	BIT		r	0	0	1	3505.11
6002	Recording not possible because weight invalid	BIT		r	0	0	1	3505.5
7000	Permitted number range violated	BIT		r	0	0	1	3506.16
		BIT		r	0	0	1	3506.15
7001	Regulation code unknown	BIT		r	0	0	1	3506.14
7002	Specifications of string lengths not plausible	BIT		r	0	0	1	3506.13
7003	Specification of date / time not plausible	BIT		r	0	0	1	3506.12
7004	Assignment of digital inputs/ outputs incorrect	BIT		r	0	0	1	3506.11
7006	Command only possible in test field	BIT		r	0	0	1	3506.10
7007	The calibration weights or calibration digits are not plausible	BIT		r	0	0	1	3506.9
7008	Zeroing/zero setting or tare parameter not plausible	BIT		r	0	0	1	3506.8
7009	Standstill range / standstill wait time not plausible	BIT		r	0	0	1	3506.7
7010	Scale interval / rounding not plausible	BIT		r	0	0	1	3506.6
7011	Filter parameter not plausible	BIT		r	0	0	1	3506.5
7013	Interface assignment for verifiable HMI not plausible	BIT		r	0	0	1	3506.4
Reserve	-	BIT		r	0	0	1	3506.3

Variable	Note	Type	Length (bytes)	Rw	Default	Min.	Max.	Modbus regis- ters
Reserve	-	BIT		r	0	0	1	3506.2
7016	Parameter assignment of analog output not plausible	BIT		r	0	0	1	3506.1
7017	MAC address cannot be changed	BIT		r	0	0	1	3607.16
7018	Error in IP mask	BIT		r	0	0	1	3607.15
7019	RS485 parameter error	BIT		r	0	0	1	3607.14
Reserve	-	USHORT	2	r	0	-	-	3504
Reserve	-	USHORT	2	r	0	-	-	3505
Reserve	-	USHORT	2	r	0	-	-	3506
Reserve	-	USHORT	2	r	0	-	-	3507
Reserve	-	USHORT	2	r	0	-	-	3508
Modbus RTU error code (Page 139)	Synchronous error code for communication at the Modbus RS485 interface	USHORT	2	r	0	-	-	3509
Modbus Ethernet error code (Page 139)	Synchronous error code for communication at the Modbus Ethernet interface	USHORT	2	r	0	-	-	3510
SIWATOOL error code (Page 140)	Synchronous error code for communication at the SIWATOOL interface	USHORT	2	r	0	-	-	3511
Error code following commands at digital input (Page 140)	Synchronous error code caused by command at the DI	USHORT	2	r	0	-	-	3512
Reserve	-	USHORT	2	r	0	-	-	3513

10.21.1 Data and operator errors, bytes 0 to 7

Messages are represented by bits in this area. A set bit means that the corresponding message is activated. The message bit is set following a data or operator error and automatically reset approximately 3 seconds later.

Message bits are analyzed by the operator panel message system.

10.21.2 Modbus RTU error code

The error code is displayed here of the error which was triggered last as a result of a command at the Modbus RTU interface.

10.21.3 Modbus Ethernet error code

The error code is displayed here of the error which was triggered last as a result of a command at the Modbus Ethernet interface.

10.21.4 SIWATOOL error code

The error code is displayed here of the error which was triggered last as a result of a command at the SIWATOOL interface.

10.21.5 Error code following commands at digital input

The error code is displayed here of the error which was triggered last as a result of a command via the digital input.

10.22 DR 34 ASCII main display value

The ASCII weight corresponds to the value on the main display of the scales and can be used for a supplementary display or operating display as well as the legal trade main display. Reading of the current weight for legal trade use is only possible with the special SecureDisplay software.

Table 10-20 Assignment of data record 34

Variable	Note	Type	Length (bytes)	Rw	Default	Min.	Max.	Modbus registers
Data record number	Contains no. of data record	USHORT	2	r	34	-	-	4000
Length	Data record length information	USHORT	2	r	26	-	-	4001
Application	Information about which application the DR belongs to	USHORT	2	r	101	-	-	4002
Version identifier	Information about current data record version	USHORT	2	r	1	1	65635	4003
ASCII display string header	Maximum length and actual length of string	UBYTE[2]	2	r	16,2	-	-	4004
Content of main display as ASCII string (Page 140)	For display of legal-for-trade weight value, increased resolution, etc. (see below)	CHAR[16]	16	r	" "	-	-	4005

10.22.1 Content of main display as ASCII string

The following values can be displayed in non-automatic weighing instruments (NAWI) applications:

Gross process value	From DR 30
Net process value	From DR 30
G/N weight	From DR 0
G/N weight x10	From DR 30

Tare	From DR 30
Gross_2 process value	From DR 30
Firmware version	From DR 9
Current calibration regulation	From DR 9
Serial number of module	From DR 9

Below are some display examples. Commands are used to toggle display values.

The values to be displayed are hidden if, for example, a fault is pending or a value is outside the valid display range.

	Value designation		Blank	Display value										Unit of weight (from DR 3)
Weight (Tare ≠ 0)	NET	•	•	•	•	•	2	2	0	.	5	0		•kg•
Weight (Tare = 0)	B	•	•	•	•	•	-	0	.	0	3			•t••
Operator error	•	•	•	•	•	•	1	0	.	0	0	3		HIGH
Weight simulation activated	B	•	•	•	•	•	E	r	r	o	r			TEST
Max+9e exceeded	B	•	•	•	•	•	-	0	.	0	3			****
Tare display activated (pt)	p	T	•	1	2	5	6	7	8	.	9	0		•kg•
Tare display activated	T	•	•	•	•	•	5	0	.	5	0			•kg•

NET = net

B = gross

T = tare

pT = preset tare (tare setting active)

S = sum

10.23 DR 45 protocol request

Scale logs can be saved in the internal memory of the SIWAREX. If necessary, a log can be read out calibration-proofed using the SIWATOOL V7 program or the SecureDisplay and its contents checked.

Using data records DR 45/DR 46, you can read all logs into the SIMATIC S7 (not legal-for-trade, only as operating information). The user enters the log ID for the desired log in DR 45 and then sends DR 45 to the SIWAREX. The log is then made available in DR 46 for reading.

Table 10-21 Assignment of data record 45

Variable	Note	Type	Length (bytes)	Rw	Default	Min.	Max.	Modbus registers
Data record number	Contains no. of data record	USHORT	2	r	45			6000
Length	Data record length information	USHORT	2	r	28			6001

10.24 DR 46 protocol contents

Variable	Note	Type	Length (bytes)	Rw	Default	Min.	Max.	Modbus registers
Application	Information about which application the DR belongs to	USHORT	2	r	101			6002
Version identifier	Information about current data record version	USHORT	2	r	1	1	65635	6003
Reserve	Reserve	UBYTE[2]	2	rw	12,12			6004
Reserve	Reserve	CHAR[12]	12	rw	" "	-	-	6005
Reserve	Reserve	USHORT	2	rw	0			6011
Protocol ID to be read, decimal	ID of requested protocol entry as decimal value	LONG	4	rw	0	1		6012

10.23.1 Protocol ID to be read

The protocol ID of the protocol to be displayed in data record 46 is entered at this point. If the value is zero, the most recently created protocol is always automatically written to data record 46.

The report ID to be read is also used for reading of the report for legal trade use by means of the SecureDisplay.

10.24 DR 46 protocol contents

Protocol data is provided in data record DR 46. The log memory can hold up to 690,000 entries.

Table 10-22 Assignment of data record 46

Variable	Note	Type	Length (bytes)	Rw	Default	Min.	Max.	Modbus registers
Data record number	Contains no. of data record	USHORT	2	r	46			6100
Length	Data record length information	USHORT	2	r	128			6101
Application	Information on which application the DR belongs to	USHORT	2	r	101			6102
Version identifier	Information on the current data record version	USHORT	2	r	1	1	65635	6103
Oldest protocol ID	Oldest protocol ID, 0: No entry available	ULONG	4	r	0	1	4,294,967,295	6104
Newest protocol ID	ID of last saved protocol entry, 0: No entry available	ULONG	4	r	0	1	4,294,967,295	6106
Selected protocol ID, numeric	ID of subsequent protocol entry, 0: No entry available)	ULONG	4	r	0	1	4,294,967,295	6108

Variable	Note	Type	Length (bytes)	Rw	Default	Min.	Max.	Mod-bus registers
Reserve	Reserve	UBYTE[2]	2	r	12,12			6110
Reserve	Reserve	CHAR[12]	12	r	" 0"	" 1"	"4294967295"	6111
Reserve	Reserve	UBYTE[2]	2	r	12,12			6117
Reserve	Reserve	CHAR[12]	12	r	" 0"	" 1"	"4294967295"	6118
Reserve	Reserve	UBYTE[2]	2	r	12,12			6124
Reserve	Reserve	CHAR[12]	12	r	" 0"	" 1"	" 4294967295"	6125
String header for report ID currently selected	String header	UBYTE[2]	2	r	28,28			6131
Gross/net identifier	Gross/net identifier	CHAR[2]	2	r	" "			6132* ¹⁾
Delimiters	Delimiter (semicolon)	CHAR	1	r	","			
G/N weight	G/N weight	CHAR[8]	8	r	" "			
Delimiters	Delimiter (semicolon)	CHAR	1	r	","			
Weight unit	Weight unit	CHAR[4]	4	r	" "			
Delimiters	Delimiter (semicolon)	CHAR	1	r	","			
Tare identifier	Tare identifier No entry: Scale was not tared when logging T: Scale was tared with manual tare when logging pT: Scale was tared with tare specification from DR15 for logging	CHAR[2]	2	r	" "			
Delimiters	Delimiter (semicolon)	CHAR	1	r	","			
Tare	Currently effective tare	CHAR[8]	8	r	" "			
String header for checksum	String header for checksum	UBYTE[2]	2	r	4.4			
CRC16 checksum	Checksum of selected protocol	CHAR[4]	4	r	"0000"			6146
String header for date	String header for date	UBYTE[2]	2	r	10,10			6147
Date	Date	CHAR[10]	10	r	"2012-03-31"			6150
String header for time	String header for time	UBYTE[2]	2	r	8.8			6155
Time	Time	CHAR[8]	8	r	"23:59:59"			6156
String header for supplementary information	String header for supplementary information	UBYTE[2]	2	r	2.2			6100

Variable	Note	Type	Length (bytes)	Rw	Default	Min.	Max.	Modbus registers
Supplementary info	Currently not used	CHAR[4]	4	r	" "			6161
Reserve	Reserve	USHORT	2	r	0			6163

¹⁾ The protocol string is read out as a unit over Modbus (Modbus registers 6132 ... 6145)

10.24.1 Oldest protocol ID

The ID of the first saved protocol is displayed here.

10.24.2 Newest protocol ID

The ID of the last saved protocol is displayed here.

10.24.3 Selected protocol ID, numeric

The ID of the protocol requested in data record 45 and shown in data record 46 is displayed here.

10.24.4 Gross / net identifier

The identifier provides information on whether a gross weight or net weight was logged for the selected ID.

10.24.5 G/N weight

The G/N weight of the selected log is displayed here.

10.24.6 Unit of weight

The unit of weight of the selected log is displayed here.

10.24.7 Tare identification

The tare identification of the selected log is displayed here. The identification shows whether the tare has been entered by the user (semi-automatically) or whether it is a specified tare.

10.24.8 Date, time

The date and time of the selected log are displayed here.

10.25 DR 47 logbook

The changes in the SecureDisplay software versions are recorded in the logbook. If the SIWAREX has established communication with the SecureDisplay, SIWAREX checks whether the software version of the SecureDisplay has changed. Changes are recorded in the logbook. In this manner a more recent version of the SecureDisplay can also be used during operation requiring calibration without the calibration being violated.

The logbook entries are in data record 47. Scrolling in the logbook is possible using commands 881 to 883: → Command lists (Page 75). Legal-for-trade reading of the logbook is carried out using the SecureDisplay.

Table 10-23 Assignment of data record 47

Variable	Note	Type	Length (bytes)	Rw	Default	Min.	Max.	Modbus registers
Data record number	Contains no. of data record	USHORT	2	r	46			6900
Length	Data record length information	USHORT	2	r	128			6901
Application	Information about which application the data record belongs to	USHORT	2	r	101			3902
Version identifier	Information about current data record version	USHORT	2	r	1	1	65635	6903
String header for ID of oldest logbook entry	String header	UBYTE[2]	2	r	8.8			6904
ID of oldest logbook entry	ID of first logbook entry	CHAR[8]	8	r	" 0"	1	99999999	6905
String header for ID of most recent logbook entry	String header	UBYTE[2]	2	r	8.8			6909
ID of most recent logbook entry	ID of last logbook entry	CHAR[8]	8	r	" 0"	1	99999999	6910
String header for selected logbook entry	String header	UBYTE[2]	2	r	8.8			6914
ID of selected logbook entry	ID of selected logbook entry	CHAR[8]	8	r	" 0"	1	99999999	6915
String header for logbook event	String header	UBYTE[2]	2	r	4.4			6919
Logbook event	Currently only logbook for SecureDisplay SW changes, corresponds to entry "HMI"	CHAR[4]	4	r	" "			6920

10.26 DR 48 date and time 2 (for Modbus)

Variable	Note	Type	Length (bytes)	Rw	Default	Min.	Max.	Modbus registers
String header for old SW version	String header	UBYTE[2]	2	r	10.10			6922
Old SW version	Old FW version, e.g. V1.01.03	CHAR[10]	10	r	" "			6923
String header for new SW version	String header	UBYTE[2]	2	r	10.10			6928
New SW version	New FW version, e.g. V1.01.04	CHAR[10]	10	r	" "			6929
CRC16	Checksum of logbook entry	USHORT	2	r	0			6934
Reserve	Reserve	USHORT	2	r	0			6935

10.26 DR 48 date and time 2 (for Modbus)

The SIWAREX module has its own hardware clock. The current date and the time can be set and read using data record DR 48. The clock is buffered with a capacitor and can continue operating for up to approximately 70 hours without supply voltage. If you are not using the Modbus protocol, data record DR 8 is used for the date and time.

Procedure

- Set the date and time
- Transfer the data record to the SIWAREX module

Table 10-24 Assignment of data record 48

Variable	Note	Type	Length (bytes)	Rw	Default	Min.	Max.	Modbus registers
Data record number	Contains no. of the data record	USHORT	2	r	48	-	-	6960
Length	Data record length information	USHORT	2	r	24	-	-	6961
Application	Information on which application the data record belongs to	USHORT	2	r	101	-	-	6962
Version identifier	Information on the current data record version	USHORT	2	r	1	1	65635	6963
Year	Year	USHORT	2	rw	2012	2012	2010	6964
Month	Month	USHORT	2	rw	1	1	12	6965
Day	Day in month	USHORT	2	rw	1	1	31	6966
Hour	Hour	USHORT	2	rw	0	0	23	6967
Minute	Minute	USHORT	2	rw	0	0	59	6968
Second	Second	USHORT	2	rw	0	0	59	6969
Millisecond	Millisecond	USHORT	2	rw	0	0	999	6970
Day of the week	Day of the week	USHORT	2	rw	1	1	7	6971

10.27 DR 59 Parameter string digital load cell

When using a digital load cell of the Wipotec company, the parameters and commands are sent to the cell using the string in DS59. The "Display duration" parameter defines how long the responses of the load cell are displayed in DS34.

The parameter string is transferred once when establishing the communication to the load cell (command 905). The command syntax is identical to the syntax of WIN Term.

Example: The average value filter in the load cell is to be set to 10 and stored.

- Display duration: 2000 ms
- Parameter string: R10;S;

After establishing the communication (command 905), the average value filter is set to 10 and stored. The responses of the cell are shown for 2000 ms in DS34. Then the weight value is displayed.

Table 10-25 Assignment of data record 59

Variable	Note	Type	Length (bytes)	RW	Default	Min.	Max.	Modbus registers
Data record number	Contains no. of data record	USHORT	2	r	59	-	-	7100
Length	Data record length information	USHORT	2	r	28	-	-	7101
Application	Information about which application the DR belongs to	USHORT	2	r	101	-	-	7102
Version identifier	Information on the current data record version	USHORT	2	r	1	1	65635	7103
Display duration	String header Parameter string	USHORT	2	rw	2000	-	-	7104
String header Parameter string	String header Parameter string	UBYTE[2]	2	rw	16,16	-	-	7105
Parameter string	Parameter string	CHAR[16]	16	rw	16,16	-	-	7106

10.28 DR 70 SIWAREX DB parameter

The parameters which define the response in combination with SIWAREX DB are specified in data record DR 70.

If SIWAREX DB is not used, the default settings can be accepted.

Table 10-26 Assignment of data record DR 70

Variable	Note	Data type	Length (bytes)	Rw	Default	Min.	Max.	Modbus registers
Data record number [DR_NO]	Contains no. of data record	USHORT	2	R	70	-	-	7200
Length [DR_LEN]	Data record length information	USHORT	2	R	180	-	-	7201
Application [APPL_ID]	Information on which application the data record belongs to	USHORT	2	R	101	-	-	7202
Version identifier [DR_VERSION]	Information on the current data record version	USHORT	2	r	1	1	65635	7203
Load cell manufacturer [LOAD_CELL_MANUFACTURER]	Load cell manufacturer	CHAR[24]	24	r/w	""	-	-	7205
Load cell order number [LOAD_CELL_ORDER_NUMBER]	Load cell order number	CHAR[24]	24	r/w	""	-	-	7218
Load cell input 1: Location designation of sensor [LOAD_CELL_INPUT_1_LOCATION_TAG]	Location designation of sensor	CHAR[24]	24	r/w	""	-	-	7231
Load cell input 2: Location designation of sensor		CHAR[24]	24	r/w	""	-	-	7244
Load cell input 3: Location designation of sensor		CHAR[24]	24	r/w	""	-	-	7257
Load cell input 4: Location designation of sensor		CHAR[24]	24	r/w	""	-	-	7270
Channel active [LOAD_CELL_ENABLE]	Bit 0: Load cell input 1 [INPUT_1] Bit 1: Load cell input 2 [INPUT_2] Bit 2: Load cell input 3 [INPUT_3] Bit 3: Load cell input 4 [INPUT_4]	USHORT	2	r/w	15	0	15	7282
Sensor type [SENSOR_TYPE]	0: 4-wire sensor 1: 6-wire sensor	USHORT	2	r/w	0	0	1	7283
Total capacity of all load cells [NOMINAL_LOAD]	Total capacity of all load cells	FLOAT	4	r/w	1000	tbd	tbd	7284

10.29 DR 80 SIWAREX DB process status

In data record DR 81, monitor the current statuses and process values in the scales with the help of the SIWAREX DB. To optimize the parameters, monitor selected data when commissioning the scales.

It is not always necessary to cyclically read data record DR 80. Messages and status bits are automatically read out by the function block when a change occurs.

Table 10-27 Assignment of data record DR 80

Variable	Note	Type	Length (bytes)	Rw	Default	Min.	Max.	Modbus registers
Data record number [DR_NO]	Contains no. of data record	USHORT	2	R	80	-	-	7300
Length [DR_LEN]	Data record length information	USHORT	2	R	76	-	-	7301
Application [APPL_ID]	Information on which application the data record belongs to	USHORT	2	R	101	-	-	7302
Version identifier [DR_VERSION]	Information on the current data record version	USHORT	2	r	1	1	65635	7303
Refresh counter [REFRESH_COUNTER]	Cycle counter of the SIWAREX DB incremented by 1 if process values have been changed.	USHORT	2	r	0	0	0xFFFF	7304
Device status [MODULE_ERROR_INFORMATION]	Bit 0: QI flag Bit 1: Load cell input faulty Bit 2: Checksum error Bit 3: Checksum error (data) Bit 4: Watchdog error Bit 5: ADC error Bit 6: Temperature warning Bit 7: Firmware update error	USHORT	2	r	0	-	-	7305
Load cell input 1: Status [LOAD_CELL_INPUT_1_DIAGNOSTIC_INFORMATION]	Bit 0: QI flag Bit 1: Underload Bit 2: Overload Bit 3: SEN error Bit 4: Impedance error Bit 5: EXC short circuit Bit 6: Power supply failure	USHORT	2	r	0	-	-	7307
Load cell input 1: filtered digit value [LOAD_CELL_INPUT_1_DIGITS_FILTERED]	Filtered digit value of AD converter from SIWAREX DB to dig. filter 1	LONG	4	r	0x7FFF FFFF	0x8000 0000	0x7FFF FFFE	7308

Variable	Note	Type	Length (bytes)	Rw	Default	Min.	Max.	Modbus registers
Load cell input 1: Load (%) [LOAD_CELL_INPUT_1_PERCENT-AGE_LOAD]	Current percentual load of the load cell in relation to the rated load of the load cell	FLOAT	4	r	0	-200	200	7310
Load cell input 1: Signal voltage SIG (mV) [LOAD_CELL_INPUT_1_LOAD_CELL_SIG-NAL]	Currently measured load cell signal	Float	4	r	0	-200	200	7312
Load cell input 2: Status	Bit 0: QI flag Bit 1: Underload Bit 2: Overload Bit 3: SEN error Bit 4: Impedance error Bit 5: EXC short circuit Bit 6: Power supply failure	USHORT	2	r	0	-	-	7315
Load cell input 2: Filtered digit value	Filtered digit value of AD converter from SIWAREX DB to dig. filter 1	LONG	4	r	0x7FFF FFFF	0x8000 0000	0x7FFF FFFE	7316
Load cell input 2: Load (%)	Current percentual load of the load cell in relation to the rated load of the load cell	FLOAT	4	r	0	-200	200	7318
Load cell input 2: Signal voltage SIG (mV)	Currently measured load cell signal	Float	4	r	0	-200	200	7320
Load cell input 3: Status	Bit 0: QI flag Bit 1: Underload Bit 2: Overload Bit 3: SEN error Bit 4: Impedance error Bit 5: EXC short circuit Bit 6: Power supply failure	USHORT	2	r	0	-	-	7323
Load cell input 3: Filtered digit value	Filtered digit value of AD converter from SIWAREX DB to dig. filter 1	LONG	4	r	0x7FFF FFFF	0x8000 0000	0x7FFF FFFE	7324
Load cell input 3: Load (%)	Current percentual load of the load cell in relation to the rated load of the load cell	FLOAT	4	r	0	-200	200	7326
Load cell input 3: Signal voltage SIG (mV)	Currently measured load cell signal	Float	4	r	0	-200	200	7328

Variable	Note	Type	Length (bytes)	Rw	Default	Min.	Max.	Modbus registers
Load cell input 4: Status	Bit 0: QI flag Bit 1: Underload Bit 2: Overload Bit 3: SEN error Bit 4: Impedance error Bit 5: EXC short circuit Bit 6: Power supply failure	USHORT	2	r	0	-	-	7331
Load cell input 4: Filtered digit value	Filtered digit value of AD converter from SIWAREX DB to dig. filter 1	LONG	4	r	0x7FFF FFFF	0x8000 0000	0x7FFF FFFE	7332
Load cell input 4: Load (%)	Current percentual load of the load cell in relation to the rated load of the load cell	FLOAT	4	r	0	-200	200	7334
Load cell input 4: Signal voltage SIG (mV)	Currently measured load cell signal	Float	4	r	0	-200	200	7336

10.30 DR 81 SIWAREX DB process status advanced

Current states and process values in the scales can be monitored using SIWAREX DB specific advanced process values and process values from data record DR 80.

Table 10-28 Assignment of data record DR 81

Variable	Note	Type	Length (bytes)	Rw	Default	Min.	Max.	Modbus registers
Data record number [DR_NO]	Contains no. of data record	USHORT	2	R	81	-	-	7338
Length [DR_LEN]	Data record length information	USHORT	2	R	64	-	-	7339
Application [APPL_ID]	Information on which application the data record belongs to	USHORT	2	R	101	-	-	7340
Version identifier [DR_VERSION]	Information on the current data record version	USHORT	2	r	1	1	65635	7341
Excitation voltage EXC (V) [EXCITATION_VOLTAGE]	Excitation voltage EXC (V) with which the load cells are supplied	FLOAT	4	r	0	0	10000	7342

Variable	Note	Type	Length (bytes)	Rw	Default	Min.	Max.	Modbus registers
Load cell input 1: Impedance (Ohm) [LOAD_CELL_INPUT_1_IMPEDANCE]	Current impedance (Ohm) of connected load cell	FLOAT	4	r	0	0	20000	7344
Load cell input 2: Impedance (Ohm)		FLOAT	4	r	0	0	20000	7346
Load cell input 3: Impedance (Ohm)		FLOAT	4	r	0	0	20000	7348
Load cell input 4: Impedance (Ohm)		FLOAT	4	r	0	0	20000	7350
Load cell input 1: Sense voltage SEN (V) [LOAD_CELL_INPUT_1_SENSE_VOLTAGE]	Current voltage (V) which is measured between SENSE+ and SENSE- of the load cell	FLOAT	4	r	0	0	10000	7352
Load cell input 2: Sense voltage SEN (V)		FLOAT	4	r	0	0	10000	7354
Load cell input 3: Sense voltage SEN (V)		FLOAT	4	r	0	0	10000	7356
Load cell input 4: Sense voltage SEN (V)		FLOAT	4	r	0	0	10000	7358
Load cell input 1: Excitation current (mA) [LOAD_CELL_INPUT_1_EXCITATION_CURRENT]	Current excitation current (mA) which is required for the supply of the load cell	FLOAT	4	r	0	0	1999	7360
Load cell input 2: Excitation current (mA)		FLOAT	4	r	0	0	1999	7362
Load cell input 3: Excitation current (mA)		FLOAT	4	r	0	0	1999	7364
Load cell input 4: Excitation current (mA)		FLOAT	4	r	0	0	1999	7366
Temperature (°C) [TEMPERATURE]	Current temperature (°C) of the SIWAREX DB electronic system	FLOAT	4	r	0.0	-50	+150.0	7368

10.31 DR 82 SIWAREX DB device information

You cannot make any entries in data record DR 82. This data record only provides information on the inner workings of the SIWAREX DB. This information is used to identify SIWAREX DB at the manufacturer plant. The entries in the data record are of no importance to the user for operation.

Table 10-29 Assignment of data record DR 82

Variable	Note	Type	Length (bytes)	Rw	Default	Min.	Max.	Modbus registers
Data record number [DR_NO]	Contains no. of data record	USHORT	2	R	82	-	-	7370
Length [DR_LEN]	Data record length information	USHORT	2	R	184	-	-	7371
Application [APPL_ID]	Information on which application the data record belongs to	USHORT	2	R	101	-	-	7372
Version identifier [DR_VERSION]	Information on the current data record version	USHORT	2	r	1	1	65635	7373
Order number [ORDER_NO]	Order number SIWAREX DB	CHAR[32]	32	r	" "	-	-	7375
Serial number [SERIAL_NO]	Serial number SIWAREX DB	CHAR[32]	32	r	" "	-	-	7426
FW version number [FW_VERSION]	FW version number SIWAREX DB	CHAR[16]	16	r	" "	-	-	7443
HW version [HW_VERSION]	HW version SIWAREX DB	CHAR[16]	16	r	" "	-	-	7452
Hardware device ID [HW_DEVICE_ID]	Hardware device ID SIWAREX DB	USHORT	2	r	0	0	31	7460

Technical specifications

11.1 Power supply

Rated voltage	100 ... 240 V AC
Static low / high limits	90 ... 264 V AC
Overcurrent protection	20 A
Rated line frequency value	50 ... 60 Hz
Line frequency range	47 ... 63 Hz
Input current 100 V / 50 Hz	0.15 A
Input current 240 V / 50 Hz	0.1 A

11.2 Analog load cell interface connection

Analog load cell interface connection

Error limit to DIN1319-1 at 20 °C +10 K		≤ 0.05% v.E. ¹⁾
Accuracy according to EN45501 / OIML R76	• Class	III (and IV 1000d)
	• Resolution (d=e)	3000d
	• Error percentage pi	0.4
	• Step voltage	0.5 µV/e
Accuracy delivery state ²⁾		Typ. 0.1% v.E.
Sampling rate		100 Hz
Input signal resolution		± 4000000
Measuring range		± 4 mV/V
Maximum cable length between junction box ↔ WP231/WP251		1000 m (3280 ft)
Common mode voltage range		0 V to 5 V
Supply of the full bridge		4.85 V DC +2/-3 %
Short-circuit and overload protection		Yes
Connection		6-wire
Sensor voltage monitoring		≤ 0.3 V
Resistance of full bridge min.	• Without Ex-i interface SIWAREX IS	40 Ω
	• With Ex-i interface SIWAREX IS	50 Ω
Resistance of full bridge max.		4100 Ω
Temperature coefficient range		≤ ± 5 ppm/K v. E.
Temperature coefficient zero point		≤ ± 0.1 µV/K
Linearity error		≤ 0.002 %

11.2 Analog load cell interface connection

Measured value filtering	Low pass	
Electrical isolation	500 V AC	
50 Hz / 60 Hz noise suppression CMRR	> 80 dB	
Input resistance	• Signal cable	Typ. $5 \cdot 10^6 \Omega$
	• Sensor cable	Typ. $60 \cdot 10^6 \Omega$

¹⁾ Relative accuracy! (Absolute accuracy is only achieved by calibration on-site with calibration standard)

²⁾ Accuracy for module replacement or theoretical Calibration decisive

³⁾ Value valid at sensor; voltage drops on cables are compensated up to 5 V

Analog output

The set replacement value is output in case of a fault or SIMATIC CPU stop.

Error limit according to DIN 1319-1 of full-scale value at 20 °C +10 K	0 ... 20 mA: $\leq 0.5 \%$ 4 ... 20 mA: $\leq 0.3 \%$
Refresh rate	10 ms
Resolution	16-bit
Measuring ranges	0 mA to 20 mA 4 mA to 20 mA
Max. output current	24 mA
Error signal (if configured (FW))	22 mA
Max. load	600 Ω
Temperature coefficient range	$\leq \pm 25$ ppm/K v. E.
Temperature coefficient zero point	typ. $\pm 0.3 \mu\text{A/K}$
Linearity error	$\leq 0.05 \%$
Electrical isolation	500 V AC
Cable length	max. 100 m, twisted and shielded

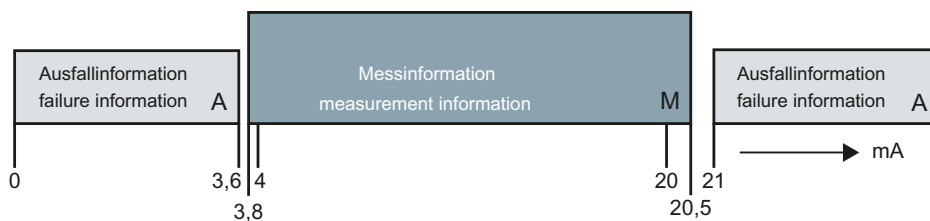


Figure 11-1 Current ranges for signal level to Namur recommendation NE43

Digital outputs (DQ)

The set value is output at the digital output in case of a fault or SIMATIC CPU stop.

A freewheeling diode has to be installed at the consumer with inductive loads at the digital output.

Quantity	4 (high-side switch)
Supply voltage range	19.2 V DC to 28.8 V DC
Max. output current per output	0.5 A (ohmic load)

Max. total current for all outputs	2.0 A
Refresh rate (FW)	100
Switching delay	Typ. 25 μ s turn on Typ. 150 μ s turn off
RDSO _N	< 0.25 Ω
Short-circuit proof	Yes
Electrical isolation	500 V AC
Cable length (meter)	Max. 500 m shielded, 150 m unshielded

Digital inputs (DI)

Table 11-1 Digital inputs up to function version 5 (FS: 05)

Number of inputs	4
Rated voltage	24 V DC
Supply voltage range	max. 30 V DC
Power consumption at 24 V DC	4 mA
Surge voltage	35 V DC for 0.5 s
Logical signal level 1 (min)	15 V DC at 2.5 mA
Logical signal level 0 (max)	5 V DC at 1.0 mA
Sampling rate (FW)	10 ms
Filtering	0.2, 0.4, 0.8, 1.6, 3.2, 6.4 and 12.8 ms
Electrical isolation	500 V DC

Table 11-2 Digital inputs up to function version 8 (FS: 08)

Number of inputs	4
Rated voltage	24 V DC (+20% / -10%)
Supply voltage range	Max. 26.5 V DC
Power consumption at 24 V DC	7 mA
Surge voltage	35 V DC for 0.5 s
Logical signal level 1 (min)	9 V DC @ 2.5 mA
Logical signal level 0 (max)	4 V DC @ 1.0 mA
Sampling rate (FW)	10 ms
Filtering	0.2, 0.4, 0.8, 1.6, 3.2, 6.4 or 12.8 ms
Electrical isolation	500 V DC
Max. cable length	300 m

11.2 Analog load cell interface connection

Real-time clock

Accuracy at 25 °C	Up to function version 5 (FS: 05): $< \pm 15$ s/day As of function version 8 (FS: 08): $< \pm 60$ s/month
Buffered period	Typ. 10 days at 25 °C min. 6 days at 40 °C

RS485 interface

Standard	EIA-485
Baud rate	Up to 115 Kbps
Data bits	7 or 8
Parity	even odd none
Stop bits	1 or 2
Terminating resistors (can be activated)	390 Ω / 220 Ω / 390 Ω
Electrical isolation	500 V AC
Transfer protocol	- Display from the company Siebert, type S102 See section: Connection of Siebert display via RS485 (Page 37) - Operator Panels or other HMI devices with RS485 and Modbus protocol RTU - Communication partner with Modbus protocol RTU - SIWAREX DB See section: Connection of the SIWAREX DB (Page 42)
Cable length	≤ 115 kbps max. 1 000 m (fieldbus cable 2-wire, shielded, e.g. 6XV1830-0EH10)

Ethernet

Standard	IEEE 802.3
Transmission rate	10/100 Mbps (determined automatically)
Electrical isolation	1 500 V AC
Transfer protocol	TCP/IP, Modbus TCP (see /1/)
Autonegotiation	Yes
Auto MDI-X	Yes
Cable lengths	- Cat-5e UTP cable (unshielded) - Cat-5e SF/UTP cable (shielded)
	Max. 50 m
	Max. 100 m

11.3 Rated conditions

Ambient conditions

The use of SIWAREX WP is intended under the following conditions in SIMATIC S7-1200. Additionally observe the operating conditions of the S7-1200 system.

Rated conditions	
Ambient	Interior
Height	2,000 m above sea level
Operating position	Horizontal
Mode	IEC60721-3-3 Class 3M3, 3K3, stationary use, weather-proofed
Storage/transport	IEC 60721-3-2 Class 2K4 without precipitation
Cleaning	Clean the surface of the enclosure with water

Table 11-3 Climatic requirements

Comments		Ambient conditions	Application areas
Operating temperature	Vertical installation in S7-1200	0 ... +40 °C	
Storage and transport temperature		-20 ... +60 °C	
Relative humidity		5 ... 95%	No condensation; corresponds to relative humidity (RH) stress level 2 to DIN IEC 61131-2
Contaminant concentration		SO ₂ : < 0.5 ppm H ₂ S: < 0.1 ppm;	RH < 60%, no condensation
Atmospheric pressure	Operation	IEC 60068-2-13	1 080 ... 795 hPa (operation) (-1 000 ... +2 000 m above sea level)
	Transport and storage	IEC 60068-2-13	1 080 to 660 hPa (storage) (-1 000 to +3 500 m above sea level)

11.4 Dimensions and weights

Dimensions and weights

Dimensions W x H x D	264 x 185 x 97 mm
Weight	4 kg

Mechanical requirements and data

Testing	Standards	Test values
Vibrational load during operation	IEC 61131-2 IEC 60068-2-6 Test Fc	5 to 8.4 Hz: 3.5 mm out. 8.4 to 150 Hz: 9.8 m/s ² (=1G) 0 cycles per axis 1 octave / min.
Shock load during operation	IEC 61131-2 IEC 60068-2-27 Test Ea	150 m/s ² (approx. 15 g), half sine Duration: 11 ms Quantity: 3 each per axis in negative and positive direction
Vibration load during transport	IEC 60068-2-6 Test Fc	5 to 8.4 Hz: 3.5 mm out. 8.4 Hz ... 500 Hz: 9.8 m/s ² 10 cycles per axis 1 octave / min.
Shock load during transport	IEC 60068-2-27: Test Ea	• 250 m/s² (25G), half sine • Duration: 6ms • Quantity: 1 000 each per axis • in negative and positive direction
Free fall	IEC 61131-2 IEC 60068-2-31: Test Ec, procedure 1	• For devices < 10 kg: • In product packaging: 300 mm drop height • In shipping package: 1.0 m drop height • per 5 attempts

11.5 Electrical, EMC and climatic requirements

11.5.1 Electrical protection and safety requirements

Fulfilled requirement	Standards	Comments
Safety regulations	IEC 61010-1 IEC 61131-2; UL 508 CSA C22.2 No.142	
Protection class	IEC 61140	Module is operated with protective extra-low voltage. The protective conductor connection serves only a functional earth to dissipate interference currents
IP degree of protection	IP65 in accordance with IEC 60529	

Fulfilled requirement	Standards	Comments
Air gaps and creepage distances	IEC 60664 IEC 61131-2 IEC 61010-1 UL 508 CSA C22.2 No. 145 EN 50156-1	Overvoltage category II Pollution degree 2 PCB material IIIa Conductor path distance 0.5 mm
Isolation stability	IEC 61131-2 CSA C22.2, No. 142 UL508	Mains - Enclosure: 1500 V AC Mains - SELV Circuits: 3000 V AC

11.5.2 Electromagnetic compatibility

Table 11-4 Requirements: Interference emission in industrial area in accordance with EN 61000-6-4

Comments	Standard	Limits
Emission of radio interferences (electromagnetic fields)	Class B Residential area EN 55011+A1:2010 CISPR 11+a1:2010	30 ... 230 MHz, 40 dB (µV/m) QP 230 ... 1000 MHz, 47 dB (µV/m) QP
Emission on power supply cables 24 V	Class B Residential area EN 55011+A1:2010 CISPR 11+a1:2010	Class A: Industrial environment 0.15 ... 0.5 MHz, 66 – 56 dB (µV) Q¹⁾ 56 – 46 dB (µV) A¹⁾ 0.5 ... 30 MHz: 56 dB (µV) Q 46 dB (µV) A 0.5 ... 30 MHz, 60 dB (µV) Q 50 dB (µV) A

¹⁾ An external protection element has to be installed to meet the requirement (e.g.: Blitzductor VT AD24V, Dehn&Söhne)

Table 11-5 Requirements: Interference immunity in industrial area in accordance with EN 61000-6-2

Comments	Standard	Severity class
Burst pulses on power supply cables	EN 61000-4-4	2 kV - Per polarity 1 min.
Electrostatic discharge (ESD)	EN 61000-4-2	4 kV direct/indirect ≥ 10 discharges pos./neg. < 1 s repeat time
Electrostatic air discharge (ESD)	EN 61000-4-2	8 kV > 10 discharges pos./neg. - All sensitive points

11.5 Electrical, EMC and climatic requirements

Comments	Standard	Severity class
Surge on power supply cables	EN 61000-4-5	1 kV symmetric 2 kV asymmetric 1.2/50 μs (8/20) μs pos./neg. - Internal generator resistance: 2 Ω
RF radiation amplitude modulated	EN 61000-4-3	80 ... 2000 MHz: 10 V/m 2 ... 2.7 GHz: 3 V/m - Mod.: 80% AM with 1 kHz
HF voltage on data, signal and power supply cables 0.15 ... 80 MHz:	EN 61000-4-6	10 kHz ... 80 MHz: 10 V_{eff} - Mod.: 80% AM with 1 kHz

11.5.3 Ambient conditions

Table 11-6 Operating conditions in accordance with IEC 60721

Mode	IEC 60721-3-3 Class 3M3, 3K3, stationary use, weather-proofed
Storage/transport	IEC 60721-3-2 Class 2K4 without precipitation

Table 11-7 Climatic requirements

Comments		Ambient conditions	Application areas
Operating temperature:	Vertical installation	0 ... +40 °C	
Storage and transport temperature		- 20 ... +60 °C	
Relative humidity		5 ... 90%	No condensation; corresponds to relative humidity (RH) stress level 2 to DIN IEC 61131-2
Contaminant concentration		SO ₂ : < 0.5 ppm H ₂ S: < 0.1 ppm;	RH < 60%, no condensation
Atmospheric pressure	Operation	IEC 60068-2-13	1080 ... 795 hPa (operation) (-1000 ... +2000 m above sea level)
	Transport and storage	IEC 60068-2-13	1080 ... 660 hPa (storage) (-1000 ... +3500 m above sea level)

Table 11-8 The Mean Time Between Failure (MTBF) calculation results in the following value:

Electronic Weighing System	MTBF in years
SIWAREX WP231/WP241/WP251	971 years @TA = 40 °C

Ordering data

You can order accessories online: Industry Mall (<https://mallstage.industry.siemens.com/mall/en/b0/Catalog/Products/10174198?tree=CatalogTree>)

Digital remote display

The digital remote displays can be connected directly through the RS485 interface to the SIWAREX WP231, SIWAREX WP251, SIWAREX WP321, SIWAREX WP52x and SIWAREX FTA.

Suitable remote display: S102

Siebert Industrieelektronik GmbH

Postfach 1180

D-66565 Eppelborn, Germany

Tel.: 06806/980-0

Fax: +49 (0)6806/980-999

Internet: Siebert Industrieelektronik GmbH (<http://www.siebert-group.com/en/index.php>)

You can obtain more detailed information from the manufacturer.

Dimension drawings

13.1 Drilling template

Mounting clearances

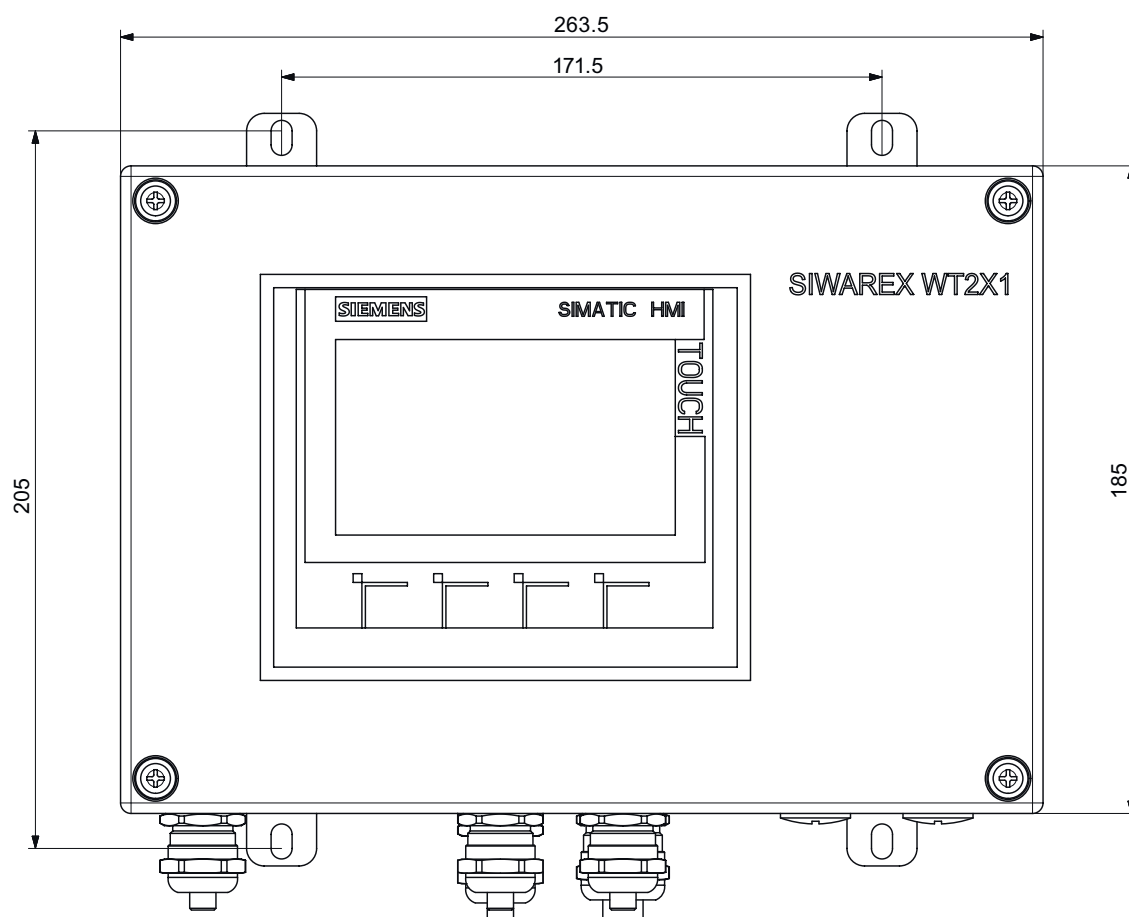


Figure 13-1 Dimensional drawing with mounting clearances/drilling template

ESD guidelines

A.1 ESD Guidelines

Definition of ESD

All electronic modules are equipped with large-scale integrated ICs or components. Due to their design, these electronic elements are highly sensitive to overvoltage, and thus to any electrostatic discharge.

The electrostatic sensitive components/modules are commonly referred to as ESD devices. This is also the international abbreviation for such devices.

ESD modules are identified by the following symbol:



NOTICE

ESD devices can be destroyed by voltages well below the threshold of human perception. These static voltages develop when you touch a component or electrical connection of a device without having drained the static charges present on your body. The electrostatic discharge current may lead to latent failure of a module, that is, this damage may not be significant immediately, but in operation may cause malfunction.

Electrostatic charging

Anyone who is not connected to the electrical potential of their surroundings can be electrostatically charged.

The figure below shows the maximum electrostatic voltage which may build up on a person coming into contact with the materials indicated. These values correspond to IEC 801-2 specifications.

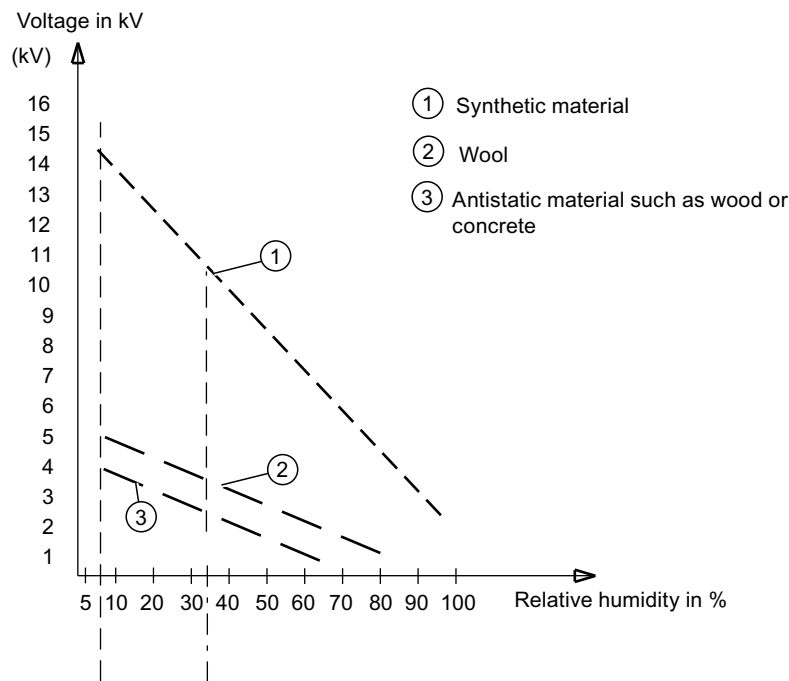


Figure A-1 Electrostatic voltages which an operator can be subjected to

Basic protective measures against electrostatic discharge

- Ensure good equipotential bonding:
When handling electrostatic sensitive devices, ensure that your body, the workplace and packaging are grounded. This prevents electrostatic charge.
- Avoid direct contact:
As a general rule, only touch electrostatic sensitive devices when this is unavoidable (e.g. during maintenance work). Handle the modules without touching any chip pins or PCB traces. In this way, the discharged energy can not affect the sensitive devices.
Discharge your body before you start taking any measurements on a module. Do so by touching grounded metallic parts. Always use grounded measuring instruments.

Product documentation and support

B.1 Product documentation

Product documentation for process instrumentation is available in the following formats:

- Certificates (<http://www.siemens.com/processinstrumentation/certificates>)
- Downloads (firmware, EDDs, software) (<http://www.siemens.com/processinstrumentation/downloads>)
- Catalogs and technical data sheets (<http://www.siemens.com/processinstrumentation/catalogs>)
- Manuals (<http://www.siemens.com/processinstrumentation/documentation>)
You have the option to view, open, save or configure the manual.
 - "Display": The manual opens in HTML5 format.
 - "Configure": You can register and configure the specific documentation for your plant here.
 - "Download": The manual is opened or saved in PDF format.
 - "Download as html5, only PC": The manual is opened or saved in HTML5 view on your PC.

You can also find manuals at Industry Online Support (<https://support.industry.siemens.com/cs/ww/de/sc/2067>) using the mobile app. Download the app to your mobile device and scan the QR code.

See also

Generally applicable information/SIMATIC manual overview (<https://support.industry.siemens.com/cs/ww/en/view/109742709>)

B.2 Technical support

Technical support

If this documentation does not completely answer your technical questions, you can enter a Support Request (<http://www.siemens.com/automation/support-request>).

For help creating a support request, view this video here (www.siemens.com/opensr).

Additional information on our technical support can be found at Technical Support (<http://www.siemens.com/automation/csi/service>).

Service & support on the Internet

In addition to our technical support, Siemens offers comprehensive online services at Service & Support (<http://www.siemens.com/automation/serviceandsupport>).

Contact

If you have further questions about the device, contact your local Siemens representative at Personal Contact (<http://www.automation.siemens.com/partner>).

To find the contact for your product, go to "all products and branches" and select "Products & Services > Industrial automation > Process instrumentation".

Contact address for business unit:

Siemens AG

Digital Industries

Process Automation

Östliche Rheinbrückenstr. 50

76187 Karlsruhe, Germany

SIWAREX support

- Email (<mailto:hotline.siwarex@siemens.com>)
- Phone: +49 (721) 667-1200 CET 8:00 to 17:00

Abbreviations

ASCII	American Standard Code for Information Interchange
B	Gross weight
CPU	Central processor, in this case SIMATIC CPU
DB	Data block
FB	SIMATIC S7 function block
HMI	Human machine interface (e.g. SIMATIC Operator Panel)
HW	Hardware
NAWI	Non-automatic weighing instrument
NAW	Non-automatic scales
OIML	Organisation Internationale de Metrologie Legale
OP	Operator Panel (SIMATIC)
PC	Personal computer
pT	Preset tare (predefined tare weight with manual taring)
RAM	Random access memory
PLC	Programmable logic controller
STEP 7	Programming device software for SIMATIC S7
T	Tare weight
TM	Technology module
TP	Touch Panel (SIMATIC)
UDT	Universal Data Type (S7)
WRP	Write protection
LC	Load cell(s)
NR	Numerical range

Index

A

ASCII, 140

C

Calibration parameters, 86
Catalog
 Technical data sheets, 169
Certificates, 15, 169
Customer Support, (Refer to Technical support)

D

Date and time, 146
 Data record, 116
Default for control of the analog output, 128
Default for control of the digital outputs, 129
Display duration
 Parameter, 147
Display of data and operator errors, 137
Document history, 11
Downloads, 169

E

ESD guidelines, 167
Ethernet parameters, 120

G

Guidelines
 ESD guidelines, 167

H

Hazardous area
 Laws and directives, 15
Hotline, (Refer to Support request)

L

Laws and directives
 Disassembly, 15
 Personel, 15

Log content
 Data record, 142
Log request
 Data record, 141
Logbook, 145

M

Main display value ASCII, 140
Manuals, 169
Modifications
 correct usage, 16
 improper, 16
Module info, 117

P

Parameter
 Display duration, 147
Parameter string
 Digital load cell, 147
Parameters of the analog load cells, 118
Process value
 Data record, 131, 135

R

RS485 interface, 123

S

Scope of delivery, 12
Service, 169
Service and support
 Internet, 169
Simulation value, 127
Support, 169
Support request, 169

T

Technical support, 169
 partner, 170
 personal contact, 170
Test certificates, 15

W

Warranty, 13

Z

Zeroing memory, 103